

OIL ANALYSIS REPORT

Sample Rating Trend

MIX ROOM A [98923530] KR-GR-003109 - E DUMPER 15A (S/N MIX A - 11513055)

Hydraulic System

AW HYDRAULIC OIL ISO 68 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. (Customer Sample Comment: 98923530)

Wear

Area


All component wear rates are normal.

Contamination

Appearance is milky. There is a moderate amount of particulates present in the oil. There is a light concentration of water present in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

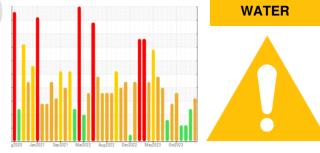



SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0055967	PCA0116665	PCA0111168
Sample Date		Client Info		16 Apr 2024	11 Mar 2024	30 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
WEAR METALS	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	2	0	0
Chromium	ppm	ASTM D5185m	>20	<1	<1	0
Nickel	ppm	ASTM D5185m	>20	0	0	0
Titanium	ppm	ASTM D5185m		<1	<1	0
Silver	ppm	ASTM D5185m		0	0	0
Aluminum	ppm	ASTM D5185m	>20	0	3	0
Lead	ppm	ASTM D5185m	>20	0	0	0
Copper	ppm	ASTM D5185m	>20	<1	<1	0
Tin	ppm	ASTM D5185m	>20	0	<1	0
Vanadium	ppm	ASTM D5185m		<1	<1	0
Cadmium	ppm	ASTM D5185m		0	<1	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0	0	0
Barium	ppm	ASTM D5185m	5	0	0	0
Molybdenum	ppm	ASTM D5185m	5	3	0	0
Manganese	ppm	ASTM D5185m		0	0	0
Magnesium	ppm	ASTM D5185m	25	0	<1	0
Calcium	ppm	ASTM D5185m	200	1	3	<1
Phosphorus	ppm	ASTM D5185m	300	402	481	424
Zinc	ppm	ASTM D5185m	370	0	1	0
Sulfur	ppm	ASTM D5185m	2500	758	560	497
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	4	2	1
Sodium	ppm	ASTM D5185m		3	4	0
Potassium	ppm	ASTM D5185m	>20	0	1	0
Water	%	ASTM D6304	>0.05	A 0.164	▲ 0.246	
ppm Water	ppm	ASTM D6304	>500	1640	4 2460	
FLUID CLEANL	INESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>10000	6159		4 1758
Particles >6µm		ASTM D7647	>2500	<mark> </mark> 3355		3580
Particles >14µm		ASTM D7647	>640	571		55
Particles >21µm		ASTM D7647	>160	192		14
Particles >38µm		ASTM D7647	>40	30		1
Particles >71µm		ASTM D7647	>10	3		0
Oil Cleanliness		ISO 4406 (c)	>20/18/16	e 20/19/16		a 23/19/13
FLUID DEGRAD	OATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045	0.57	0.26	0.20	0.17


Submitted By: Wilberto Pacheco Garcia Page 1 of 2





OIL ANALYSIS REPORT

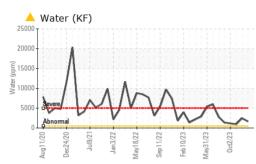

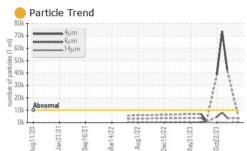

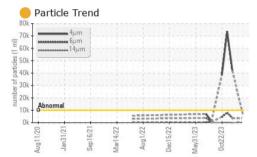


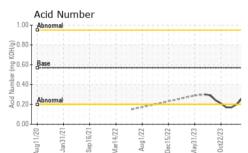

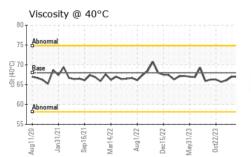



Bottom

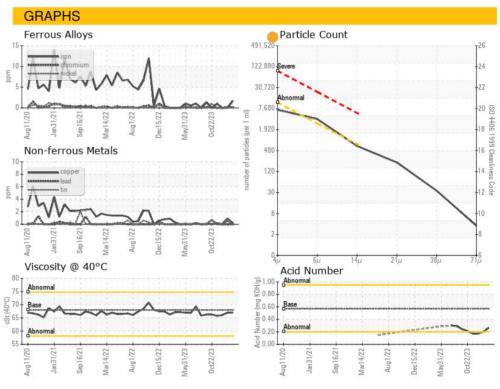



Sample No. : PCA0055967 Received : 22 Apr 2024 2504 INDUSTRIAL DR Tested Lab Number : 06155884 : 26 Apr 2024 Unique Number : 10991307 Diagnosed : 26 Apr 2024 - Jonathan Hester Test Package : IND 2 (Additional Tests: KF) Contact: WALLACE WARD Certificate 12367 To discuss this sample report, contact Customer Service at 1-800-237-1369. wallace.ward@kraftheinzcompany.com * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

Report Id: KRAKIR [WUSCAR] 06155884 (Generated: 04/26/2024 12:24:28) Rev: 1

Laboratory

Submitted By: Wilberto Pacheco Garcia

KraftHeinz - Kirksville - Plant 8333 PCA

Page 2 of 2

US 63501

KIRKSVILLE, MO

T: (660)627-1031

F: (660)627-5887