

## **OIL ANALYSIS REPORT**

Sample Rating Trend



Machine Id **DEEP SOUTH FUEL** Component Hydraulic System AW HYDRAULIC OIL ISO 68 (--- GAL)

### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

#### Wear

All component wear rates are normal.

#### Contamination

There is no indication of any contamination in the oil.


#### Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0124959		
Sample Date		Client Info		03 May 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINA	TION	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR META	LS	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	<1		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>10	0		
Lead	ppm	ASTM D5185m	>10	0		
Copper	ppm	ASTM D5185m	>75	5		
Tin	ppm	ASTM D5185m	>10	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	5	0		
Barium	ppm	ASTM D5185m	5	<1		
Molybdenum	ppm	ASTM D5185m	5	0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m	25	0		
Calcium	ppm	ASTM D5185m	200	93		
Phosphorus	ppm	ASTM D5185m	300	354		
Zinc	ppm	ASTM D5185m	370	414		
Sulfur	ppm	ASTM D5185m	2500	1918		
CONTAMINA		method	limit/base	current	history1	history2
Silicon		ASTM D5185m		<1	TIIStOLA	mstoryz
Sodium	ppm	ASTM D5185m	>20			
Potassium	ppm	ASTM D5185m	. 20	0		
	ppm					
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	*Visual	NONE	NONE		
Yellow Metal	scalar	*Visual	NONE	NONE		
Precipitate	scalar	*Visual	NONE	NONE		
Silt	scalar	*Visual	NONE	NONE		
Debris	scalar	*Visual	NONE	NONE		
Sand/Dirt	scalar	*Visual	NONE	NONE		
Appearance	scalar	*Visual	NORML	NORML		
Odor	scalar	*Visual	NORML	NORML		
Emulsified Water	scalar	*Visual	>0.1	NEG		
Free Water	scalar	*Visual		NEG		
31:31) Rev: 1				Contact/Loc	ation: BILL ME	ADOW - AKIVA



# **OIL ANALYSIS REPORT**

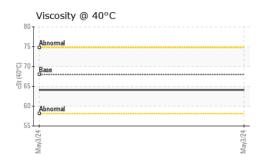

eck USA - 501 Madison Ave., Cary, NC 27513 Arbitra Breceived : 19 May 2024 ar Ersted : 19 May 2024 brow and the second	history1	history2
eck USA - 501 Madison Ave., Cary, NC 27513		
eck USA - 501 Madison Ave., Cary, NC 27513	history1	history2
eck USA - 501 Madison Ave., Cary, NC 27513		
APHS bus Alloys 	no image	no image
APHS bus Alloys 		
APHS bus Alloys 	no image	no image
eck USA - 501 Madison Ave., Cary, NC 27513	nomage	no image
eck USA - 501 Madison Ave., Cary, NC 27513		
eck USA - 501 Madison Ave., Cary, NC 27513 Hereived ::09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513		
ferrous Metals		
eck USA - 501 Madison Ave., Cary, NC 27513 Ages 202 10 202		
eck USA - 501 Madison Ave., Cary, NC 27513 A959 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 A959 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 Received : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
eck USA - 501 Madison Ave., Cary, NC 27513 4959 <b>Received</b> : 09 May 2024		
4959 <b>Received</b> : 09 May 2024		
4959 <b>Received</b> : 09 May 2024		AKINS LL
		TTERSON S
I1 Tested : 10 May 2024   54 Diagnosed : 10 May 2024 - Wes Davis	VA	ALDOSTA, G US 316



To discuss this sample report, contact Customer Service at 1-800-237-1369. \* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Laboratory

Contact/Location: BILL MEADOW - AKIVAL

F:

Contact: BILL MEADOW

bmeadow@akinsfuel.com T: (229)247-1839