


# **OIL ANALYSIS REPORT**

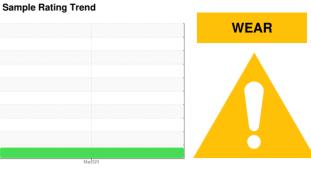

Machine Id 1324143

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- 0

## **DIAGNOSIS**

### Recommendation

Oil and filter change at the time of sampling has been noted. We recommend an early resample to monitor this condition.

The aluminum level is abnormal. Piston wear is indicated.

## Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

AL)		Marž024				
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0111427		
Sample Date		Client Info		05 Mar 2024		
Machine Age	mls	Client Info		175165		
Oil Age	mls	Client Info		175165		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method	7 0.2	NEG		
-						
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	66		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		<1		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	<u> </u>		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	4		
Tin	ppm	ASTM D5185m	>15	<1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	3		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	73		
Manganese	ppm	ASTM D5185m	0	1		
Magnesium	ppm	ASTM D5185m	950	996		
Calcium	ppm	ASTM D5185m	1050	1258		
Phosphorus	ppm	ASTM D5185m	995	1115		
Zinc	ppm	ASTM D5185m	1180	1278		
Sulfur		ACTM DE10E	0000			
Sullur	ppm	ASTM D5185m	2600	3661		
CONTAMINAN		method	limit/base	3661 current	history1	history2
CONTAMINAN					history1	history2
CONTAMINAN Silicon	TS	method ASTM D5185m ASTM D5185m	limit/base	current	•	
CONTAMINAN Silicon Sodium	TS ppm	method ASTM D5185m	limit/base	current 10		
CONTAMINAN Silicon Sodium	TS ppm ppm	method ASTM D5185m ASTM D5185m	limit/base >25	current 10 31		
CONTAMINAN Silicon Sodium Potassium INFRA-RED	TS ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m	limit/base >25 >20	10 31 27		
CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot %	TS ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m method	limit/base >25 >20 limit/base >3	current 10 31 27 current	  history1	  history2
CONTAMINAN Silicon Sodium Potassium	ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m method *ASTM D7844	limit/base >25 >20 limit/base >3	current 10 31 27 current 2.2	  history1	  history2
CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration	ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D7415	limit/base >25 >20 limit/base >3 >20	current  10 31 27 current 2.2 11.4	 history1	history2
CONTAMINAN Silicon Sodium Potassium INFRA-RED Soot % Nitration Sulfation	ppm ppm ppm	method ASTM D5185m ASTM D5185m ASTM D5185m method *ASTM D7844 *ASTM D7624 *ASTM D7415	limit/base	current 10 31 27 current 2.2 11.4 22.8	  history1 	history2



# **OIL ANALYSIS REPORT**

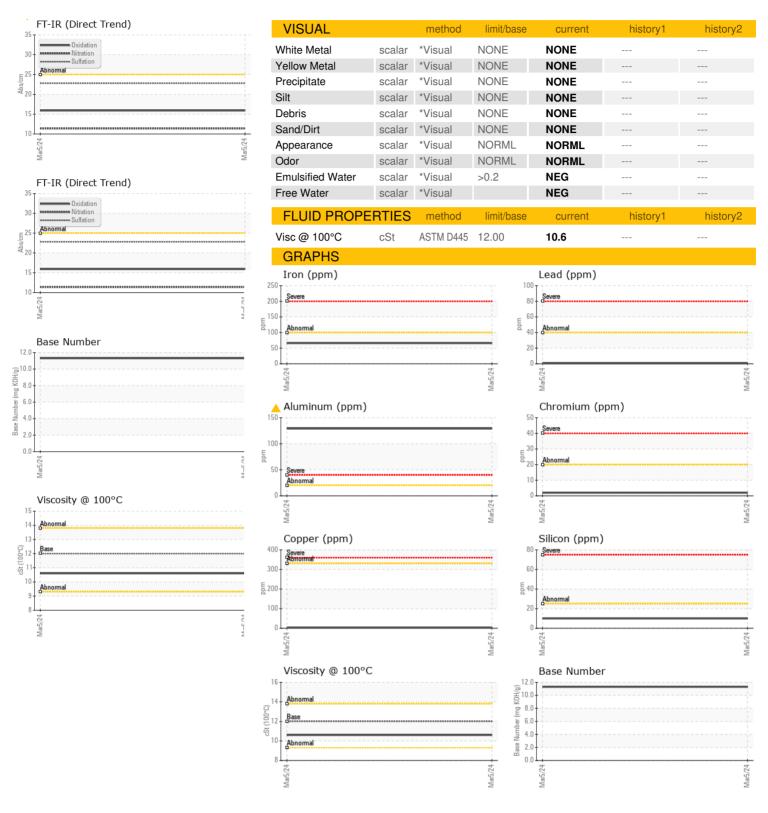



Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513

: PCA0111427 Lab Number : 06188334 Unique Number : 11045086

Received **Tested** Diagnosed

Test Package : MOB 1 ( Additional Tests: TBN )

To discuss this sample report, contact Customer Service at 1-800-237-1369.  $^st$  - Denotes test methods that are outside of the ISO 17025 scope of accreditation. **MILLER TRUCK LEASING #128** 

529 CEDAR LN FLORENCE, NJ US 08518

Contact: PETER SHEPARD pshepard@millertransgroup.com T: (609)499-3601

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

: 22 May 2024

: 28 May 2024

: 28 May 2024 - Jonathan Hester