

# **OIL ANALYSIS REPORT**

T

Sample Rating Trend

WEAR

May 2024

Machine Id **735450** 

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- QTS

## DIAGNOSIS

#### Recommendation

Oil and filter change at the time of sampling has been noted. No corrective action is recommended at this time. Resample at the next service interval to monitor.

### Wear

The aluminum level is abnormal. All other component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil


### **Fluid Condition**

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

TS)			,	May2024		
10)			·	nay2027		
SAMPLE INFOR	RMATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0121068		
Sample Date		Client Info		29 May 2024		
Machine Age	mls	Client Info		132905		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINAT	ΓΙΟΝ	method	limit/base	current	history1	history2
-uel		WC Method	>5	<1.0		
<i>N</i> ater		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	_S	method	limit/base	current	history1	history2
ron	ppm	ASTM D5185m	>100	73		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>4	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	0		
Aluminum	ppm	ASTM D5185m	>20	<u> </u>		
_ead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	70		
- Tin	ppm	ASTM D5185m	>15	4		
/anadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	6		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	64		
Manganese	ppm	ASTM D5185m	0	2		
//agnesium	ppm	ASTM D5185m	950	923		
Calcium	ppm	ASTM D5185m	1050	1264		
Phosphorus	ppm	ASTM D5185m	995	1008		
Zinc	ppm	ASTM D5185m	1180	1275		
Sulfur	ppm	ASTM D5185m	2600	2446		
CONTAMINAN	NTS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	8		
Sodium	ppm	ASTM D5185m		3		
Potassium	ppm	ASTM D5185m	>20	31		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1		
Nitration	Abs/cm	*ASTM D7624	>20	13.8		
Sulfation	Abs/.1mm	*ASTM D7415	>30	24.7		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	27.7		
Base Number (BN)	mg KOH/g	ASTM D2896		4.1		
(DIV)						



## **OIL ANALYSIS REPORT**

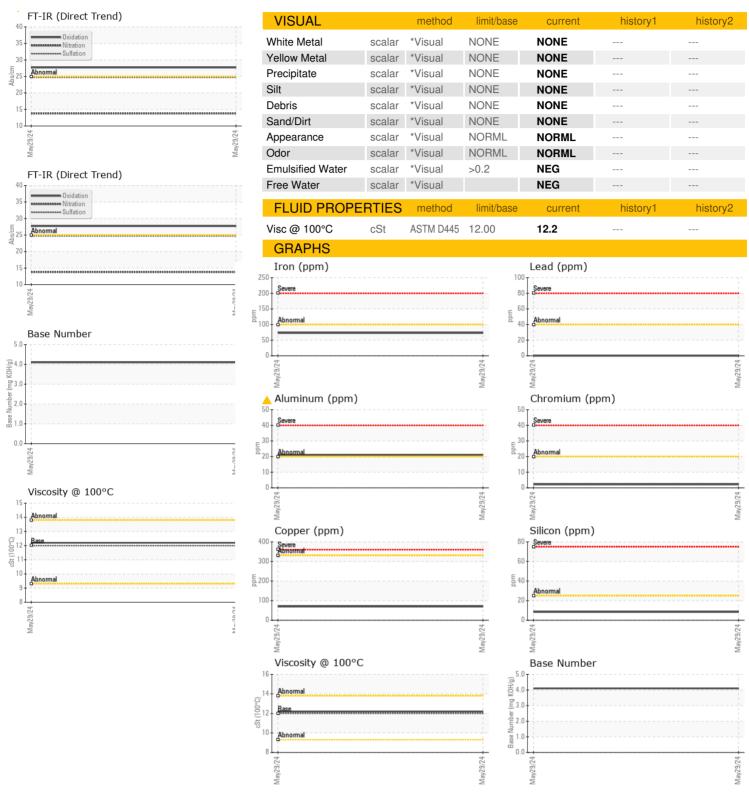





Certificate 12367

Laboratory Sample No.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 : PCA0121068 Lab Number : 06202462 Unique Number : 11069923

Received : 07 Jun 2024 **Tested** Diagnosed

: 11 Jun 2024 : 11 Jun 2024 - Sean Felton

Test Package : MOB 1 ( Additional Tests: TBN ) To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact: ED DAVIS edavis@millertransgroup.com T: (856)214-3521

LOGAN TOWNSHIP, NJ

**MILLER TRUCK LEASING #114** 

63 REPAUPO STATION ROAD

Contact/Location: ED DAVIS - MILLOG

F: (856)214-3663

US 08085