


OIL ANALYSIS REPORT



NORMAL

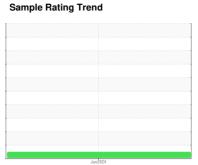

Machine Id 444438

Component

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- Q

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. No other contaminants were detected in the oil.

Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.

rTS)				Jun 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0128906		
Sample Date		Client Info		07 Jun 2024		
Machine Age	mls	Client Info		21972		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATI	ON	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS	3	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	44		
Chromium	ppm	ASTM D5185m	>20	<1		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	60		
Lead	ppm	ASTM D5185m	>40	<1		
Copper	ppm	ASTM D5185m	>330	307		
Tin	ppm	ASTM D5185m	>15	6		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	63		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	55		
Manganese	ppm	ASTM D5185m	0	4		
Magnesium	ppm	ASTM D5185m	950	547		
Calcium	ppm	ASTM D5185m	1050	1644		
Phosphorus	ppm	ASTM D5185m	995	742		
Zinc	ppm	ASTM D5185m	1180	880		
Sulfur	ppm	ASTM D5185m	2600	2526		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	8		
Sodium	ppm	ASTM D5185m		7		
Potassium	ppm	ASTM D5185m	>20	164		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.4		
Nitration	Abs/cm	*ASTM D7624	>20	8.3		
Sulfation	Abs/.1mm	*ASTM D7415	>30	22.2		
FLUID DEGRAD	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	20.9		
Base Number (BN)	mg KOH/g	ASTM D2896		8.4		



OIL ANALYSIS REPORT





Certificate 12367

Laboratory Sample No.

Lab Number : 06209816 Unique Number : 11082680

: PCA0128906

Received

: 14 Jun 2024 **Tested** : 17 Jun 2024 Diagnosed : 17 Jun 2024 - Don Baldridge

Test Package : MOB 1 (Additional Tests: KV40, TBN) To discuss this sample report, contact Customer Service at 1-800-237-1369.

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

Contact: MIKE LONGETTE mlongette@millertransgroup.com T:

Report Id: MILRUT [WUSCAR] 06209816 (Generated: 06/17/2024 14:44:03) Rev: 1

Contact/Location: MIKE LONGETTE - MILRUT

F: (201)528-7053

US 07604

39 INDUSTRIAL AVE

HASBROUCK HEIGHTS, NJ