


OIL ANALYSIS REPORT

_ _ _



NORMAL

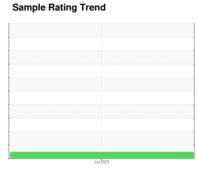

Machine Id **735617**

Diesel Engine

PETRO CANADA DURON SHP 10W30 (--- QTS

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

QTS)				Jun2024		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0123299		
Sample Date		Client Info		18 Jun 2024		
Machine Age	mls	Client Info		151198		
Oil Age	mls	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	.S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	51		
Chromium	ppm	ASTM D5185m	>20	4		
Nickel	ppm	ASTM D5185m	>4	0		
Titanium	ppm	ASTM D5185m		58		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	39		
Lead	ppm	ASTM D5185m	>40	0		
Copper	ppm	ASTM D5185m	>330	28		
Tin	ppm	ASTM D5185m	>15	1		
Vanadium	ppm	ASTM D5185m		<1		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	32		
Barium	ppm	ASTM D5185m	0	0		
Molybdenum	ppm	ASTM D5185m	50	18		
Manganese	ppm	ASTM D5185m	0	1		
Magnesium	ppm	ASTM D5185m	950	561		
Calcium	ppm	ASTM D5185m	1050	1732		
Phosphorus	ppm	ASTM D5185m	995	1057		
Zinc	ppm	ASTM D5185m	1180	1260		
Sulfur	ppm	ASTM D5185m	2600	3869		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	8		
Sodium	ppm	ASTM D5185m		5		
Potassium	ppm	ASTM D5185m	>20	85		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	1.2		
Nitration	Abs/cm	*ASTM D7624	>20	10.1		
Sulfation	Abs/.1mm	*ASTM D7415	>30	23.1		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	17.9		
Base Number (BN)	mg KOH/g	ASTM D2896		6.2		



OIL ANALYSIS REPORT

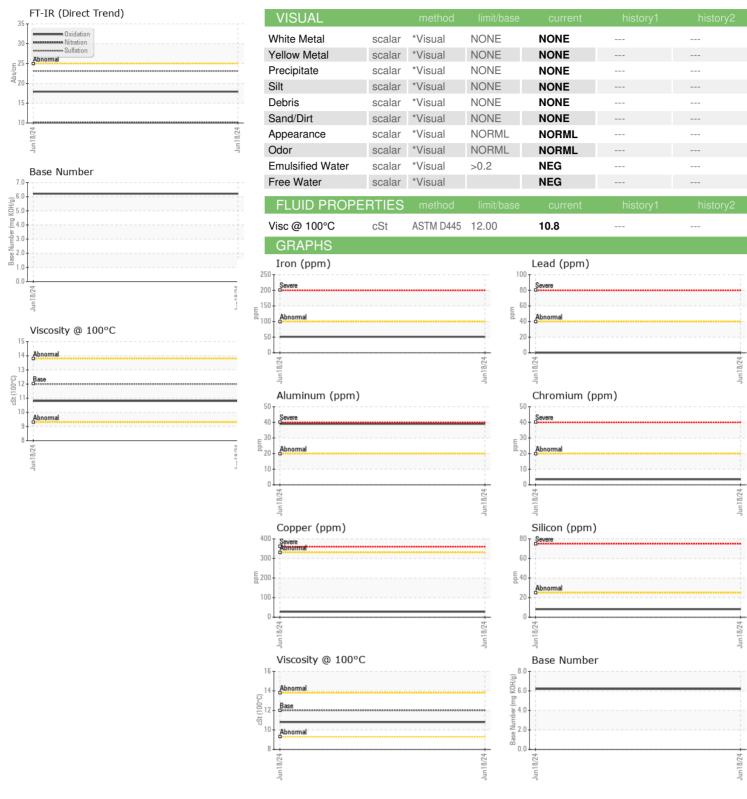





Certificate 12367

Laboratory Sample No.

Lab Number : 06216626

: PCA0123299 Unique Number : 11089490

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2024 **Tested** : 24 Jun 2024 Diagnosed

: 24 Jun 2024 - Sean Felton Test Package : MOB 1 (Additional Tests: TBN)

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

MILLER TRUCK LEASING #117

2666 LEISCZS BRIDGE RD LEESPORT, PA

US 19533 Contact: JAMEY RITZ

jritz@millertransgroup.com T:

Report Id: MILLEEPA [WUSCAR] 06216626 (Generated: 06/24/2024 10:38:55) Rev: 1

Contact/Location: JAMEY RITZ - MILLEEPA

F: