


OIL ANALYSIS REPORT

Walgreens - Tractor [Walgreens - Tractor] 136A624066

Diesel Engine

PETRO CANADA DURON SHP 10W30 (1 Q1

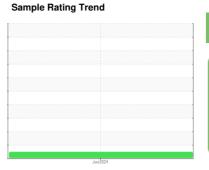



DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. (Customer Sample Comment: Top Up Amount: 1 QT

Wear

Metal levels are typical for a new component breaking in.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the oil.


Fluid Condition

The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is suitable for further service.

TS)				Jun2024		
CAMPLE INCOR	MATION		P 25 #			1
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0117301		
Sample Date		Client Info		10 Jun 2024		
Machine Age	mls	Client Info		15083		
Oil Age	mls	Client Info		15083		
Oil Changed		Client Info		Oil Added		
Sample Status				NORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Fuel		WC Method	>2.0	<1.0		
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>100	37		
Chromium	ppm	ASTM D5185m	>20	2		
Nickel	ppm	ASTM D5185m	>4	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m	>3	<1		
Aluminum	ppm	ASTM D5185m	>20	33		
Lead	ppm	ASTM D5185m	>40	2		
Copper	ppm	ASTM D5185m	>330	26		
Tin	ppm	ASTM D5185m	>15	2		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m	2	81		
Barium	ppm	ASTM D5185m	0	2		
Molybdenum	ppm	ASTM D5185m	50	60		
Manganese	ppm	ASTM D5185m	0	5		
Magnesium	ppm	ASTM D5185m	950	491		
Calcium	ppm	ASTM D5185m	1050	1788		
Phosphorus	ppm	ASTM D5185m	995	972		
Zinc	ppm	ASTM D5185m	1180	1321		
Sulfur	ppm	ASTM D5185m	2600	3646		
CONTAMINAN	ITS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>25	36		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	101		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	*ASTM D7844	>3	0.2		
Nitration	Abs/cm	*ASTM D7624	>20	6.9		
Sulfation	Abs/.1mm	*ASTM D7415	>30	20.3		
FLUID DEGRAI	OATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	*ASTM D7414	>25	16.0		
Base Number (BN)	mg KOH/g	ASTM D2896		8.5		



OIL ANALYSIS REPORT

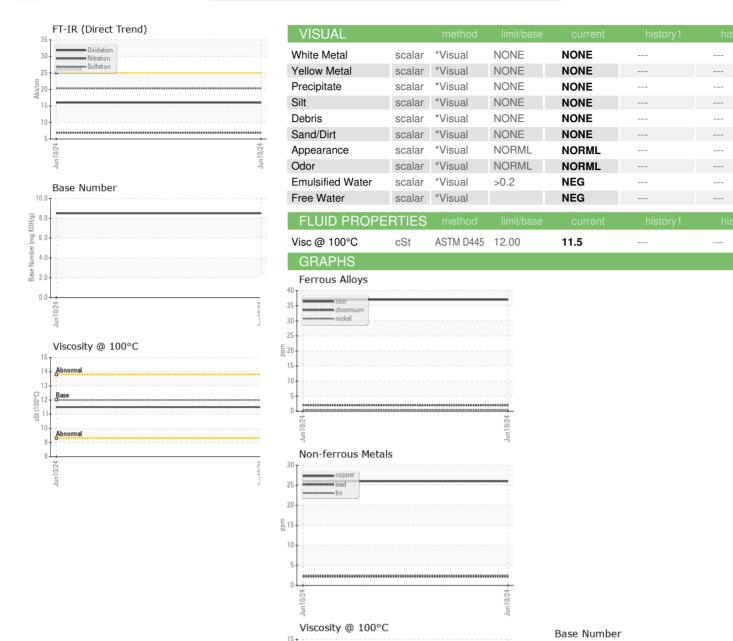





Certificate 12367

Laboratory Sample No.

Lab Number : 06216723

:St (100°C)

: PCA0117301 Unique Number : 11089587 Test Package : FLEET

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 21 Jun 2024

Tested : 24 Jun 2024 Diagnosed

: 24 Jun 2024 - Sean Felton

를 6.0

£ 5.0 흩 4.0 age 2.0 1.0 0.0

Transervice - Shop 1367 - Berkeley-Jupiter

15998 Walgreens Drive Jupiter, FL US 33478

Contact: Manny Gonzalez egonzalez@transervice.com T: (561)776-0755

 st - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: (561)776-0799