


OIL ANALYSIS REPORT

Sample Rating Trend

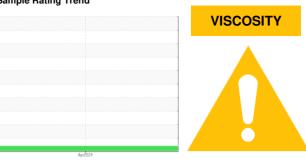

Machine Id

HUNDAI LB-57

Component Rear Left Final Drive

FACTORY FILL 75W85 (--- GAL)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition


The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.


SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		PCA0110041		
Sample Date		Client Info		04 Apr 2024		
Machine Age	hrs	Client Info		160		
Oil Age	hrs	Client Info		160		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINAT	ION	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
WEAR METAL	S	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>500	74		
Chromium	ppm	ASTM D5185m	>10	<1		
Nickel	ppm	ASTM D5185m	>10	<1		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>25	0		
Lead	ppm	ASTM D5185m	>25	0		
Copper	ppm	ASTM D5185m	>50	5		
Tin	ppm	ASTM D5185m	>10	0		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		1		
Barium	ppm	ASTM D5185m		0		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		2		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		23		
Phosphorus	ppm	ASTM D5185m		782		
Zinc	ppm	ASTM D5185m		1		
Sulfur	ppm	ASTM D5185m		26525		
CONTAMINAN	TS	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>75	1		
Sodium	ppm	ASTM D5185m		4		
Potassium	ppm	ASTM D5185m	>20	4		
FLUID DEGRA	DATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D8045		1.76		



Viscosity @ 40°C

OIL ANALYSIS REPORT

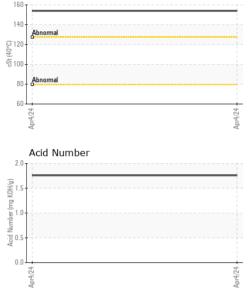

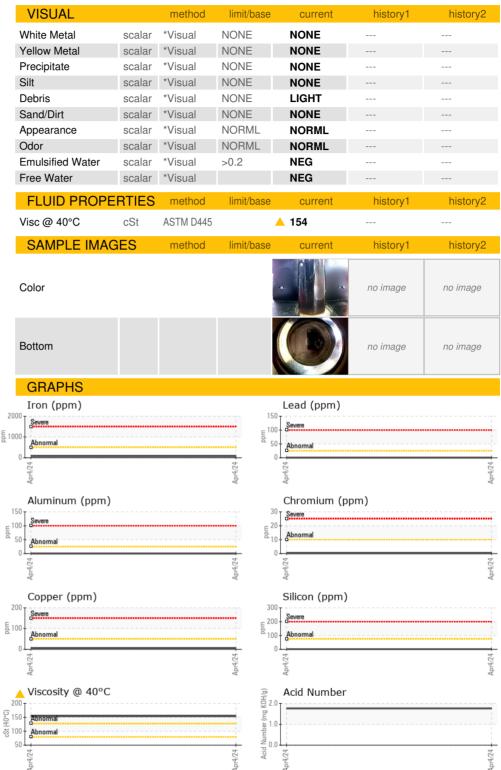





Certificate 12367

Laboratory Sample No.

: PCA0110041 Lab Number : 06223606

Unique Number : 11101803 Test Package : MOB 2

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received : 28 Jun 2024

Tested : 01 Jul 2024 Diagnosed : 01 Jul 2024 - Don Baldridge

LORUSSO BRISTOL STONE CORP 611 PLEASANT ST

WEYMOUTH, MA US 02189 Contact: PAUL MOGAN lbstone611@comcast.net

To discuss this sample report, contact Customer Service at 1-800-237-1369. st - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

T: (781)331-5379 Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012) F: (781)337-8274 Contact/Location: PAUL MOGAN - LORWEYMA