



OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Area

(C-FFOZ)

Machine Id

[C-FFOZ] BOMBARDIER DASH 8-400 SP-EO64645

Component

Auxiliary Power Unit Jet Turbine

Fluid

EASTMAN TURBO OIL 2380 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.
NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal. The direct-reading & analytical ferrographic results are normal indicating no abnormal wear in the system.

Contaminants

The water content is negligible. There is no indication of any contamination in the oil.

Oil Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC0840165	---	---
Sample Date	Client Info	08 Aug 2023	---	---
TSN	hrs Client Info	0	---	---
TSO	hrs Client Info	0	---	---
Oil Age	hrs Client Info	0	---	---
Oil Changed	Client Info	N/A	---	---
Sample Status		NORMAL	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm ASTM D5185(m)	>8	0	---	---
Chromium ppm ASTM D5185(m)	>2	0	---	---
Nickel ppm ASTM D5185(m)	>2	0	---	---
Titanium ppm ASTM D5185(m)	>2	0	---	---
Silver ppm ASTM D5185(m)	>2	0	---	---
Aluminum ppm ASTM D5185(m)	>2	<1	---	---
Lead ppm ASTM D5185(m)	>3	0	---	---
Copper ppm ASTM D5185(m)	>3	0	---	---
Tin ppm ASTM D5185(m)	>2	0	---	---
Antimony ppm ASTM D5185(m)		0	---	---
Vanadium ppm ASTM D5185(m)		0	---	---
Beryllium ppm ASTM D5185(m)		0	---	---
Cadmium ppm ASTM D5185(m)		0	---	---

ADDITIVES

method	limit/base	current	history1	history2
Boron ppm ASTM D5185(m)	0	1	---	---
Barium ppm ASTM D5185(m)	0	0	---	---
Molybdenum ppm ASTM D5185(m)	0	0	---	---
Manganese ppm ASTM D5185(m)		0	---	---
Magnesium ppm ASTM D5185(m)	0	<1	---	---
Calcium ppm ASTM D5185(m)	0	<1	---	---
Phosphorus ppm ASTM D5185(m)	2500	2717	---	---
Zinc ppm ASTM D5185(m)	0	1	---	---
Sulfur ppm ASTM D5185(m)	0	4	---	---
Lithium ppm ASTM D5185(m)		<1	---	---

CONTAMINANTS





method	limit/base	current	history1	history2
Silicon ppm ASTM D5185(m)	>8	<1	---	---
Sodium ppm ASTM D5185(m)		<1	---	---
Potassium ppm ASTM D5185(m)	>20	<1	---	---
Water % ASTM D6304*	>0.1	0.068	---	---
ppm Water ppm ASTM D6304*	>1000	687.7	---	---

FLUID DEGRADATION

method	limit/base	current	history1	history2
Acid Number (AN) mg KOH/g ASTM D974*	0.43	0.36	---	---



OIL ANALYSIS REPORT

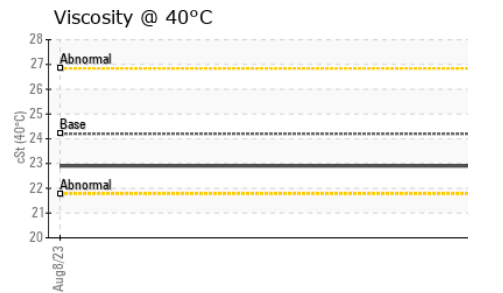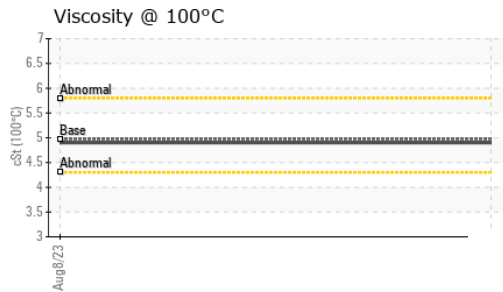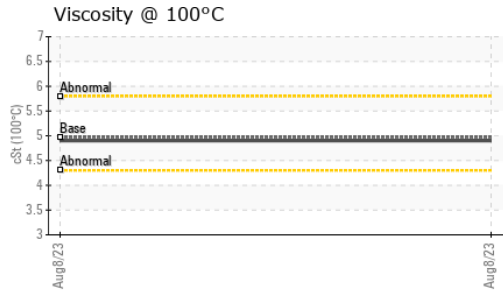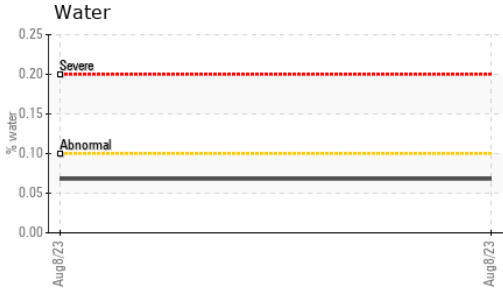





VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	NEG	---	---
Free Water	scalar	Visual*		NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	24.2	22.9	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	4.97	4.9	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	134	142	---	---

SAMPLE IMAGES

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

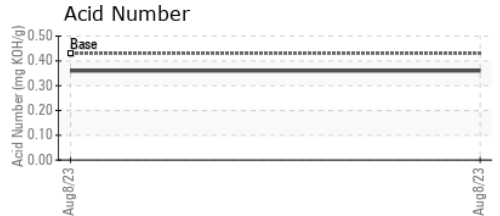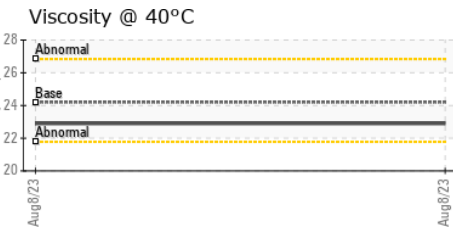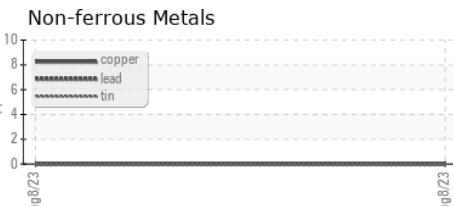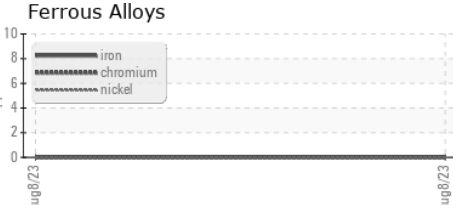



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0840165 **Received** : 11 Aug 2023
Lab Number : **02575354** **Diagnosed** : 11 Aug 2023
Unique Number : 5620405 **Diagnostician** : Kevin Marson
Test Package : AVI 3

SMART AVIATION
 775 COUNTY ROAD 64
 BRIGHTON, ON
 CA K0K 1H0
 Contact: Naji Karroum
 naji.karroum@smartams.ca
 T: (647)215-1688
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

FERROGRAPHY REPORT

Area
(C-FFOZ)
 Machine Id
[C-FFOZ] BOMBARDIER DASH 8-400 SP-EO64645
 Component
Auxiliary Power Unit Jet Turbine
 Fluid
EASTMAN TURBO OIL 2380 (--- GAL)

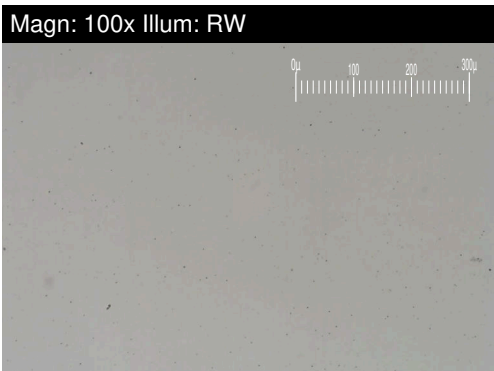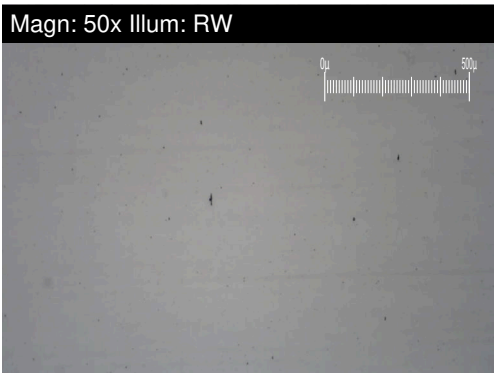


DR-FERROGRAPHY		method	limit/base	current	history1	history2
Large Particles		DR-Ferr*		3.9	---	---
Small Particles		DR-Ferr*		3.7	---	---
Total Particles		DR-Ferr*	>---	7.6	---	---
Large Particles Percentage	%	DR-Ferr*		2.6	---	---
Severity Index		DR-Ferr*		1	---	---

FERROGRAPHY		method	limit/base	current	history1	history2
Ferrous Rubbing	Scale 0-10	ASTM D7684*		1		
Ferrous Sliding	Scale 0-10	ASTM D7684*				
Ferrous Cutting	Scale 0-10	ASTM D7684*				
Ferrous Rolling	Scale 0-10	ASTM D7684*		1		
Ferrous Break-in	Scale 0-10	ASTM D7684*				
Ferrous Spheres	Scale 0-10	ASTM D7684*				
Ferrous Black Oxides	Scale 0-10	ASTM D7684*				
Ferrous Red Oxides	Scale 0-10	ASTM D7684*				
Ferrous Corrosive	Scale 0-10	ASTM D7684*				
Ferrous Other	Scale 0-10	ASTM D7684*				
Nonferrous Rubbing	Scale 0-10	ASTM D7684*				
Nonferrous Sliding	Scale 0-10	ASTM D7684*				
Nonferrous Cutting	Scale 0-10	ASTM D7684*				
Nonferrous Rolling	Scale 0-10	ASTM D7684*				
Nonferrous Other	Scale 0-10	ASTM D7684*				
Carbonaceous Material	Scale 0-10	ASTM D7684*				
Lubricant Degradation	Scale 0-10	ASTM D7684*				
Sand/Dirt	Scale 0-10	ASTM D7684*		1		
Fibres	Scale 0-10	ASTM D7684*				
Spheres	Scale 0-10	ASTM D7684*				
Other	Scale 0-10	ASTM D7684*		1		

WEAR

All component wear rates are normal. The direct-reading & analytical ferrographic results are normal indicating no abnormal wear in the system.

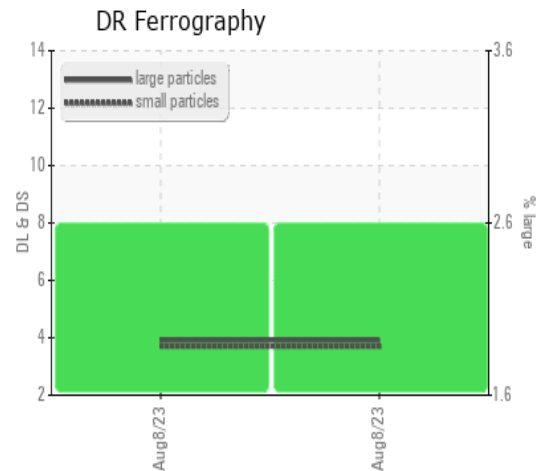

This page left intentionally blank