

PROBLEM SUMMARY


GFL 122 Arrow Road - C13100 **AG174**

Component **Hydraulic System**

NOT GIVEN (--- GAL)

Sample Rating Trend ISO

COMPONENT CONDITION SUMMARY

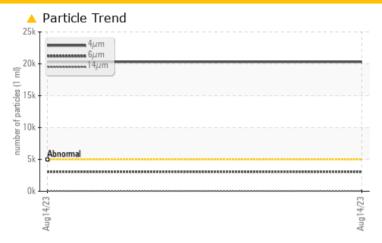

RECOMMENDATION

This is a baseline read-out on the submitted sample. (Customer Sample Comment: IND2-ICP KV AN KF

| PROBLEMATIC TEST RESULTS | | | | | | | | | |
|--------------------------|--------------|-----------|-----------------|--|--|--|--|--|--|
| Sample Status | | | ABNORMAL | | | | | | |
| Particles >4µm | ASTM D7647 | >5000 | 20302 | | | | | | |
| Particles >6µm | ASTM D7647 | >1300 | 3064 | | | | | | |
| Oil Cleanliness | ISO 4406 (c) | >19/17/14 | 22/19/13 | | | | | | |

Customer Id: CHECOB Sample No.: E30000189 Lab Number: 02576324 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Tatiana Sorkina +1 (800)263-3939 tsorkina@e360s.ca

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT


GFL 122 Arrow Road - C13100

AG174

Component

Hydraulic System

NOT GIVEN (--- GAL)

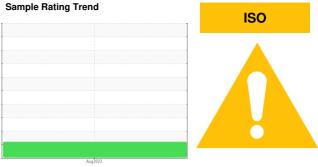

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample. (Customer Sample Comment: IND2-ICP KV AN KF)

{not applicable}

Contamination

Particles >4µm are abnormally high. Particles >6µm and oil cleanliness are abnormally high.


Fluid Condition

{not applicable}

| | | | | Aug2023 | | |
|--------------------|--------|---------------|-------------|---------------|----------|----------|
| SAMPLE INFORM | MATION | method | limit/base | current | history1 | history2 |
| Sample Number | | Client Info | | E30000189 | | |
| Sample Date | | Client Info | | 14 Aug 2023 | | |
| Machine Age | hrs | Client Info | | 0 | | |
| Oil Age | hrs | Client Info | | 0 | | |
| Oil Changed | | Client Info | | Not Changd | | |
| Sample Status | | | | ABNORMAL | | |
| WEAR METALS | | method | limit/base | current | history1 | history2 |
| Iron | ppm | ASTM D5185(m) | >20 | 3 | | |
| Chromium | ppm | ASTM D5185(m) | >20 | <1 | | |
| Nickel | ppm | ASTM D5185(m) | >20 | 0 | | |
| Titanium | ppm | ASTM D5185(m) | | 0 | | |
| Silver | ppm | ASTM D5185(m) | | 0 | | |
| Aluminum | ppm | ASTM D5185(m) | >20 | <1 | | |
| Lead | ppm | ASTM D5185(m) | >20 | 4 | | |
| Copper | ppm | ASTM D5185(m) | >20 | 6 | | |
| Tin | ppm | ASTM D5185(m) | >20 | 0 | | |
| Antimony | ppm | ASTM D5185(m) | | 0 | | |
| Vanadium | ppm | ASTM D5185(m) | | 0 | | |
| Beryllium | ppm | ASTM D5185(m) | | 0 | | |
| Cadmium | ppm | ASTM D5185(m) | | 0 | | |
| ADDITIVES | | method | limit/base | current | history1 | history2 |
| | | | IIIIII/Dase | | TilStory | HISTOTYZ |
| Boron | ppm | ASTM D5185(m) | | <1 | | |
| Barium | ppm | ASTM D5185(m) | | 0 | | |
| Molybdenum | ppm | ASTM D5185(m) | | 0 | | |
| Manganese | ppm | ASTM D5185(m) | | <1 | | |
| Magnesium | ppm | ASTM D5185(m) | | 5 | | |
| Calcium | ppm | ASTM D5185(m) | | 53 | | |
| Phosphorus | ppm | ASTM D5185(m) | | 359 | | |
| Zinc | ppm | ASTM D5185(m) | | 383 | | |
| Sulfur | ppm | ASTM D5185(m) | | 911 | | |
| Lithium | ppm | ASTM D5185(m) | | <1 | | |
| CONTAMINANTS | | method | limit/base | current | history1 | history2 |
| Silicon | ppm | ASTM D5185(m) | >15 | <1 | | |
| Sodium | ppm | ASTM D5185(m) | | 2 | | |
| Potassium | ppm | ASTM D5185(m) | >20 | <1 | | |
| Water | % | ASTM D6304* | >0.05 | 0.002 | | |
| ppm Water | ppm | ASTM D6304* | >500 | 22.1 | | |
| FLUID CLEANLIN | IESS | method | limit/base | current | history1 | history2 |
| Particles >4µm | | ASTM D7647 | >5000 | 20302 | | |
| Particles >6µm | | ASTM D7647 | >1300 | △ 3064 | | |
| Particles >14µm | | ASTM D7647 | >160 | 58 | | |
| Particles >21µm | | ASTM D7647 | >40 | 11 | | |
| Particles >38µm | | ASTM D7647 | >10 | 2 | | |
| Particles >71µm | | ASTM D7647 | >3 | 1 | | |
| Tartiolog >7 Tarif | | 710111121011 | - 0 | • | | |



OIL ANALYSIS REPORT

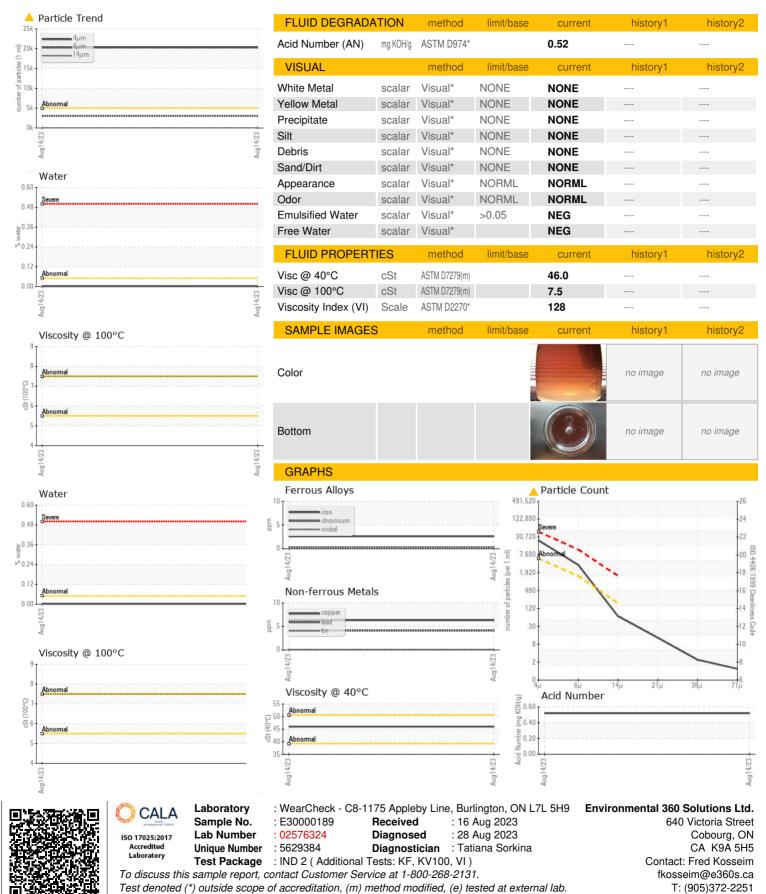

Validity of results and interpretation are based on the sample and information as supplied.

F: (905)372-1658