

PROBLEM SUMMARY

Sample Rating Trend

ISO


Societe via Quebec City - 888017 **XB094**

Component **Hydraulic System**

NOT GIVEN (--- GAL)



COMPONENT CONDITION SUMMARY

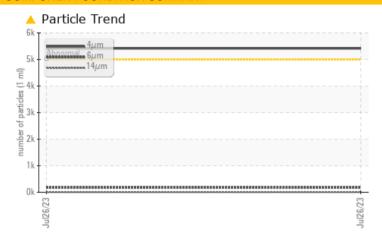

RECOMMENDATION

This is a baseline read-out on the submitted sample.

PROBLEMATIC T	EST RESULTS				
Sample Status			ATTENTION	 	
Particles >4µm	ASTM D7647	>5000	<u></u> 5417	 	
Oil Cleanliness	ISO 4406 (c)	>19/17/14	20/15/10	 	

Customer Id: CHECOB Sample No.: E30000066 Lab Number: 02576345 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Tatiana Sorkina +1 (800)263-3939 tsorkina@e360s.ca

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS




OIL ANALYSIS REPORT

Societe via Quebec City - 888017 **XB094**

Component

Hydraulic System

NOT GIVEN (--- GAL)

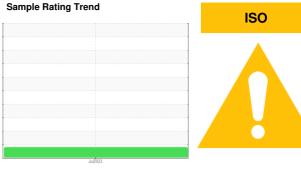

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

Contamination

Particles >4µm and oil cleanliness are notably high.


Fluid Condition

{not applicable}

				Jul2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		E30000066		
Sample Date		Client Info		26 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ATTENTION		
WEAR METALS		method	limit/base	current	history1	history2
ron	ppm	ASTM D5185(m)	>20	3		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>20	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	1		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		6		
Calcium	ppm	ASTM D5185(m)		52		
Phosphorus	ppm	ASTM D5185(m)		383		
Zinc	ppm	ASTM D5185(m)		444		
Sulfur	ppm	ASTM D5185(m)		1048		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	1		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Water	%	ASTM D6304*	>0.05	0.006		
ppm Water	ppm	ASTM D6304*	>500	62.5		
FLUID CLEANLI	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	<u></u> 5417		
Particles >6µm		ASTM D7647	>1300	179		
Particles >14µm		ASTM D7647	>160	7		
Particles >21µm		ASTM D7647	>40	2		
Particles >38µm		ASTM D7647	>10	0		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	20/15/10		



OIL ANALYSIS REPORT

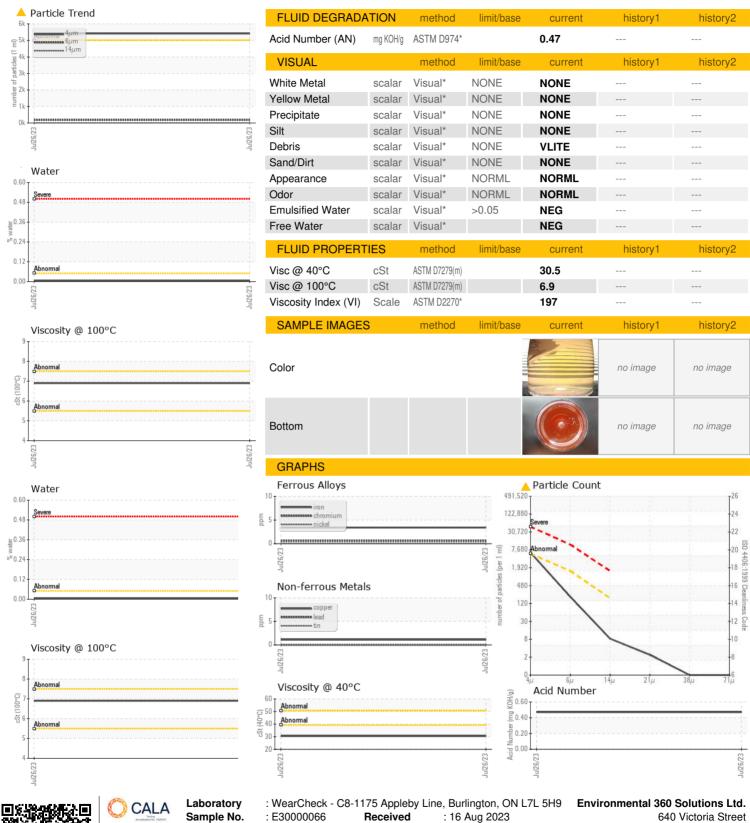



ISO 17025:2017 Accredited

Laboratory

Sample No. Lab Number **Unique Number**

: 02576345

: E30000066

Received : 5629405

Diagnosed : 25 Aug 2023 Diagnostician : Tatiana Sorkina

Test Package : IND 2 (Additional Tests: KF, KV100, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

640 Victoria Street Cobourg, ON **CA K9A 5H5** Contact: Tatiana Sorkina tsorkina@e360s.ca

T: (800)263-3939 F: (905)373-4950