


PROBLEM SUMMARY

Sample Rating Trend

Area Societe via Quebec City - 888017 Machine Id XB098

Component Hydraulic System Fluid NOT GIVEN (--- GAL)

COMPONENT CONDITION SUMMARY

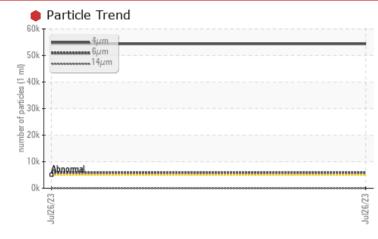

RECOMMENDATION

This is a baseline read-out on the submitted sample.

PROBLEMATIC TEST RESULTS								
Sample Status			SEVERE					
Particles >4µm	ASTM D7647	>5000	e 54355					
Particles >6µm	ASTM D7647	>1300	6 5876					
Oil Cleanliness	ISO 4406 (c)	>19/17/14	e 23/20/12					

Customer Id: CHECOB Sample No.: E3000070 Lab Number: 02576346 Test Package: IND 2



To manage this report scan the QR code

To discuss the diagnosis or test data: Tatiana Sorkina +1 (800)263-3939 tsorkina@e360s.ca

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



Sample Rating Trend

ISO

Area Societe via Quebec City - 888017 XB098

Component Hydraulic System Fluid NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

Contamination

Particles $>4\mu$ m and oil cleanliness are severely high. Particles $>6\mu$ m are abnormally high.


Fluid Condition


{not applicable}


				Jul2023		
SAMPLE INFORM	1ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		E30000070		
Sample Date		Client Info		26 Jul 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				SEVERE		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	3		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>20	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	2		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		6		
Calcium	ppm	ASTM D5185(m)		69		
Phosphorus	ppm	ASTM D5185(m)		300		
Zinc	ppm	ASTM D5185(m)		350		
Sulfur	ppm	ASTM D5185(m)		1526		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	1		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Water	%	ASTM D6304*	>0.05	0.003		
ppm Water	ppm	ASTM D6304*	>500	25.3		
FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	• 54355		
Particles >6μm		ASTM D7647	>1300	5876		
Particles >14µm		ASTM D7647	>160	27		
Particles >21µm		ASTM D7647	>40	3		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	23/20/12		
		. /				



OIL ANALYSIS REPORT

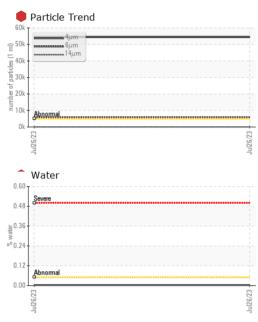

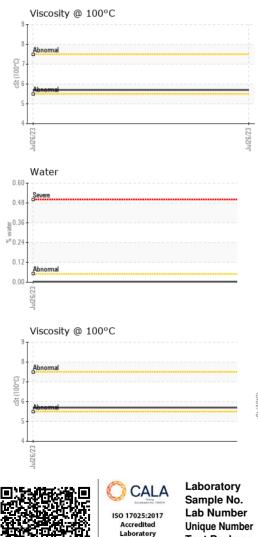

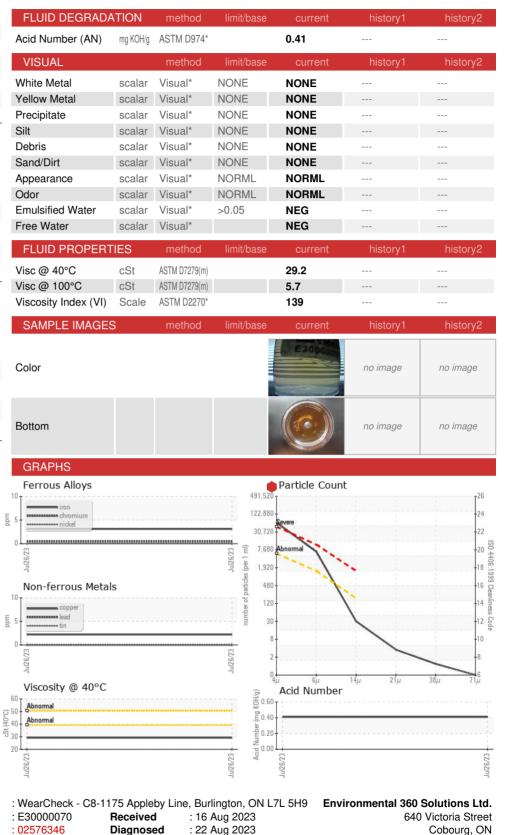

 Test Package
 : IND 2 (Additional Tests: KF, KV100, VI)

 To discuss this sample report, contact Customer Service at 1-800-268-2131.

 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

 Validity of results and interpretation are based on the sample and information as supplied.

: 5629406

Diagnostician : Tatiana Sorkina

CA K9A 5H5 Contact: Tatiana Sorkina tsorkina@e360s.ca T: (800)263-3939 F: (905)373-4950