

PROBLEM SUMMARY

Sample Rating Trend




A

Banbury 2 Machine Id BB02 North Ext Bott

Component **Gearbox**

SHELL OMALA 220 (40 GAL)

COMPONENT CONDITION SUMMARY

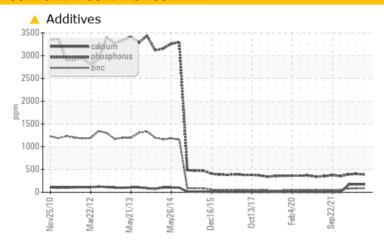

RECOMMENDATION

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				ATTENTION	NORMAL	NORMAL		
Molybdenum	ppm	ASTM D5185(m)	0	<u></u> ▲ 82	80	74		
Calcium	ppm	ASTM D5185(m)	0	<u> </u>	176	171		
Zinc	ppm	ASTM D5185(m)	0	<u>^</u> 87	86	81		

Customer Id: GOONAP Sample No.: WC0841269 Lab Number: 02579781 Test Package: IND 2

To manage this report scan the QR code

To discuss the diagnosis or test data: Kevin Marson +1 (289)291-4644 x4644 Kevin.Marson@wearcheck.com

To change component or sample information: Gloria Gonzalez +1 (289)291-4643 x4643 gloria.gonzalez@wearcheck.com

RECOMMENDED ACTIONS

Action	Status	Date	Done By	Description
Check Fluid Source			?	Confirm the source of the lubricant being utilized for top-up/fill.

HISTORICAL DIAGNOSIS

05 Feb 2023 Diag: Kevin Marson

NORMAL



Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is no indication of any contamination in the oil. Additive levels indicate the addition of a different brand, or type of oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.



27 Oct 2022 Diag: Kevin Marson

NORMAL



Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.All component wear rates are normal. There is no indication of any contamination in the oil. Additive levels indicate the addition of a different brand, or type of oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

view report

05 Nov 2021 Diag: Wes Davis

NORMAL



Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. All component wear rates are normal. There is no indication of any contamination in the oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.





OIL ANALYSIS REPORT

SAMPLE INFORMATION

Sample Rating Trend

ADDITIVES



history2

Banbury 2 **BB02 North Ext Bott**

Component Gearbox

SHELL OMALA 220 (40 GAL)

DIAGNOSIS

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition


Additive levels indicate the addition of a different brand, or type of oil. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

thod	limit/base	curi		
v2010 Mar2012	May2013 May2014	Dec2015 Oct2017	Feb2020	Sep2021
	la faction f	*******		

Sample Number		Client Info		WC0841269	WC0754394	WC0664083
Sample Date		Client Info		25 Aug 2023	05 Feb 2023	27 Oct 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m)	>200	10	8	7
Chromium	ppm	ASTM D5185(m)	>15	0	0	0
Nickel	ppm	ASTM D5185(m)	>15	0	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>25	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>100	<1	<1	1
Copper	ppm	ASTM D5185(m)	>200	2	2	2
Tin	ppm	ASTM D5185(m)	>25	0	0	0
Antimony	ppm	ASTM D5185(m)	>5	0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
,	le le			U	0	
Cadmium	ppm	ASTM D5185(m)		0	0	0
•			limit/base			
Cadmium		ASTM D5185(m)	limit/base 4.4	current	0	0 history2 <1
Cadmium ADDITIVES	ppm	ASTM D5185(m) method		o current	0 history1	0 history2
Cadmium ADDITIVES Boron	ppm	ASTM D5185(m) method ASTM D5185(m)	4.4	current	0 history1	0 history2 <1
Cadmium ADDITIVES Boron Barium	ppm ppm	ASTM D5185(m) method ASTM D5185(m) ASTM D5185(m)	4.4	current 1 0	0 history1 1 0	0 history2 <1 0
Cadmium ADDITIVES Boron Barium Molybdenum	ppm ppm ppm ppm	ASTM D5185(m) method ASTM D5185(m) ASTM D5185(m) ASTM D5185(m)	4.4	0 current 1 0 ▲ 82 0 1	0 history1 1 0 80	0 history2 <1 0 74
Cadmium ADDITIVES Boron Barium Molybdenum Manganese	ppm ppm ppm ppm ppm	ASTM D5185(m) method ASTM D5185(m) ASTM D5185(m) ASTM D5185(m) ASTM D5185(m)	4.4 0.0 0	0 current 1 0 ▲ 82 0	0 history1 1 0 80 0	0 history2 <1 0 74
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium	ppm ppm ppm ppm ppm ppm	Method ASTM D5185(m) method ASTM D5185(m) ASTM D5185(m) ASTM D5185(m) ASTM D5185(m) ASTM D5185(m)	4.4 0.0 0	0 current 1 0 ▲ 82 0 1	0 history1 1 0 80 0 1	0 history2 <1 0 74 0 1
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium	ppm ppm ppm ppm ppm ppm ppm	ASTM D5185(m) method ASTM D5185(m) ASTM D5185(m) ASTM D5185(m) ASTM D5185(m) ASTM D5185(m) ASTM D5185(m)	4.4 0.0 0	0 current 1 0 ▲ 82 0 1 ▲ 171	0 history1 1 0 80 0 1 176	0 history2 <1 0 74 0 1 171
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus	ppm ppm ppm ppm ppm ppm ppm ppm	ASTM D5185(m) method ASTM D5185(m)	4.4 0.0 0 0 0 0 215	0 current 1 0 ▲ 82 0 1 ▲ 171 389	0 history1 1 0 80 0 1 176 402	0 history2 <1 0 74 0 1 171 395
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc	ppm	ASTM D5185(m) method ASTM D5185(m)	4.4 0.0 0 0 0 0 215	0 current 1 0 ▲ 82 0 1 ▲ 171 389 ▲ 87	0 history1 1 0 80 0 1 176 402 86	0 history2 <1 0 74 0 1 171 395 81
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur	ppm	ASTM D5185(m) method ASTM D5185(m)	4.4 0.0 0 0 0 0 215	0 current 1 0 ▲ 82 0 1 ▲ 171 389 ▲ 87 8544	0 history1 1 0 80 0 1 176 402 86 8748	0 history2 <1 0 74 0 1 171 395 81 8440
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur Lithium	ppm	ASTM D5185(m) method ASTM D5185(m)	4.4 0.0 0 0 0 0 215 0 7039	0 current 1 0 ▲ 82 0 1 ▲ 171 389 ▲ 87 8544 <1	0 history1 1 0 80 0 1 176 402 86 8748 <1	0 history2 <1 0 74 0 1 171 395 81 8440 <1
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur Lithium CONTAMINANTS	ppm	ASTM D5185(m) method ASTM D5185(m)	4.4 0.0 0 0 0 215 0 7039	0 current 1 0 82 0 1 171 389 87 8544 <1 current	0 history1 1 0 80 0 1 176 402 86 8748 <1 history1	0 history2 <1 0 74 0 1 171 395 81 8440 <1 history2
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur Lithium CONTAMINANTS Silicon	ppm	ASTM D5185(m) method ASTM D5185(m)	4.4 0.0 0 0 0 215 0 7039	0 current 1 0	0 history1 1 0 80 0 1 176 402 86 8748 <1 history1 12	0 history2 <1 0 74 0 1 171 395 81 8440 <1 history2 11
Cadmium ADDITIVES Boron Barium Molybdenum Manganese Magnesium Calcium Phosphorus Zinc Sulfur Lithium CONTAMINANTS Silicon Sodium	ppm	ASTM D5185(m) method ASTM D5185(m) ASTM D5185(m)	4.4 0.0 0 0 0 215 0 7039	0 current 1 0 ▲ 82 0 1 ▲ 171 389 ▲ 87 8544 <1 current 11 <1	0 history1 1 0 80 0 1 176 402 86 8748 <1 history1 12 <1	0 history2 <1 0 74 0 1 171 395 81 8440 <1 history2 11 0



OIL ANALYSIS REPORT

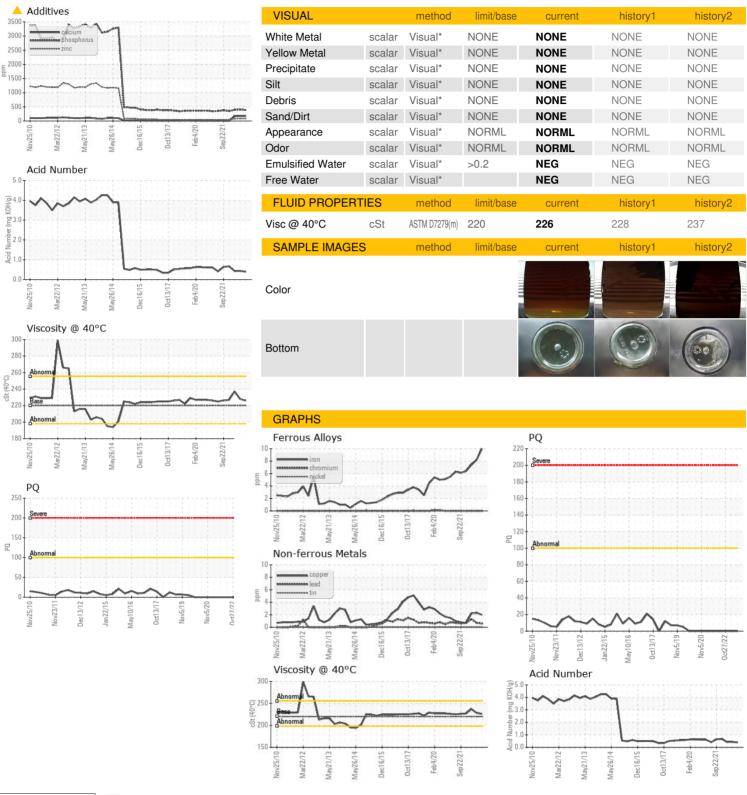



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: WC0841269

: 02579781 : 5632841

Received Diagnosed

: 01 Sep 2023 : Kevin Marson Diagnostician

: 31 Aug 2023

Test Package : IND 2 (Additional Tests: TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Goodyear Napanee

388 GOODYEAR ROAD NAPANEE, ON CA K7R 3L2

Contact: Mohammad Waleed Mohammad_Waleed@goodyear.com

T: (613)354-7709 F: (613)354-9377