




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

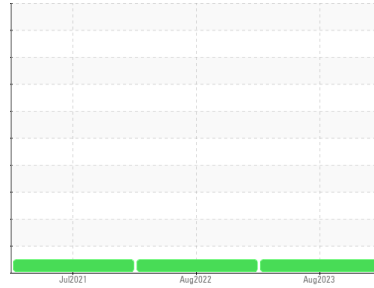

Area
Life Saving Equipment
 Machine Id
MOB DAVIT (S/N HL9D)
 Component
Hydraulic System
 Fluid
CASTROL HYSPIIN HVI 32 (350 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MAR 2 test kits, this testkit includes Particle Count to determine the ISO cleanliness of the fluid. this testkit includes AN to determine the suitability of the oil for continued use.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component(unconfirmed).

Fluid Condition

The condition of the oil is acceptable for the time in service (unconfirmed).

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0754034	WC0587339	WC0587316
Sample Date	Client Info			24 Aug 2023	11 Aug 2022	18 Jul 2021
Machine Age	hrs	Client Info		0	0	2
Oil Age	hrs	Client Info		0	0	1
Oil Changed	Client Info			N/A	Not Changd	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1	<1	0
Chromium	ppm	ASTM D5185(m)	>10	0	0	0
Nickel	ppm	ASTM D5185(m)	>10	<1	<1	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>10	0	0	0
Lead	ppm	ASTM D5185(m)	>10	<1	<1	0
Copper	ppm	ASTM D5185(m)	>75	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>10	0	0	0
Antimony	ppm	ASTM D5185(m)		0	<1	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0


ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		<1	<1	<1
Calcium	ppm	ASTM D5185(m)		34	36	35
Phosphorus	ppm	ASTM D5185(m)		287	298	289
Zinc	ppm	ASTM D5185(m)		344	323	330
Sulfur	ppm	ASTM D5185(m)		727	756	727
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	<1	<1	<1
Sodium	ppm	ASTM D5185(m)		<1	<1	0
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG




OIL ANALYSIS REPORT



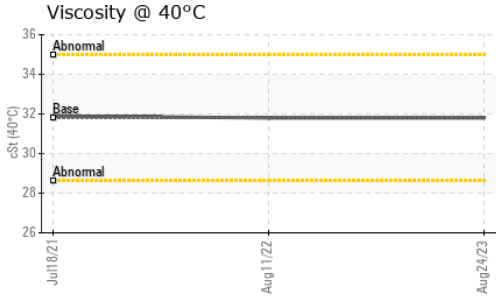


FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	31.8	31.8	31.8	31.9

SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------

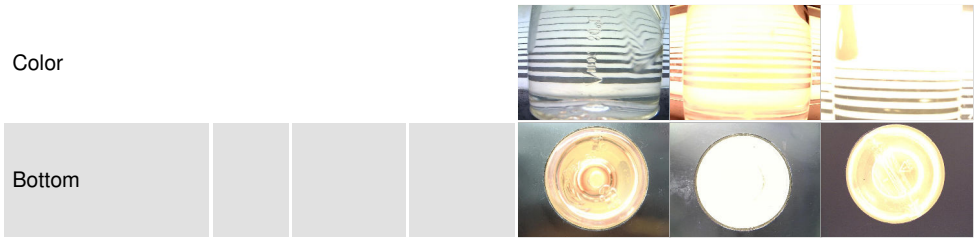

GRAPHS

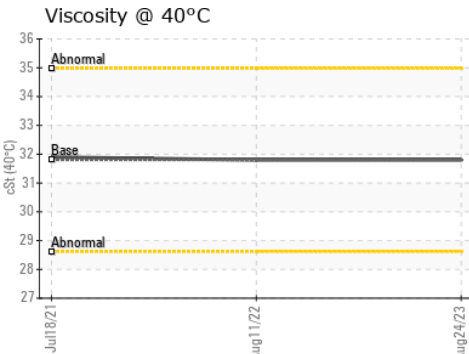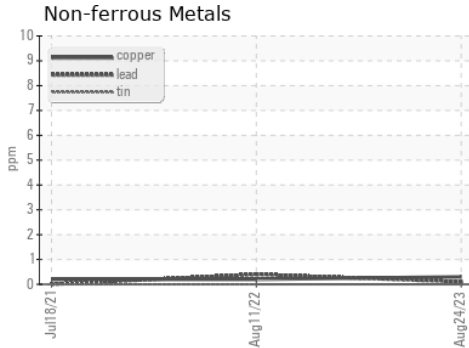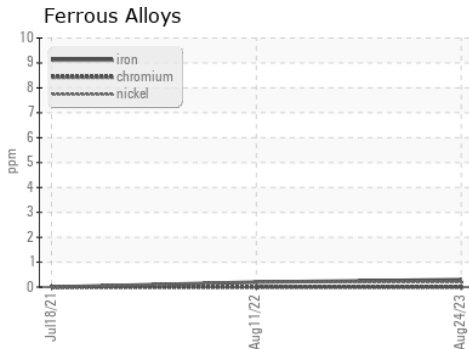

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Horizon Maritime Services Ltd. - Horizon Enabler
Sample No. : WC0754034 **Received** : 06 Sep 2023 87 Water Street, 2nd Floor
Lab Number : **02580692** **Diagnosed** : 06 Sep 2023 St. John's, NL
Unique Number : 5633752 **Diagnostician** : Kevin Marson CA A1C 1A5
Test Package : MAR 1

To discuss this sample report, contact Customer Service at 1-800-268-2131. Contact: Andrew Whalen
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. chiefeng.enabler@horizonmaritime.com
 Validity of results and interpretation are based on the sample and information as supplied. T:
F: