

OIL ANALYSIS REPORT

Sample Rating Trend



PRESS #2 NEW PULLER -

Hydraulic System

NOT GIVEN (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

1X2				Sen/023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		wc		
Sample Date		Client Info		26 Sep 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	0		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>20	<1		
Titanium	ppm	ASTM D5185(m)		0		
0''		AOTH DE LOS		_		

INICKEI	ppiii	A01101 D0100(111)	>20	~ I		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	<1		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		170		
Zinc	ppm	ASTM D5185(m)		1		
Sulfur	ppm	ASTM D5185(m)		1682		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANT	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	0		
FLUID CLEANLI	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	1331		
Particles >6µm		ASTM D7647	>1300	310		
Particles >14μm		ASTM D7647	>160	23		
Particles >21µm		ASTM D7647	>40	7		
Particles >38μm		ASTM D7647	>10	0		

Acid Number (AN)

FLUID DEGRADATION

Particles >71µm

Oil Cleanliness

mg KOH/g ASTM D974*

ASTM D7647 >3

ISO 4406 (c) >19/17/14


18/15/12

Report Id: INDMIS [WCAMIS] 02585868 (Generated: 10/02/2023 08:41:38) Rev: 1

Contact/Location: Rajkumar Chandiran - INDMIS



OIL ANALYSIS REPORT

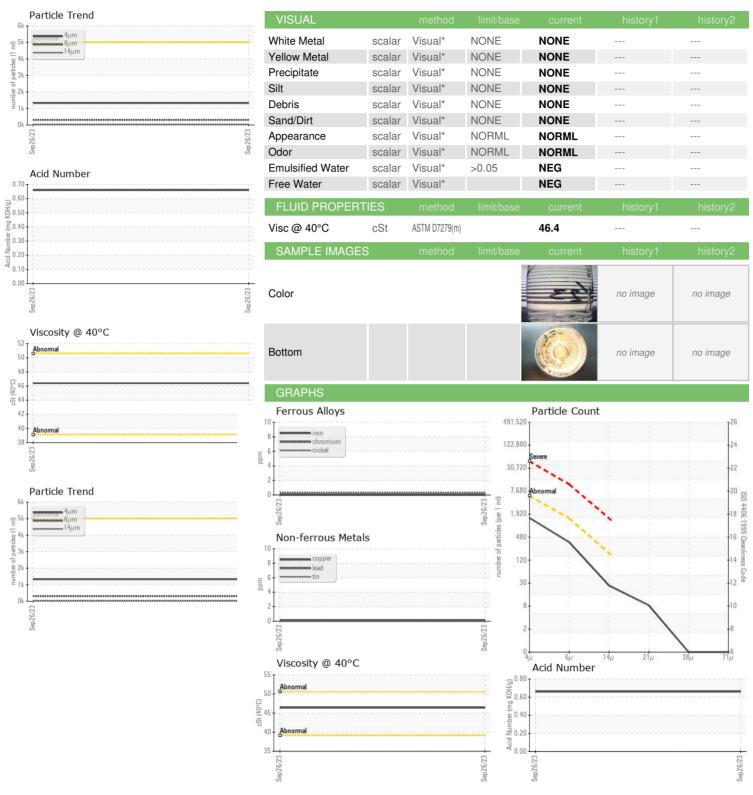



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** Test Package

: WC : 02585868

: 5654934 : IND 2

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : 28 Sep 2023 Received : 02 Oct 2023 Diagnosed : Wes Davis

Diagnostician

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Hydro Extrusion North 5675 Kennedy Road Mississauga, ON

CA L4Z 2H9 Contact: Rajkumar Chandiran rajkumar.chandiran@hydro.com

T: (905)890-8821 F: (866)462-6478