




# OIL ANALYSIS REPORT

Sample Rating Trend

**NORMAL**



Area  
**[4210]**  
 Machine Id  
**NEW FLYER 1404**  
 Component  
**Rear Diesel Engine**  
 Fluid  
**DIESEL ENGINE OIL SAE 15W40 (26 LTR)**

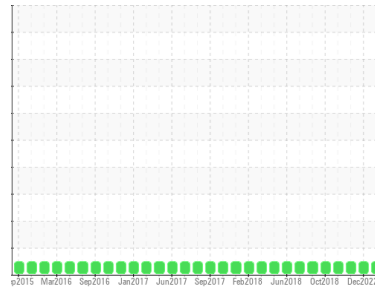

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			<b>WC0843537</b>	WC0737229	WC0308455
Sample Date	Client Info			<b>06 Sep 2023</b>	03 Dec 2022	18 Jan 2019
Machine Age	kms	Client Info		<b>483000</b>	420785	172837
Oil Age	kms	Client Info		<b>0</b>	0	0
Oil Changed	Client Info			<b>Changed</b>	N/A	N/A
Sample Status				<b>NORMAL</b>	NORMAL	NORMAL

CONTAMINATION		method	limit/base	current	history1	history2
Fuel	WC Method	>5		<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method			<b>NEG</b>	0.0	NEG

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	<b>6</b>	8	6
Chromium	ppm	ASTM D5185(m)	>20	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<b>0</b>	<1	0
Titanium	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Silver	ppm	ASTM D5185(m)	>3	<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<b>1</b>	2	1
Lead	ppm	ASTM D5185(m)	>40	<b>&lt;1</b>	0	<1
Copper	ppm	ASTM D5185(m)	>330	<b>&lt;1</b>	<1	<1
Tin	ppm	ASTM D5185(m)	>15	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	<1

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	<b>13</b>	91	24
Barium	ppm	ASTM D5185(m)	10	<b>&lt;1</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	100	<b>14</b>	18	42
Manganese	ppm	ASTM D5185(m)		<b>0</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)	450	<b>25</b>	121	568
Calcium	ppm	ASTM D5185(m)	3000	<b>2243</b>	2092	1508
Phosphorus	ppm	ASTM D5185(m)	1150	<b>887</b>	996	913
Zinc	ppm	ASTM D5185(m)	1350	<b>1038</b>	1117	1178
Sulfur	ppm	ASTM D5185(m)	4250	<b>2917</b>	2862	2396
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0


CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	<b>4</b>	4	4
Sodium	ppm	ASTM D5185(m)	>158	<b>2</b>	9	2
Potassium	ppm	ASTM D5185(m)	>20	<b>3</b>	33	0

INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	<b>0.3</b>	0.2	0.2
Nitration	Abs/cm	ASTM D7624*	>20	<b>8.2</b>	8.9	9.8
Sulfation	Abs/.1mm	ASTM D7415*	>30	<b>20.0</b>	23.3	21.8

FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	<b>13.8</b>	18.6	19.3











# OIL ANALYSIS REPORT

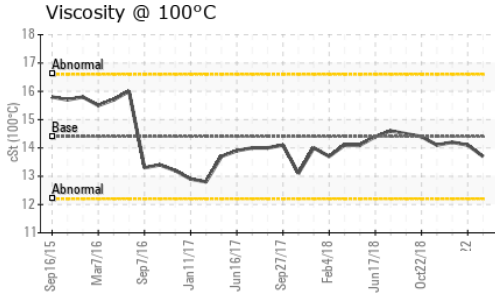

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	14.4	13.7	14.1

## GRAPHS

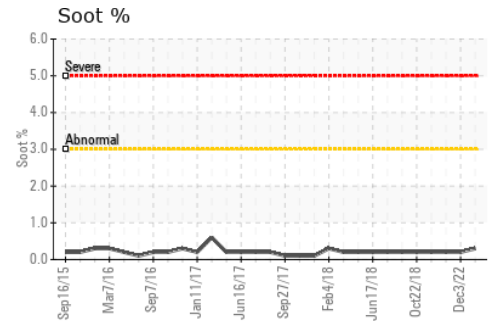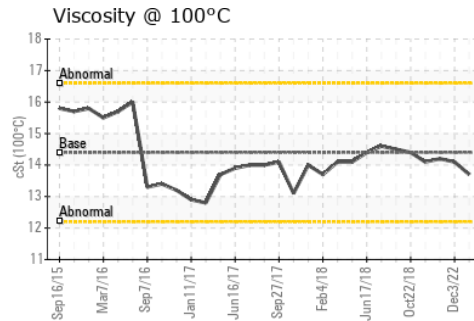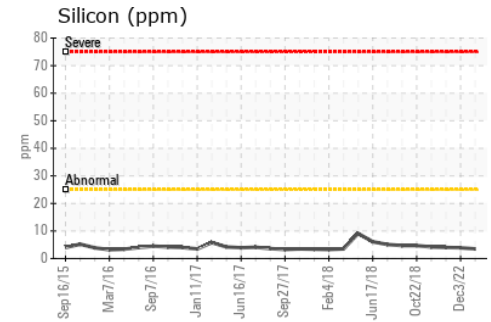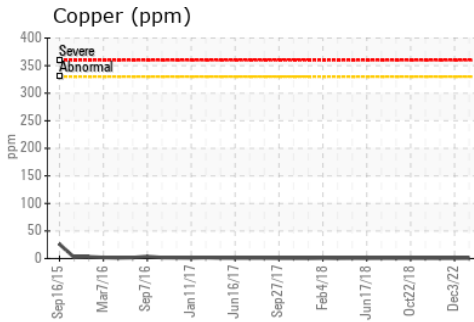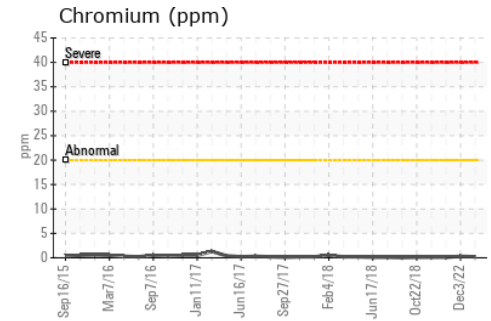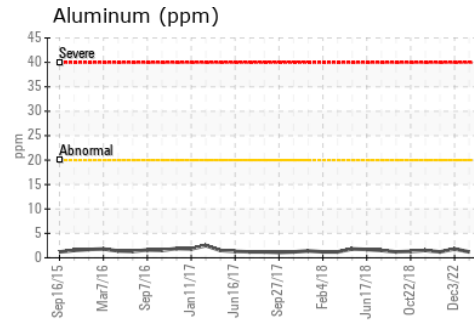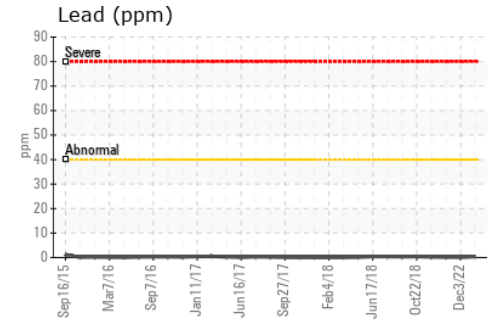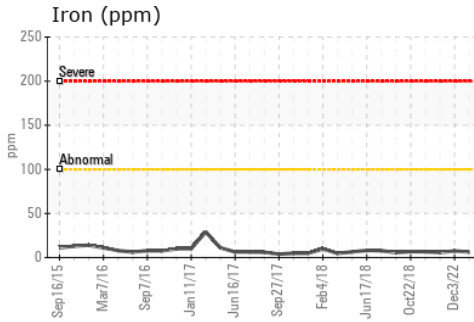

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0843537 **Received** : 02 Oct 2023  
**Lab Number** : 02586078 **Diagnosed** : 02 Oct 2023  
**Unique Number** : 5655144 **Diagnostician** : Wes Davis  
**Test Package** : MOB 1

**MVT Canadian Bus**  
 133 Welham Road  
 Barrie, ON  
 CA L4N 8Y3  
 Contact: Frank Mastromarco  
 frank.mastromarco@mvttransit.com  
 T: (709)792-5033  
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.