



OIL ANALYSIS REPORT


Sample Rating Trend

NORMAL



Area
POSTE FRONTOLIER COUEX HILL [6100199696]
Machine Id
KOHLER 3703712301

Component
Diesel Engine
Fluid
APRIL SUPERFLO HYPER SYN 5W30 (--- GAL)

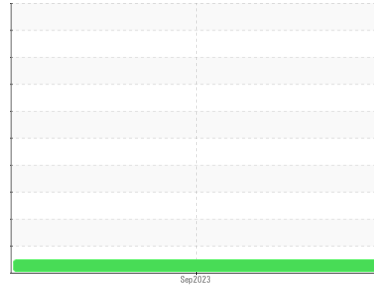

DIAGNOSIS

Recommendation

Aucune mesure corrective n'est recommandée pour l'instant. Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Wear

Les taux de métaux sont typiques pour la période de rodage d'un nouveau composant.

Contamination

La teneur en carburant est négligeable. Il n'y a aucun indice de contamination dans l'huile.

Fluid Condition

L'état de l'huile est acceptable pour la durée de service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GD0005202	---	---
Sample Date	Client Info		26 Sep 2023	---	---
Machine Age	hrs	Client Info	419	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Changed	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Glycol	WC Method		NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >100	6	---	---
Chromium	ppm	ASTM D5185(m) >20	0	---	---
Nickel	ppm	ASTM D5185(m) >4	0	---	---
Titanium	ppm	ASTM D5185(m)	0	---	---
Silver	ppm	ASTM D5185(m) >3	<1	---	---
Aluminum	ppm	ASTM D5185(m) >20	2	---	---
Lead	ppm	ASTM D5185(m) >40	<1	---	---
Copper	ppm	ASTM D5185(m) >330	2	---	---
Tin	ppm	ASTM D5185(m) >15	2	---	---
Antimony	ppm	ASTM D5185(m)	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	47	---	---
Barium	ppm	ASTM D5185(m)	<1	---	---
Molybdenum	ppm	ASTM D5185(m)	75	---	---
Manganese	ppm	ASTM D5185(m)	0	---	---
Magnesium	ppm	ASTM D5185(m)	446	---	---
Calcium	ppm	ASTM D5185(m)	1177	---	---
Phosphorus	ppm	ASTM D5185(m)	643	---	---
Zinc	ppm	ASTM D5185(m)	747	---	---
Sulfur	ppm	ASTM D5185(m)	1773	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >25	4	---	---
Sodium	ppm	ASTM D5185(m)	1	---	---
Potassium	ppm	ASTM D5185(m) >20	0	---	---
Fuel	%	ASTM D7593* >5	0.3	---	---

INFRA-RED



	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844* >3	0	---	---
Nitration	Abs/cm	ASTM D7624* >20	6.2	---	---
Sulfation	Abs/.1mm	ASTM D7415* >30	14.5	---	---

FLUID DEGRADATION

	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414* >25	8.2	---	---











OIL ANALYSIS REPORT

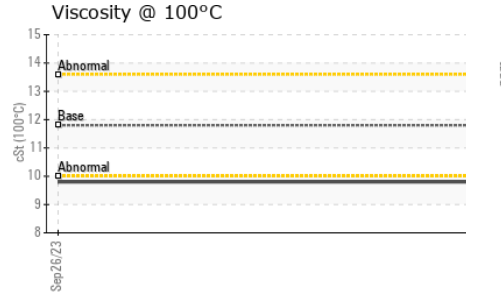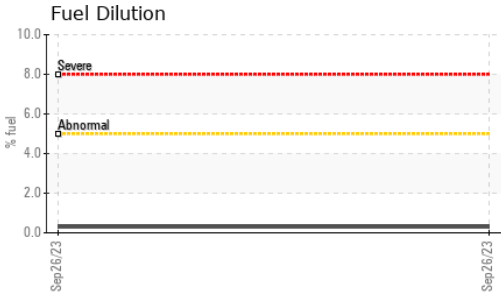

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.2	NEG	---
Free Water	scalar	Visual*		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	11.8	9.8	---

GRAPHS

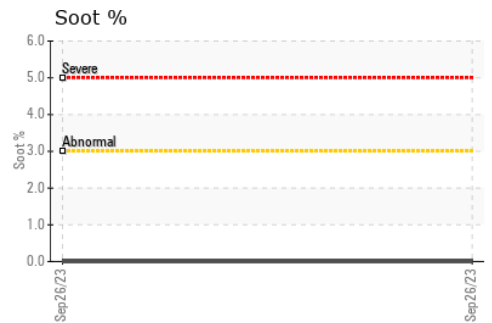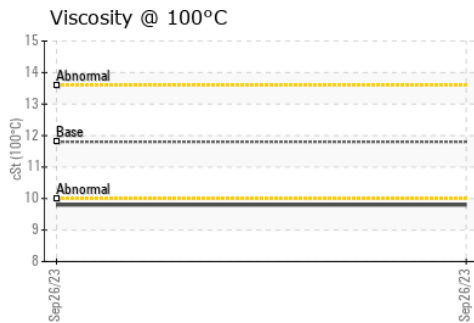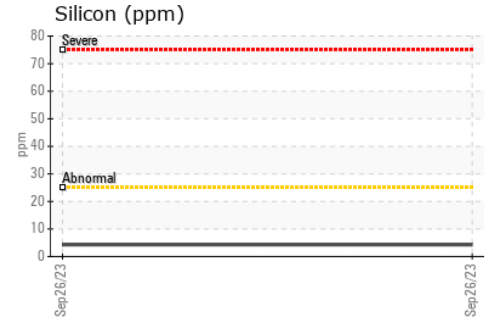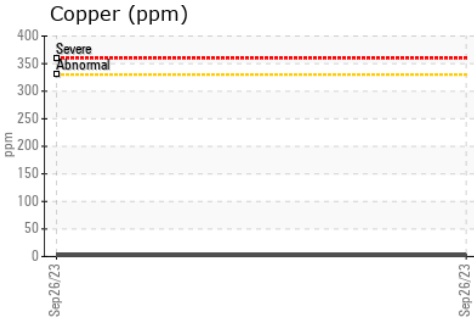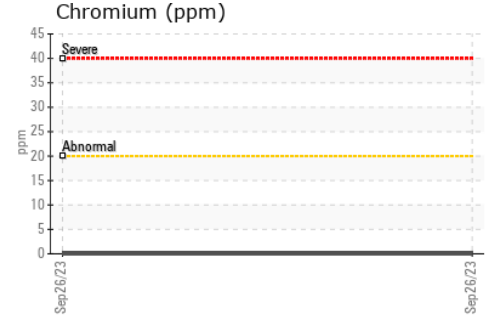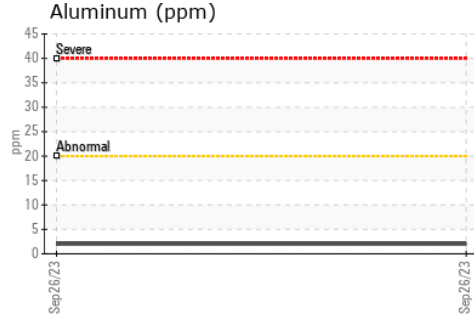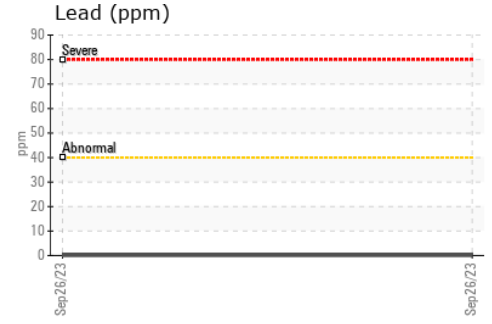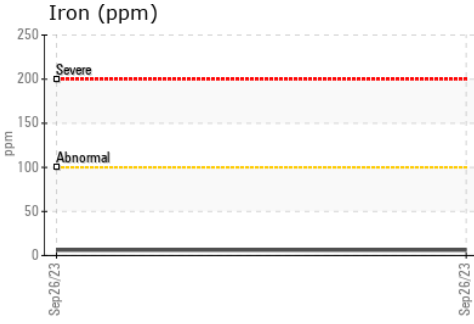

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : GD0005202 **Received** : 11 Oct 2023
Lab Number : **02588182** **Diagnosed** : 12 Oct 2023
Unique Number : 5657248 **Diagnostician** : Wes Davis
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel)

Generatrice Drummond
 243 rue des ARTISANS
 SAINT-GERMAIN-DE-GRANTHAM, QC
 CA J0C 1K0
 Contact: Valerie Poirier
 poiirivalerie@generatricedrummond.com
 T: (819)398-6811
 F: (819)398-7022

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.