




OIL ANALYSIS REPORT

Sample Rating Trend

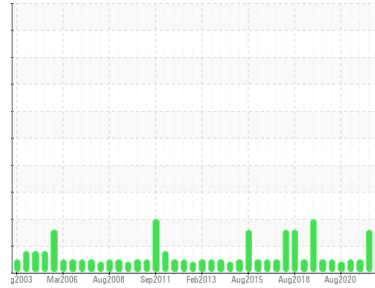

NORMAL



Area
Temboard/Service/Stock Preparation
 Machine Id
[801-275-002] TB Air Compressor #2
 Component
Centrifugal Compressor
 Fluid
INGERSOLL-RAND TECHTROL GOLD (231 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The water content is negligible. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0841329	WC0725814	WC0608953
Sample Date	Client Info		10 Oct 2023	06 Sep 2022	18 Aug 2021
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	ABNORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>50	<1	<1
Chromium	ppm	ASTM D5185(m)	>10	0	0
Nickel	ppm	ASTM D5185(m)		0	<1
Titanium	ppm	ASTM D5185(m)		0	0
Silver	ppm	ASTM D5185(m)		<1	<1
Aluminum	ppm	ASTM D5185(m)	>25	0	<1
Lead	ppm	ASTM D5185(m)	>25	0	<1
Copper	ppm	ASTM D5185(m)	>50	<1	<1
Tin	ppm	ASTM D5185(m)	>15	0	0
Antimony	ppm	ASTM D5185(m)		0	<1
Vanadium	ppm	ASTM D5185(m)		0	0
Beryllium	ppm	ASTM D5185(m)		0	0
Cadmium	ppm	ASTM D5185(m)		0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		1	<1
Barium	ppm	ASTM D5185(m)		406	403
Molybdenum	ppm	ASTM D5185(m)		0	0
Manganese	ppm	ASTM D5185(m)		0	0
Magnesium	ppm	ASTM D5185(m)		<1	0
Calcium	ppm	ASTM D5185(m)		3	2
Phosphorus	ppm	ASTM D5185(m)		8	6
Zinc	ppm	ASTM D5185(m)		4	4
Sulfur	ppm	ASTM D5185(m)		268	238
Lithium	ppm	ASTM D5185(m)		<1	<1

CONTAMINANTS






	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	3	4
Sodium	ppm	ASTM D5185(m)		6	5
Potassium	ppm	ASTM D5185(m)	>20	<1	<1
Water	%	ASTM D6304*	>0.1	0.075	0.123
ppm Water	ppm	ASTM D6304*	>1000	754.5	1230.4

FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647		299	424	181
Particles >6µm	ASTM D7647	>160	103	112	58
Particles >14µm	ASTM D7647	>40	6	11	8
Particles >21µm	ASTM D7647	>10	2	2	2
Particles >38µm	ASTM D7647	>3	1	0	0
Particles >71µm	ASTM D7647	>3	1	0	0
Oil Cleanliness	ISO 4406 (c)	>--/14/12	15/14/10	16/14/11	15/13/10




OIL ANALYSIS REPORT

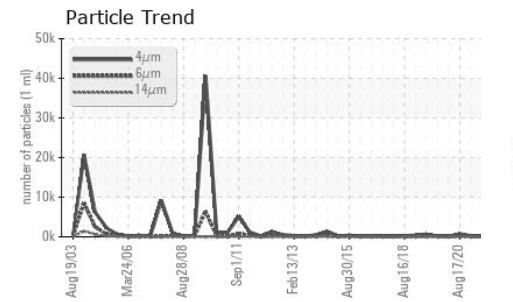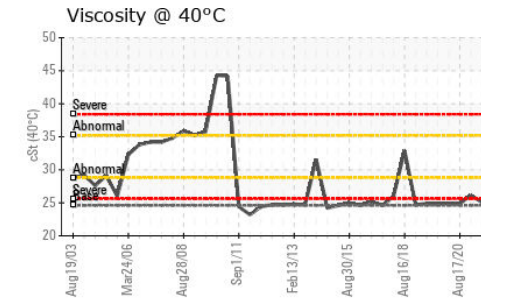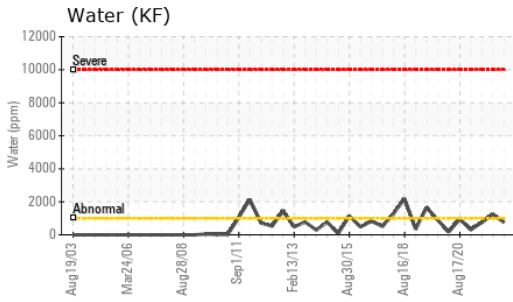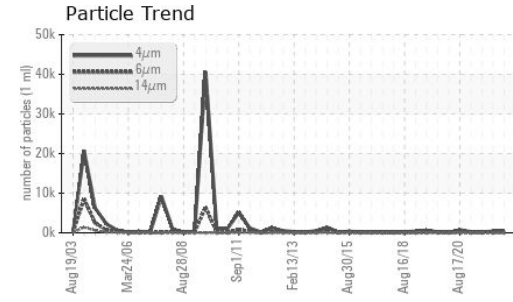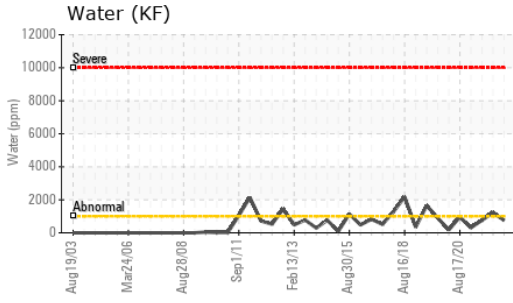






FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.10	0.37	0.36	0.33
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	24.6	25.8	25.8	25.1

SAMPLE IMAGES		method	limit/base	current	history1	history2
Color						
Bottom						

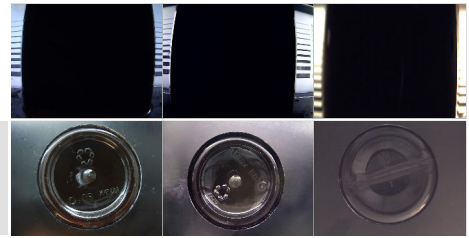

GRAPHS

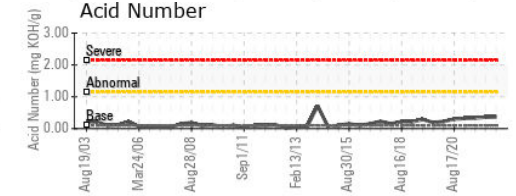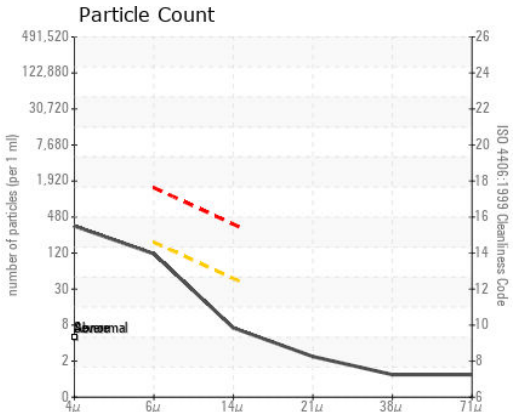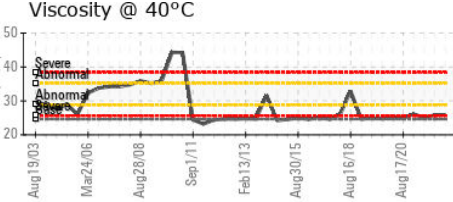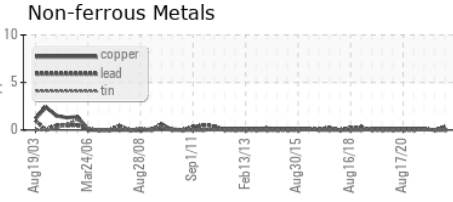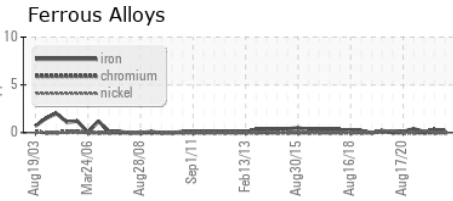

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0841329 **Received** : 11 Oct 2023
Lab Number : **02588286** **Diagnosed** : 12 Oct 2023
Unique Number : 5657352 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: KF, TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Rayonier Advanced Materials
 P.O.Box 6000, 33 Kipawa Road
 Temiscaming, QC
 CA J0Z 3R0
 Contact: Santosh Raikar
 santosh.raikar@rayonieram.com
 T: (819)627-4931
 F: (819)627-1507