

OIL ANALYSIS REPORT

Hendrickson - H00200 A2310107

Component Hydraulic Power Pack

AW HYDRAULIC OIL ISO 46 (--- GAL)

Sample Rating Trend NORMAL

Recommendation

This is a baseline read-out on the submitted sample.

Wear

{not applicable}

Contamination

{not applicable}


Fluid Condition

{not applicable}

				0ct2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Batch #		Client Info		2023 09 0700		
Machine ID		Client Info		A2310107		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Final		
Sent to WC		Client Info		10/18/2023		
Sample Number		Client Info		E30000559		
Sample Date		Client Info		18 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	13		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>20	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>20	1		
Lead	ppm	ASTM D5185(m)	>20	4		
Copper	ppm	ASTM D5185(m)	>20	11		
Tin	ppm	ASTM D5185(m)	>20	4		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	1		
Barium	ppm	ASTM D5185(m)	5	<1		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)	25	55		
Calcium	ppm	ASTM D5185(m)	200	111		
Phosphorus	ppm	ASTM D5185(m)	300	464		
Zinc	ppm	ASTM D5185(m)	370	513		
Sulfur	ppm	ASTM D5185(m)	2500	1497		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	2		
Sodium	ppm	ASTM D5185(m)		4		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Water	%	ASTM D6304*	>0.05	0.002		
ppm Water	ppm	ASTM D6304*	>500	22.8		



OIL ANALYSIS REPORT

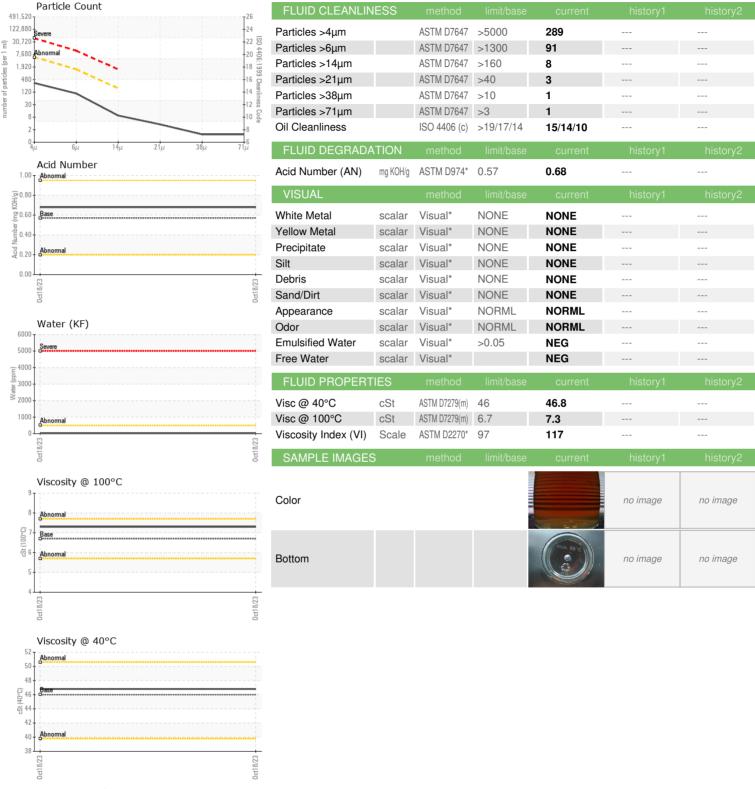



CALA ISO 17025:2017 Accredited

Laboratory Sample No. Lab Number **Unique Number**

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : E30000559 : 5659695

+02590629

Received Diagnosed

: 20 Oct 2023 : 25 Oct 2023 Diagnostician : Tatiana Sorkina

Test Package : IND 2 (Additional Tests: KF, KV100, VI) To discuss this sample report, contact Customer Service at 1-905-372-2251.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Environmental 360 Solutions Ltd.

640 Victoria Street Cobourg, ON **CA K9A 5H5** Contact: Pierre Guillet

pguillet@e360s.ca

T: F: (905)373-4950

Contact/Location: Pierre Guillet - CHECOB