




OIL ANALYSIS REPORT

Sample Rating Trend

VISCOSITY



Machine Id
CATERPILLAR R1600 SCP210
 Component
Hydraulic System
 Fluid
PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

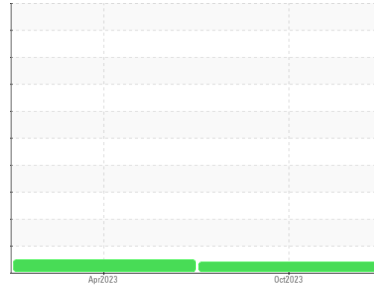

DIAGNOSIS

Recommendation

Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MOB 2 test kits, this testkit includes Particle Count to determine the ISO cleanliness of the fluid.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the component(unconfirmed).

Fluid Condition

Viscosity of sample indicates oil is within SAE 40 range, advise investigate. This plus the additive levels indicates that this is not the same brand, or type of oil as reported. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0788011	WC0775100	---
Sample Date	Client Info		16 Oct 2023	17 Apr 2023	---
Machine Age	hrs	Client Info	10970	10539	---
Oil Age	hrs	Client Info	0	0	---
Oil Changed	Client Info		N/A	N/A	---
Sample Status			ABNORMAL	NORMAL	---

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>20	4	1	---
Chromium	ppm	ASTM D5185(m)	>10	0	0	---
Nickel	ppm	ASTM D5185(m)	>10	0	<1	---
Titanium	ppm	ASTM D5185(m)		0	<1	---
Silver	ppm	ASTM D5185(m)		<1	0	---
Aluminum	ppm	ASTM D5185(m)	>10	<1	<1	---
Lead	ppm	ASTM D5185(m)	>10	0	<1	---
Copper	ppm	ASTM D5185(m)	>75	<1	<1	---
Tin	ppm	ASTM D5185(m)	>10	0	0	---
Antimony	ppm	ASTM D5185(m)		0	0	---
Vanadium	ppm	ASTM D5185(m)		0	0	---
Beryllium	ppm	ASTM D5185(m)		0	0	---
Cadmium	ppm	ASTM D5185(m)		0	0	---

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	2	17	2	---
Barium	ppm	ASTM D5185(m)	0	<1	0	---
Molybdenum	ppm	ASTM D5185(m)	0	41	53	---
Manganese	ppm	ASTM D5185(m)	0	0	<1	---
Magnesium	ppm	ASTM D5185(m)	9	614	872	---
Calcium	ppm	ASTM D5185(m)	3114	1724	989	---
Phosphorus	ppm	ASTM D5185(m)	1099	932	1053	---
Zinc	ppm	ASTM D5185(m)	1245	1048	1112	---
Sulfur	ppm	ASTM D5185(m)	7086	4069	2632	---
Lithium	ppm	ASTM D5185(m)		<1	<1	---

CONTAMINANTS



	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>20	9	5	---
Sodium	ppm	ASTM D5185(m)		2	1	---
Potassium	ppm	ASTM D5185(m)	>20	0	<1	---

VISUAL

	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	NONE	---
Debris	scalar	Visual*	NONE	VLITE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG	---
Free Water	scalar	Visual*		NEG	NEG	---



OIL ANALYSIS REPORT

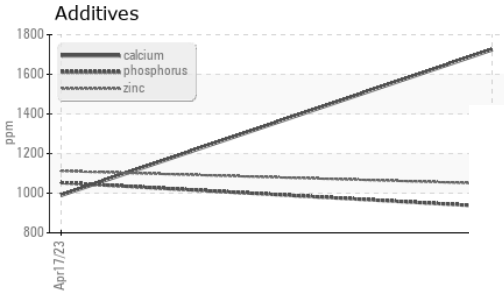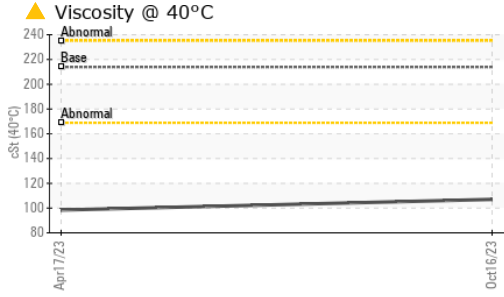









FLUID PROPERTIES

	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	▲ 107	98.4	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color					no image
Bottom					no image

GRAPHS

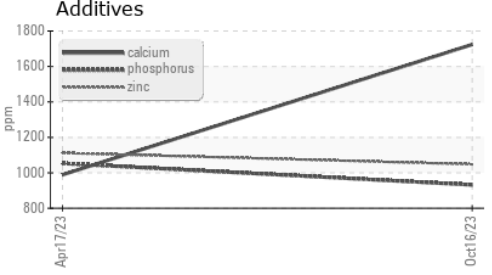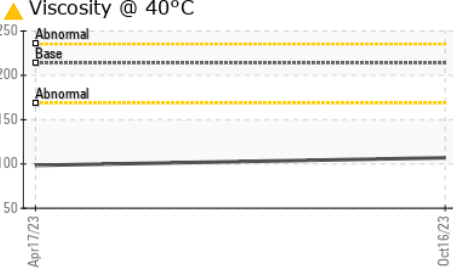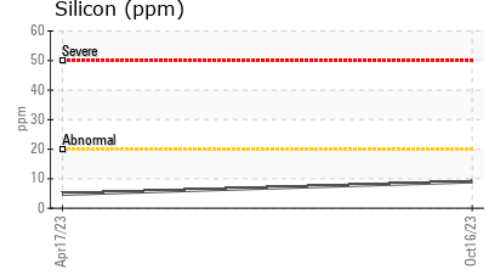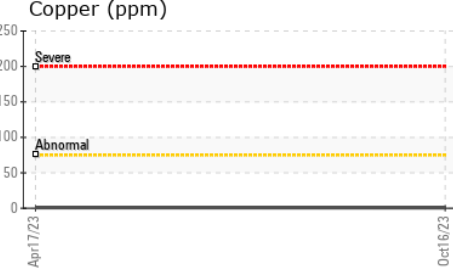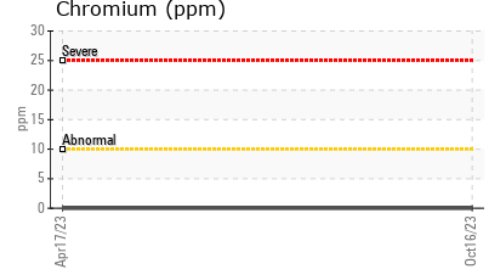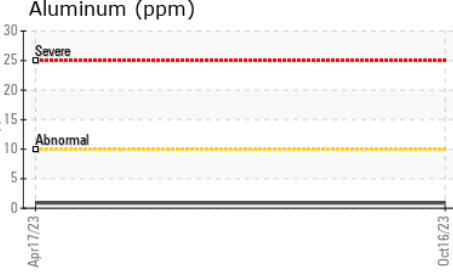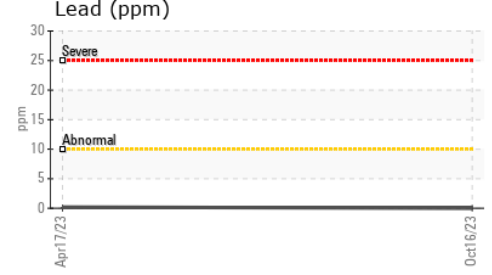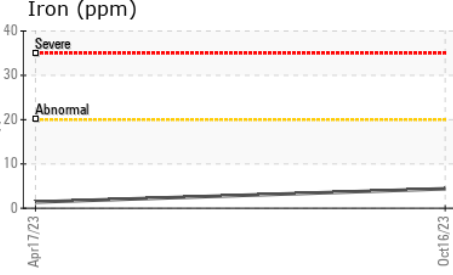

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0788011 **Received** : 26 Oct 2023
Lab Number : 02592163 **Diagnosed** : 27 Oct 2023
Unique Number : 5669242 **Diagnostician** : Kevin Marson
Test Package : MOB 1

Agnico Eagle Canada
 1350 Government Rd. W, MACASSA COMPLEX
 Kirkland Lake, ON
 CA P2N 3J1
 Contact: Tony Tees
 tony.tees@agnicoeagle.com
 T: (705)567-5208
 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.