




OIL ANALYSIS REPORT

Sample Rating Trend

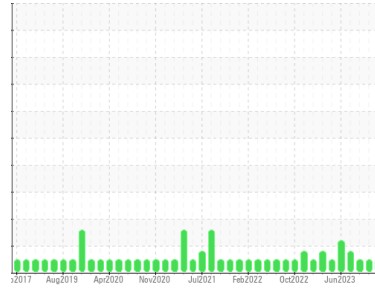

NORMAL



Machine Id
NEW FLYER 1204
 Component
Diesel Engine
 Fluid
SAFETY-KLEEN PERFORMANCE PLUS XHD-7 15W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0877961	WC0849709	WC0849858
Sample Date	Client Info		30 Nov 2023	15 Oct 2023	23 Aug 2023
Machine Age	kms	Client Info	875968	0	857580
Oil Age	kms	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<1.0	<1.0	<1.0
Water	WC Method	>0.2	NEG	NEG	NEG
Glycol	WC Method		NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>75	8	10	8
Chromium	ppm	ASTM D5185(m)	>5	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	0	0	<1
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	<1	<1	0
Aluminum	ppm	ASTM D5185(m)	>15	1	1	<1
Lead	ppm	ASTM D5185(m)	>25	<1	1	<1
Copper	ppm	ASTM D5185(m)	>100	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		<1	1	<1
Barium	ppm	ASTM D5185(m)		<1	<1	0
Molybdenum	ppm	ASTM D5185(m)		60	62	58
Manganese	ppm	ASTM D5185(m)		0	0	<1
Magnesium	ppm	ASTM D5185(m)		956	996	972
Calcium	ppm	ASTM D5185(m)		1037	1071	1038
Phosphorus	ppm	ASTM D5185(m)		962	1029	1044
Zinc	ppm	ASTM D5185(m)		1186	1230	1197
Sulfur	ppm	ASTM D5185(m)		2445	2501	2516
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS


	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	3	3	3
Sodium	ppm	ASTM D5185(m)		1	2	2
Potassium	ppm	ASTM D5185(m)	>20	0	0	0

INFRA-RED

	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>6	0.4	0.5	0.4
Nitration	Abs/cm	ASTM D7624*	>20	8.5	8.9	8.0
Sulfation	Abs./1mm	ASTM D7415*	>30	20.6	21.1	22.1



OIL ANALYSIS REPORT

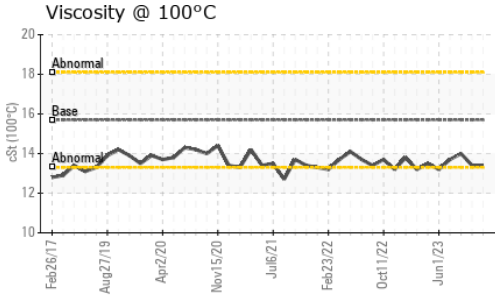

FLUID DEGRADATION		method	limit/base	current	history1	history2
-------------------	--	--------	------------	---------	----------	----------

Oxidation	Abs./1mm	ASTM D7414*	>25	17.8	18.3	17.1
-----------	----------	-------------	-----	-------------	------	------

VISUAL		method	limit/base	current	history1	history2
--------	--	--------	------------	---------	----------	----------









Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
------------------	--------	---------	------	------------	-----	-----

Free Water	scalar	Visual*		NEG	NEG	NEG
------------	--------	---------	--	------------	-----	-----

FLUID PROPERTIES		method	limit/base	current	history1	history2
------------------	--	--------	------------	---------	----------	----------

Visc @ 100°C	cSt	ASTM D7279(m)	15.7	13.4	13.4	14.0
--------------	-----	---------------	------	-------------	------	------

GRAPHS

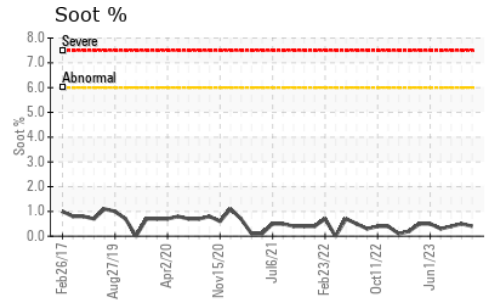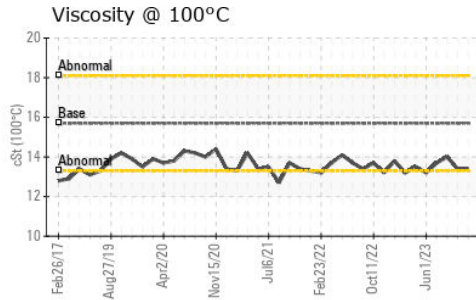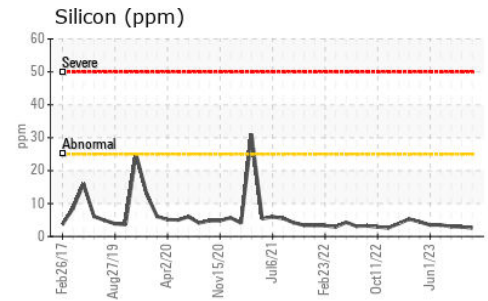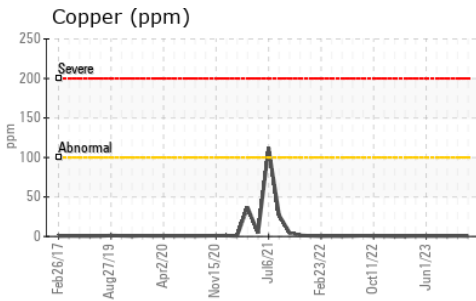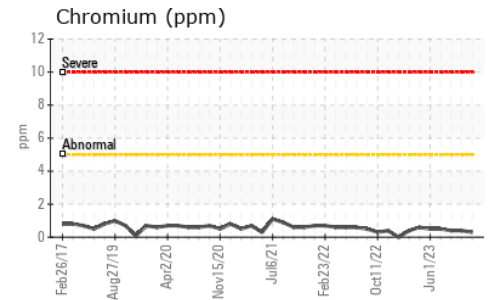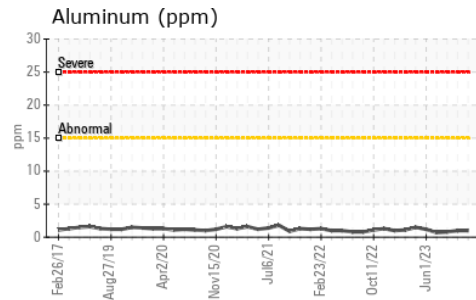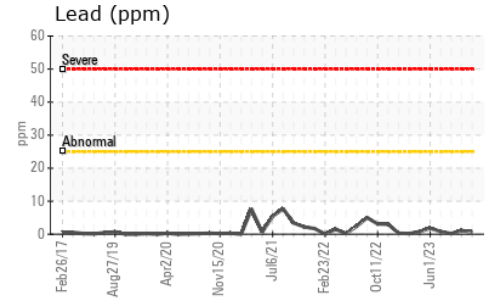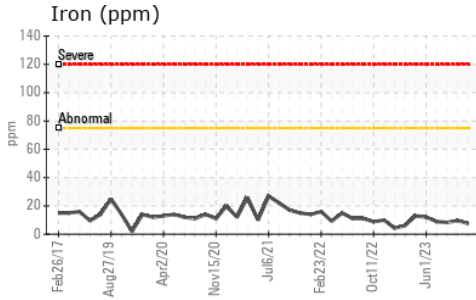

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0877961 **Received** : 06 Dec 2023
Lab Number : **02601205** **Diagnosed** : 06 Dec 2023
Unique Number : 5694290 **Diagnostician** : Wes Davis
Test Package : MOB 1

CITY OF HAMILTON
 2200 UPPER JAMES., MOUNTAIN TRANSIT STOREROOM
 MOUNT HOPE, ON
 CA L0R 1W0
 Contact: Jeff Parr
 jeff.parr@hamilton.ca
 T: (905)546-2424
 F: (905)679-4502

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.