

OIL ANALYSIS REPORT

BLUETRITON [4501192812]

FRICK 420CHI-005 (S/N 0471)

Screw Compressor

FRICK COMPRESSOR OIL #11 (200 LTR)

NOR



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Moor

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORM	MOITAN	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0802945		
Sample Date		Client Info		29 Nov 2023		
Machine Age	hrs	Client Info		5219		
Oil Age	hrs	Client Info		5219		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0		
Iron	ppm	ASTM D5185(m)	>60	2		
Chromium	ppm	ASTM D5185(m)	>4	0		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>5	0		
Lead	ppm	ASTM D5185(m)	>10	<1		
Copper	ppm	ASTM D5185(m)	>30	<1		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		<1		
Zinc	ppm	ASTM D5185(m)		1		
Sulfur	ppm	ASTM D5185(m)		5		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	<1		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	0		
Water	%	ASTM D6304*	>0.1	0.002		
ppm Water	ppm	ASTM D6304*	>1000	24		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2


Acid Number (AN)

mg KOH/g ASTM D974*

0.01



OIL ANALYSIS REPORT

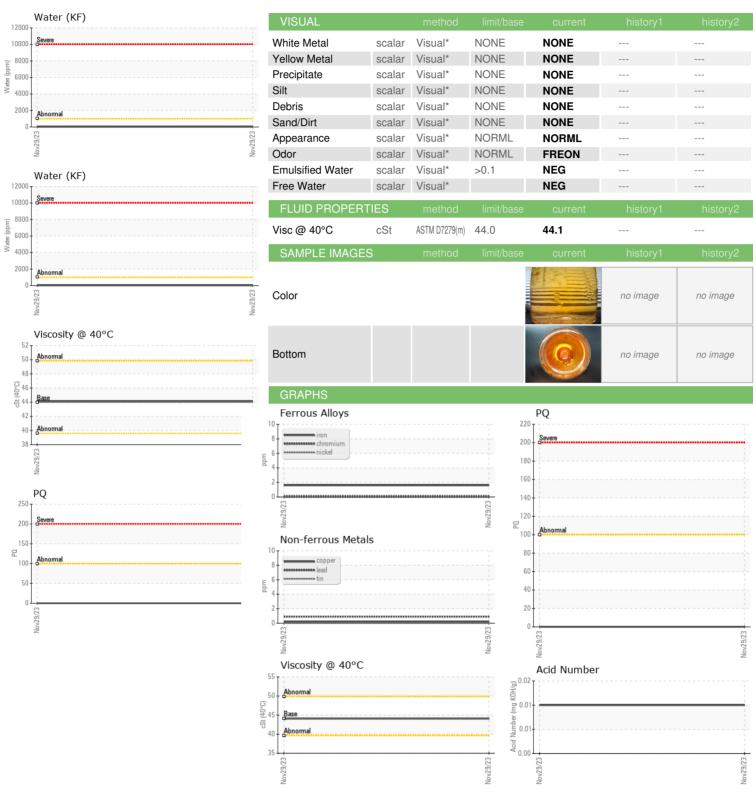



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number**

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0802945 : 02601578

: 5694663

Received Diagnosed

: 08 Dec 2023 Diagnostician : Bill Quesnel

: 07 Dec 2023

Test Package : IND 2 (Additional Tests: KF) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

CIMCO Refrigeration

1551 Corporate Drive Burlington, ON CA L7L 6M3 Contact: DAVID PARISE

DPARISE@ToROMONT.COM

Contact/Location: DAVID PARISE - CIMTOR

T: (416)465-7581 F: (416)465-8815