




OIL ANALYSIS REPORT

Sample Rating Trend

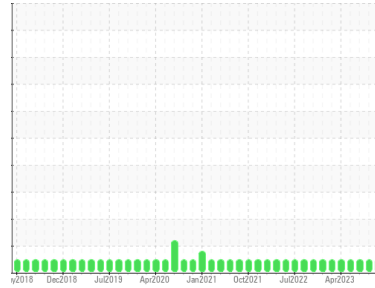

NORMAL



Machine Id
CUMMINS 234

Component
Rear Diesel Engine

Fluid
ESSO XD-3 EXTRA 15W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0866498	WC0816362	WC0816511
Sample Date	Client Info		29 Nov 2023	10 Oct 2023	25 Jul 2023
Machine Age	kms	Client Info	0	0	0
Oil Age	kms	Client Info	9526	10869	9501
Oil Changed	Client Info		Changed	Changed	Changed
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<1.0	<1.0	<1.0
Water	WC Method	>0.2	NEG	NEG	NEG
Glycol	WC Method		NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>90	6	9	5
Chromium	ppm	ASTM D5185(m)	>20	0	0	<1
Nickel	ppm	ASTM D5185(m)	>2	<1	<1	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>2	<1	<1	<1
Aluminum	ppm	ASTM D5185(m)	>20	1	2	1
Lead	ppm	ASTM D5185(m)	>40	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>330	4	6	5
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		113	79	94
Barium	ppm	ASTM D5185(m)		<1	<1	0
Molybdenum	ppm	ASTM D5185(m)		0	<1	2
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		12	14	29
Calcium	ppm	ASTM D5185(m)	3780	2150	2217	2113
Phosphorus	ppm	ASTM D5185(m)	1370	933	864	991
Zinc	ppm	ASTM D5185(m)	1500	1133	1072	1138
Sulfur	ppm	ASTM D5185(m)	3800	2841	2840	2844
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS



	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	3	4	4
Sodium	ppm	ASTM D5185(m)	>192	2	4	2
Potassium	ppm	ASTM D5185(m)	>20	5	4	4

INFRA-RED

	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>6	0.2	0.2	0.2
Nitration	Abs/cm	ASTM D7624*	>20	8.4	9.3	8.8
Sulfation	Abs.1mm	ASTM D7415*	>30	22.6	24.9	24.4



OIL ANALYSIS REPORT


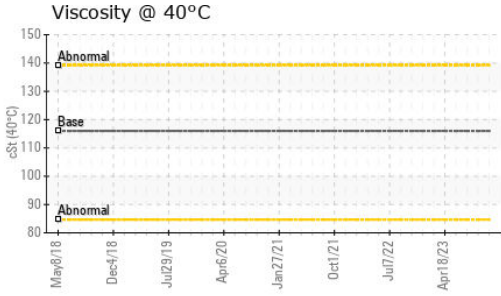
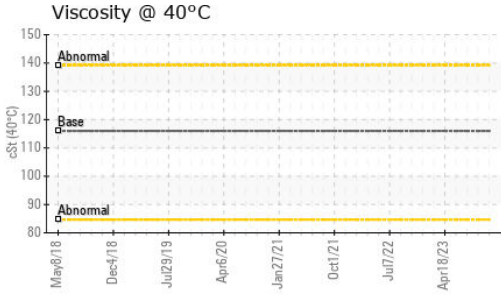


FLUID DEGRADATION		method	limit/base	current	history1	history2
Oxidation	Abs./1mm	ASTM D7414*	>25	19.8	24.2	22.6

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	116	108	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	15.4	14.2	14.4	14.3
Viscosity Index (VI)	Scale	ASTM D2270*	140	133	---	---

GRAPHS

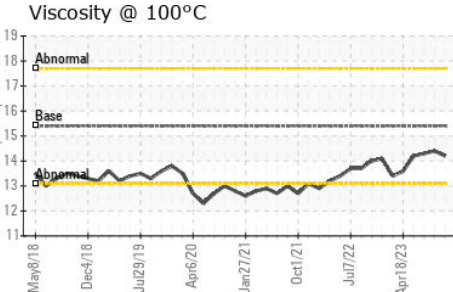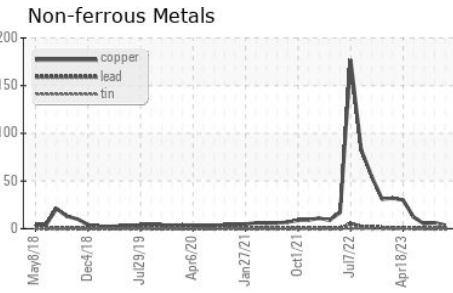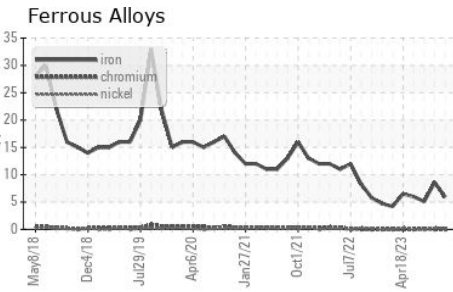

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0866498 **Received** : 07 Dec 2023
Lab Number : **02601603** **Diagnosed** : 08 Dec 2023
Unique Number : 5694688 **Diagnostician** : Kevin Marson
Test Package : MOB 1 (Additional Tests: KV40, PrtCount, VI, Visual)

CITY OF THUNDER BAY
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD
 THUNDER BAY, ON
 CA P7B 2Z8
 Contact: Sean Malcolm
 sean.malcolm@thunderbay.ca
 T: (807)684-2716
 F: (807)344-0237

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.