




OIL ANALYSIS REPORT

Sample Rating Trend

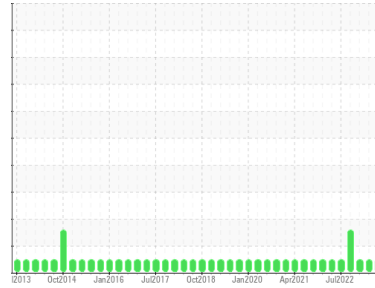

NORMAL



Area

1

Machine Id

1-201-8

Component

Air Compressor

Fluid

GARDNER DENVER AEON 4000 (200 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0869845	WC0842642	WC0818118
Sample Date	Client Info		23 Oct 2023	01 Aug 2023	11 May 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m) >50	2	2	2
Chromium	ppm	ASTM D5185(m) >4	0	0	0
Nickel	ppm	ASTM D5185(m) >4	<1	0	0
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	<1	0	0
Aluminum	ppm	ASTM D5185(m) >10	<1	<1	<1
Lead	ppm	ASTM D5185(m) >20	0	<1	0
Copper	ppm	ASTM D5185(m) >40	4	2	2
Tin	ppm	ASTM D5185(m) >5	0	0	0
Antimony	ppm	ASTM D5185(m)	0	0	<1
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0.2	<1	0	0
Barium	ppm	ASTM D5185(m) 0.0	<1	0	0
Molybdenum	ppm	ASTM D5185(m) 0.0	0	0	0
Manganese	ppm	ASTM D5185(m) 0.0	0	0	0
Magnesium	ppm	ASTM D5185(m) 0.0	<1	<1	<1
Calcium	ppm	ASTM D5185(m) 0.0	36	28	21
Phosphorus	ppm	ASTM D5185(m) 312	2	1	0
Zinc	ppm	ASTM D5185(m) 0.0	1	2	<1
Sulfur	ppm	ASTM D5185(m) 1629	2350	2852	2316
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >25	2	2	<1
Sodium	ppm	ASTM D5185(m)	1	1	0
Potassium	ppm	ASTM D5185(m) >20	7	7	3
Water	%	ASTM D6304* >0.6	0.002	0.004	0.001
ppm Water	ppm	ASTM D6304* >6000	21	45.0	1.7
Glycol	%	ASTM D7922*	0.0	0.0	0.0


FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974* 0.03	0.09	0.04	0.24




OIL ANALYSIS REPORT


Glycol Contamination

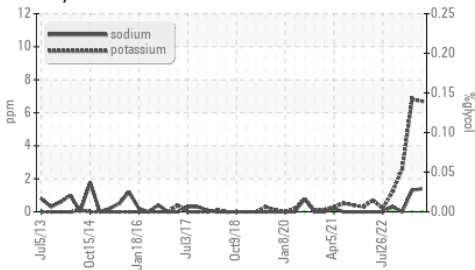


Water (KF)

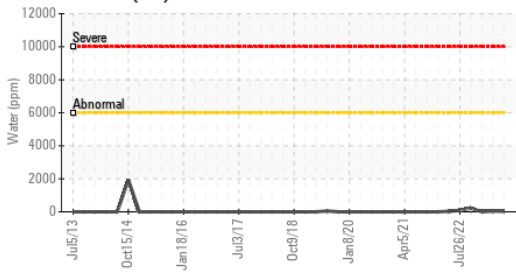


Acid Number

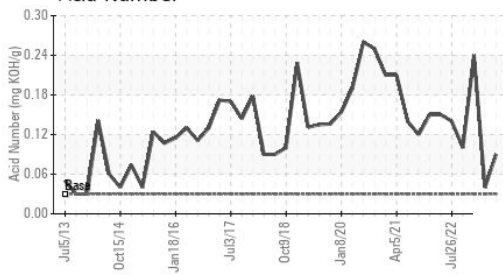

Viscosity @ 40°C

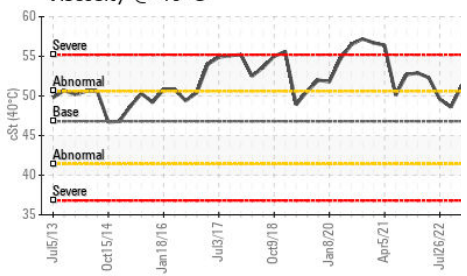

PQ

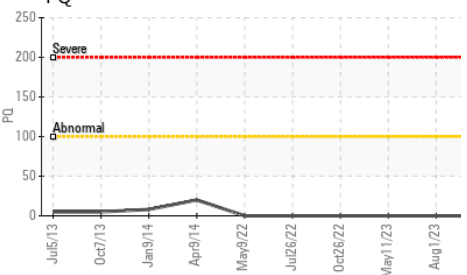

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.6	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46.8	50.4	48.0

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------


Color

Bottom




GRAPHS


Ferrous Alloys

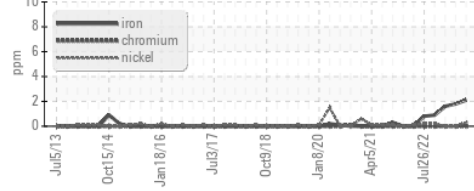


Non-ferrous Metals

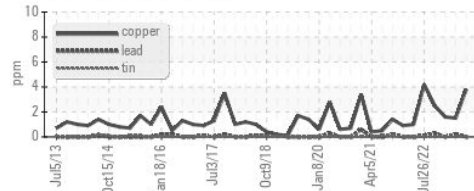


Viscosity @ 40°C

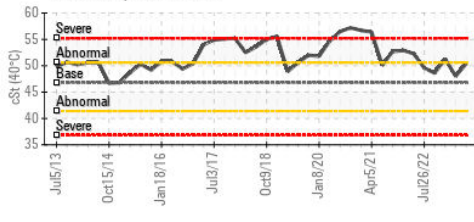

PQ

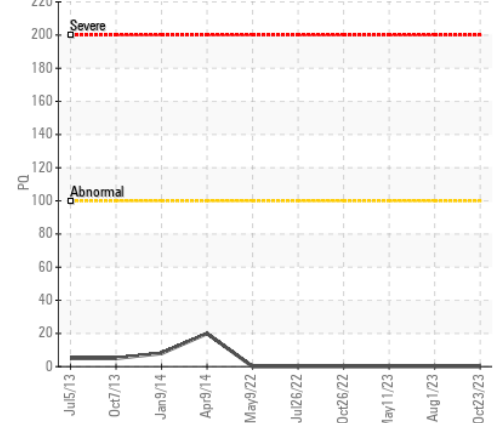

Acid Number

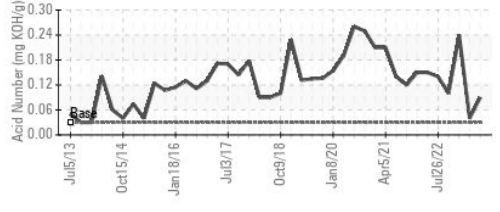

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0869845
Lab Number : 02601863
Unique Number : 5694948
Test Package : IND 2 (Additional Tests: Glycol, KF, TAN Man)

Received : 08 Dec 2023
Diagnosed : 09 Dec 2023
Diagnostician : Wes Davis

ST. MARYS CEMENT CO.
 400 BOWMANVILLE AVENUE
 BOWMANVILLE, ON
 CA L1C 7B5
 Contact: Lou Traiforos
 lou.traiforos@vcimentos.com
 T: (905)440-5874
 F: (905)623-4695

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.