


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

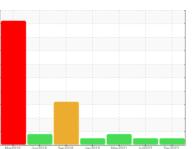

Machine Id

Amada Horizontal Band Saw # 014 cc4030

Component

Hydraulic System

AW HYDRAULIC OIL ISO 32 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Mar2018	Jun2018 Sep2018	Jan2019 May2021 Jul2022	Dec2023	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0888622	WC0724502	WC0586087
Sample Date		Client Info		10 Dec 2023	18 Jul 2022	16 May 2021
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				NORMAL	NORMAL	ATTENTION
CONTAMINATIO	Ν	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	1	<1	0
Chromium	ppm	ASTM D5185(m)	>20	<1	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	0	0	<1
Lead	ppm	ASTM D5185(m)	>20	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>20	2	2	2
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	<1	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	2	<1	<1
Barium	ppm	ASTM D5185(m)	5	<1	0	0
Molybdenum	ppm	ASTM D5185(m)	5	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	25	<1	<1	<1
Calcium	ppm	ASTM D5185(m)	200	47	44	53
Phosphorus	ppm	ASTM D5185(m)	300	342	338	345
Zinc	ppm	ASTM D5185(m)	370	424	415	453
Sulfur	ppm	ASTM D5185(m)	2500	877	2538	851
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0	<1	<1
Sodium	ppm	ASTM D5185(m)		<1	0	<1
Potassium	ppm	ASTM D5185(m)	>20	0	<1	<1
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	3665	4537	△ 9101
Particles >6µm		ASTM D7647	>1300	598	1050	▲ 1832
Particles >14µm		ASTM D7647	>160	14	46	76
Particles >21µm		ASTM D7647	>40	3	11	17
Particles >38µm		ASTM D7647	>10	0	1	0
Particles >71µm		ASTM D7647	\3	0	0	0

ISO 4406 (c) >19/17/14


Oil Cleanliness

19/16/11

20/18/13



OIL ANALYSIS REPORT

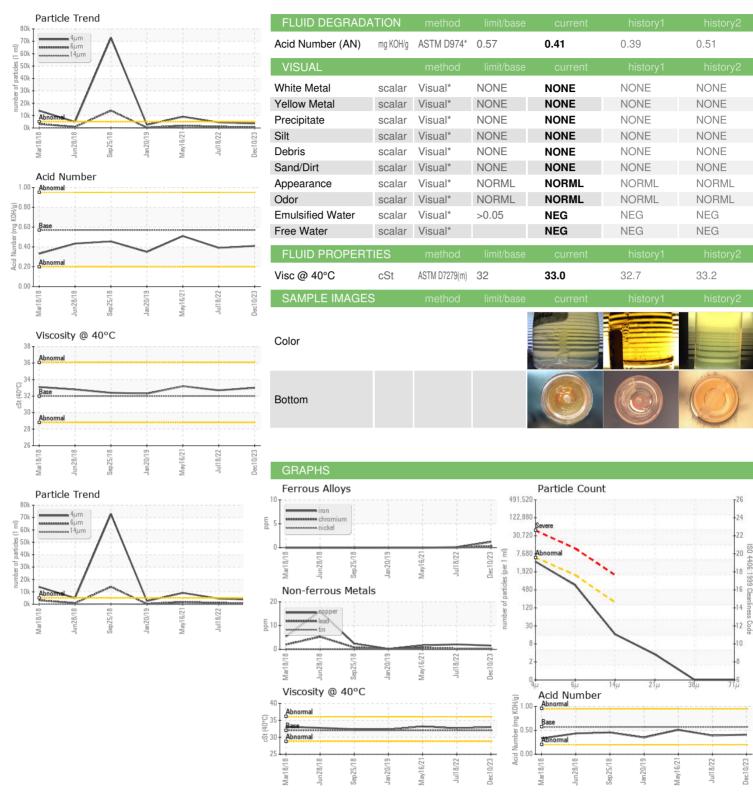



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number** Test Package

: WC0888622

: IND 2

02602278 : 5695363

Received Diagnosed Diagnostician

: 11 Dec 2023 : 12 Dec 2023 : Wes Davis

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 HUSKY INJECTION MOLDING SYSTEMS LTD 530 QUEEN STREET SOUTH BOLTON, ON

CA L7E 5S5 Contact: Robert Cameron rcameron@husky.ca

T: (905)951-5000

F: (905)951-5167

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.