



# OIL ANALYSIS REPORT

Sample Rating Trend

**WEAR**



Machine Id  
**VOLVO L120 SL21**  
Component  
**Transmission (Manual)**  
Fluid  
**{not provided} (--- GAL)**



## DIAGNOSIS

### ▲ Recommendation

We recommend that you drain the fluid from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the brand, type, and viscosity of the oil on your next sample.

### ▲ Wear

Lead ppm levels are abnormal. Clutch disc wear indicated.

### Contamination

There is no indication of any contamination in the fluid.

### Fluid Condition

The fluid is no longer serviceable as a result of the abnormal and/or severe wear.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0884555</b>	---	---
Sample Date	Client Info		<b>12 Dec 2023</b>	---	---
Machine Age	hrs	Client Info	<b>1240</b>	---	---
Oil Age	hrs	Client Info	<b>0</b>	---	---
Oil Changed	Client Info		<b>N/A</b>	---	---
Sample Status			<b>ABNORMAL</b>	---	---

## CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	<b>NEG</b>	---	---

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	<b>10</b>	---
Chromium	ppm	ASTM D5185(m)	>5	<b>0</b>	---
Nickel	ppm	ASTM D5185(m)	>5	<b>0</b>	---
Titanium	ppm	ASTM D5185(m)		<b>0</b>	---
Silver	ppm	ASTM D5185(m)	>7	<b>&lt;1</b>	---
Aluminum	ppm	ASTM D5185(m)	>25	<b>2</b>	---
Lead	ppm	ASTM D5185(m)	>45	<b>▲ 111</b>	---
Copper	ppm	ASTM D5185(m)	>225	<b>51</b>	---
Tin	ppm	ASTM D5185(m)	>10	<b>&lt;1</b>	---
Antimony	ppm	ASTM D5185(m)		<b>0</b>	---
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	---
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	---
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	---

## ADDITIVES


	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<b>25</b>	---
Barium	ppm	ASTM D5185(m)		<b>&lt;1</b>	---
Molybdenum	ppm	ASTM D5185(m)		<b>10</b>	---
Manganese	ppm	ASTM D5185(m)		<b>0</b>	---
Magnesium	ppm	ASTM D5185(m)		<b>123</b>	---
Calcium	ppm	ASTM D5185(m)		<b>2330</b>	---
Phosphorus	ppm	ASTM D5185(m)		<b>757</b>	---
Zinc	ppm	ASTM D5185(m)		<b>885</b>	---
Sulfur	ppm	ASTM D5185(m)		<b>4349</b>	---
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	---

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>125	<b>6</b>	---
Sodium	ppm	ASTM D5185(m)		<b>3</b>	---
Potassium	ppm	ASTM D5185(m)	>20	<b>0</b>	---



# OIL ANALYSIS REPORT

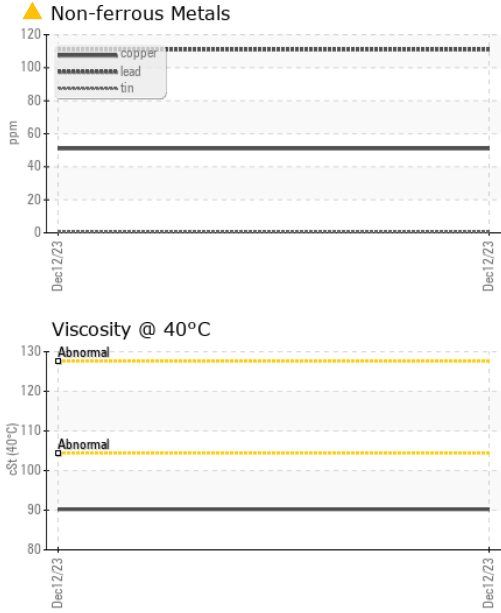


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	---	---
Precipitate	scalar	Visual*	NONE	---	---
Silt	scalar	Visual*	NONE	---	---
Debris	scalar	Visual*	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	---	---
Appearance	scalar	Visual*	NORML	---	---
Odor	scalar	Visual*	NORML	---	---
Emulsified Water	scalar	Visual*	>0.1	---	---
Free Water	scalar	Visual*	---	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	90.2	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

## GRAPHS

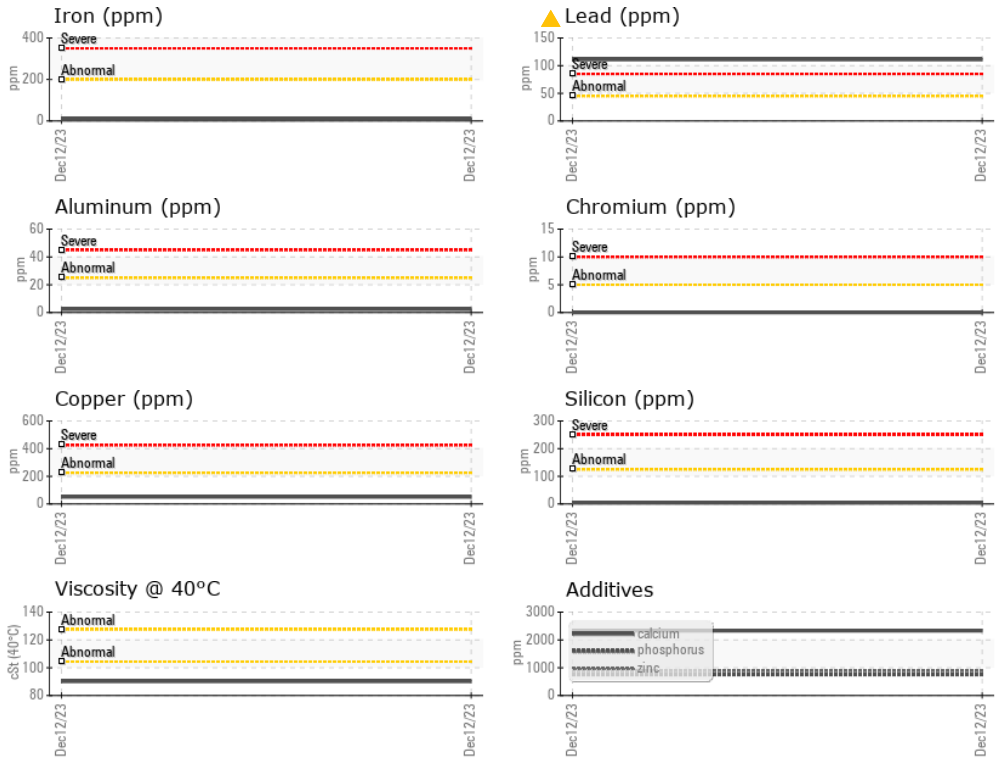

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0884555 **Received** : 15 Dec 2023  
**Lab Number** : 02603535 **Diagnosed** : 18 Dec 2023  
**Unique Number** : 5696620 **Diagnostician** : Kevin Marson  
**Test Package** : MOB 1

**Agnico Eagle Canada**  
 1350 Government Rd. W, MACASSA COMPLEX  
 Kirkland Lake, ON  
 CA P2N 3J1  
 Contact: Tony Tees  
 tony.tees@agnicoeagle.com  
 T: (705)567-5208  
 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.