

OIL ANALYSIS REPORT

^{Area}[6100229727] CD3029L313102

Component **Diesel Engine**

NOT GIVEN (--- GAL)

Sample Rating Trend **NORMAL**

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. Resample at the next service interval to monitor. No other corrective action is recommended at this time. The fluid was not specified, however, a fluid match indicates that this fluid is SAE 30 Diesel Engine Oil. Please confirm the oil type and grade, and specify the brand of the oil on your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

Light fuel dilution occurring. No other contaminants were detected in the oil.


Fluid Condition

Viscosity of sample indicates oil is within SAE 30 range, advise investigate. The condition of the oil is acceptable for the time in service.

				Dec2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WA0020868		
Sample Date		Client Info		14 Dec 2023		
Machine Age	hrs	Client Info		407		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.21	NEG		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>51	30		
Chromium	ppm	ASTM D5185(m)	>11	<1		
Nickel	ppm	ASTM D5185(m)	>5	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	<1		
Aluminum	ppm	ASTM D5185(m)	>31	5		
Lead	ppm	ASTM D5185(m)	>26	6		
Copper	ppm	ASTM D5185(m)	>26	74		
Tin	ppm	ASTM D5185(m)	>4	1		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		232		
Barium	ppm	ASTM D5185(m)		2		
Molybdenum	ppm	ASTM D5185(m)		257		
Manganese	ppm	ASTM D5185(m)		3		
Magnesium	ppm	ASTM D5185(m)		797		
Calcium	ppm	ASTM D5185(m)		1552		
Phosphorus	ppm	ASTM D5185(m)		869		
Zinc	ppm	ASTM D5185(m)		1039		
Sulfur	ppm	ASTM D5185(m)		2724		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>22	29		
Sodium	ppm	ASTM D5185(m)	>31	5		
Potassium	ppm	ASTM D5185(m)	>20	4		
Fuel	%	ASTM D7593*	>2.1	1.5		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0		
Nitration	Abs/cm	ASTM D7624*	>20	9.2		
Sulfation	Abs/.1mm	ASTM D7415*	>30	23.6		



OIL ANALYSIS REPORT

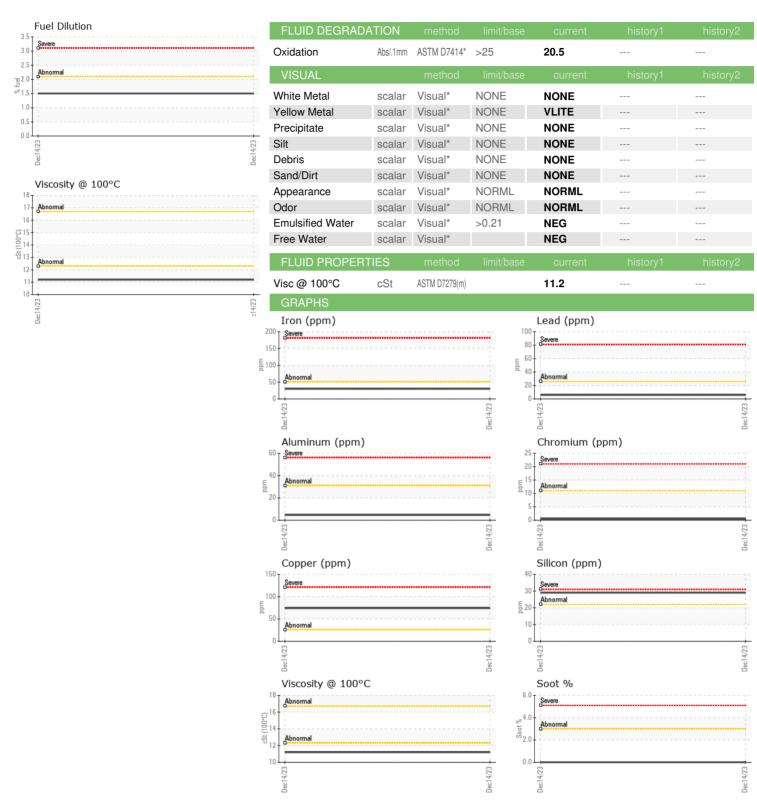





Laboratory Sample No. Lab Number **Unique Number**

: WA0020868

: 5697112

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved : 02604027

Diagnosed

: 20 Dec 2023 Diagnostician : Kevin Marson

: 19 Dec 2023

Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel, Visual) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Wajax Power Systems 70 Raddall Avenue Dartmouth, NS **CA B3B 1T7**

Contact: Danelle Hoffman dhoffman@wajax.com T: (902)468-6200

F: (902)468-3325