



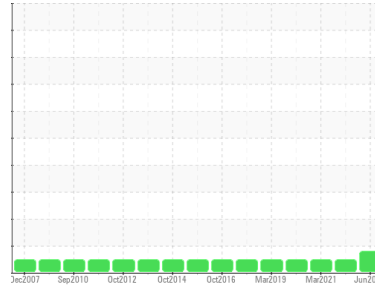
OIL ANALYSIS REPORT

Sample Rating Trend

WEAR



Area
Brockville Gen. Hospital #1 [450054809]
 Machine Id
CARRIER 3901Q66162
 Component
Chiller
 Fluid
SUMMIT CENTRIPUMP SPO-68 (--- GAL)



DIAGNOSIS

Recommendation
 This unit should be monitored closely by a service engineer as these wear conditions tend to advance rapidly. We recommend an early resample to monitor this condition.

Wear
 Tin ppm levels are abnormal. Bearing wear is indicated.

Contamination
 There is no indication of any contamination in the oil.

Fluid Condition
 The AN level is acceptable for this fluid.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		GTT0001322	GTT12333	GTT12334
Sample Date	Client Info		26 Jun 2023	05 Apr 2023	01 Mar 2021
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			ABNORMAL	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >8	2	<1	<1
Chromium	ppm	ASTM D5185(m) >2	0	<1	<1
Nickel	ppm	ASTM D5185(m)	0	---	---
Titanium	ppm	ASTM D5185(m)	0	---	---
Silver	ppm	ASTM D5185(m) >2	0	---	---
Aluminum	ppm	ASTM D5185(m) >3	<1	<1	<1
Lead	ppm	ASTM D5185(m) >2	<1	<1	<1
Copper	ppm	ASTM D5185(m) >8	4	<1	<1
Tin	ppm	ASTM D5185(m) >4	▲ 12	<1	<1
Antimony	ppm	ASTM D5185(m)	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	<1	---	---
Barium	ppm	ASTM D5185(m)	0	---	---
Molybdenum	ppm	ASTM D5185(m)	0	---	---
Manganese	ppm	ASTM D5185(m)	0	---	---
Magnesium	ppm	ASTM D5185(m)	0	---	---
Calcium	ppm	ASTM D5185(m)	0	---	---
Phosphorus	ppm	ASTM D5185(m)	442	---	---
Zinc	ppm	ASTM D5185(m)	8	2	2
Sulfur	ppm	ASTM D5185(m)	0	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	11	---	---
Sodium	ppm	ASTM D5185(m)	<1	---	---
Potassium	ppm	ASTM D5185(m) >20	0	---	---
ppm Water	ppm	ASTM D6304* >100	131	111	108

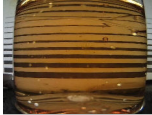
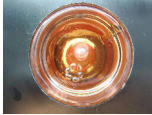
FLUID DEGRADATION

	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.11	0.051	0.083

OIL ANALYSIS REPORT

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	67.2	65.1	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image

GRAPHS



Sample No. : GTT0001322 **Recieved** : 28 Dec 2023
Lab Number : 02605656 **Diagnosed** : 05 Jan 2024
Unique Number : 5698741 **Diagnostician** : Bill Quesnel
Test Package : IND 2 (Additional Tests: KV40)

To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26.

Test denoted () outside scope of accreditation, (m) method modified, (e) tested at external lab.*

Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

Carrier Commerical Service
 C/O Conduent Div of Carrier Canada, 1-2740 Matheson Blvd
 Mississauga, ON
 CA L4W 4X3
 Contact: Brian Raymundo
 Brian.Raymundo@carrier.com

T:
F: