


OIL ANALYSIS REPORT



York University Glendon #1 [1-1NMPLUCU] **YORK GEHM127749**

Component Chiller

YORK TYPE C (--- GAL)

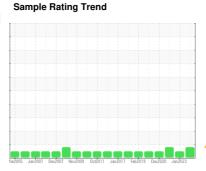



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

The elevated copper reading suggests the effects of oil migration through the evaporator (oil loss from the compressor) possibly occurring during intervals of operation at low cooling load conditions.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0001299	GTT29611	GTT29612
Sample Date		Client Info		29 Sep 2023	18 Jan 2023	10 Nov 2021
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	ABNORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	2	<1	1
Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>2	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>8	△ 35	16	<u>^</u> 28
Tin	ppm	ASTM D5185(m)	>4	0	<1	<1
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	<1		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	0	0		
Calcium	ppm	ASTM D5185(m)	0	<1		
Phosphorus	ppm	ASTM D5185(m)	0	8		
Zinc	ppm	ASTM D5185(m)	0	2	2	1
Sulfur	ppm	ASTM D5185(m)	200	202		
Lithium	ppm	ASTM D5185(m)		1		
CONTAMINANTS	,	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	3		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
ppm Water	ppm	ASTM D6304*	>50	18		62
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.11	0.07		0.147



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	VLITE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	LIGHT		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	63.8	39.8		
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image
GRAPHS						



 Sample No.
 : GTT0001299
 Recieved
 : 28 Dec 2023

 Lab Number
 : 02605694
 Diagnosed
 : 09 Jan 2024

 Unique Number
 : 5698779
 Diagnostician
 : Bill Quesnel

 Test Package
 : IND 2 (Additional Tests: KV40)

Johnson Controls - Markham Accounts Payable A-33, P.O. Box 2012

Accounts Payable A-33, P.O. Box 2012 Milwaukee, WI

US 532012012 Contact: Service Manager

To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

Report Id: GTT0000206 [WCAMIS] 02605694 (Generated: 01/09/2024 09:04:37) Rev: 1

Contact/Location: Service Manager - GTT0000206

T: