


## **OIL ANALYSIS REPORT**

## PORT



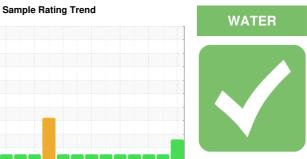

# 55 Metcalfe St. Ch#2 [4500054809] Machine Id CARRIER 0211Q20352

Chiller

COMP OIL (POE) ISO 68 (--- GAL)

## DIAGNOSIS

#### Recommendation

If not recently done change any filter driers to reduce moisture level. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

#### Wear

All component wear rates are normal.

### Contamination

The elevated moisture content is associated with POE oils which are hygroscopic, and can absorb moisture from sampling and processing.

#### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

68 ( GAL)		Oct2012	Oct2014 Feb 2016	Sep2017 Mar2020 Dec2021	Oct2023	
SAMPLE INFORI	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0001440	GTT741	GTT742
Sample Date		Client Info		31 Oct 2023	05 Apr 2023	07 Dec 2021
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ATTENTION	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	2	<1	2
Chromium	ppm	ASTM D5185(m)	>2	0	<1	<1
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>2	<1	<1	<1
Copper	ppm	ASTM D5185(m)	>8	0	<1	<1
Tin	ppm	ASTM D5185(m)	>4	<1	<1	<1
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	1		
Barium	ppm	ASTM D5185(m)	5	0		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	5	<1		
Calcium	ppm	ASTM D5185(m)	5	0		
Phosphorus	ppm	ASTM D5185(m)	400	1		
Zinc	ppm	ASTM D5185(m)	5	2	<1	1
Sulfur	ppm	ASTM D5185(m)	100	20		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	S	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	25		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	5		
ppm Water	ppm	ASTM D6304*	>100	▲ 514	203	150
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.40	0.17	0.126	0.138



# **OIL ANALYSIS REPORT**

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
FLUID PROPERT	IES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68	63.0		
SAMPLE IMAGES	5	method	limit/base	current	history1	history2
Color					no image	no image
Bottom					no image	no image
						-



Sample No. : GTT0001440 Recieved : 03 Jan 2024 Lab Number : 02606393 Diagnosed : 12 Jan 2024 Unique Number : 5707479 Diagnostician : Bill Quesnel

Mississauga, ON CA L4W 4X3 Test Package : IND 2 (Additional Tests: KV40) Contact: Brian Raymundo

To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

F:

Report Id: GTT0000224 [WCAMIS] 02606393 (Generated: 01/12/2024 14:20:04) Rev: 1

Contact/Location: Brian Raymundo - GTT0000224

T:

**Carrier Commerical Service** 

Brian.Raymundo@carrier.com

C/O Conduent Div of Carrier Canada, 1-2740 Matheson Blvd