


OIL ANALYSIS REPORT

Machine Id **SL09** Component **Diesel Engine**

DIESEL ENGINE OIL SAE 15W40 (--- GAL)



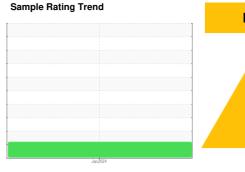

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

There is a moderate amount of fuel present in the oil. Tests confirm the presence of fuel in the oil.


Fluid Condition

Fuel is present in the oil and is lowering the viscosity. The oil is no longer serviceable due to the presence of contaminants.

				Jan 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0886136		
Sample Date		Client Info		03 Jan 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				ABNORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Water		WC Method	>0.2	NEG		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	6		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>4	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	0		
Aluminum	ppm	ASTM D5185(m)	>20	2		
Lead	ppm	ASTM D5185(m)	>40	<1		
Copper	ppm	ASTM D5185(m)	>330	2		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	80		
Barium	ppm	ASTM D5185(m)	10	0		
Molybdenum	ppm	ASTM D5185(m)	100	27		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	450	340		
Calcium	ppm	ASTM D5185(m)	3000	1715		
Phosphorus	ppm	ASTM D5185(m)	1150	775		
Zinc	ppm	ASTM D5185(m)	1350	859		
Sulfur	ppm	ASTM D5185(m)	4250	2289		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	4		
Sodium	ppm	ASTM D5185(m)	>158	2		
Potassium	ppm	ASTM D5185(m)	>20	5		
Fuel	%	ASTM D7593*	>5	<u>▲</u> 5.3		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0.1		
Nitration	Abs/cm	ASTM D7624*	>20	6.1		
Sulfation	Abs/.1mm	ASTM D7415*	>30	21.5		



OIL ANALYSIS REPORT

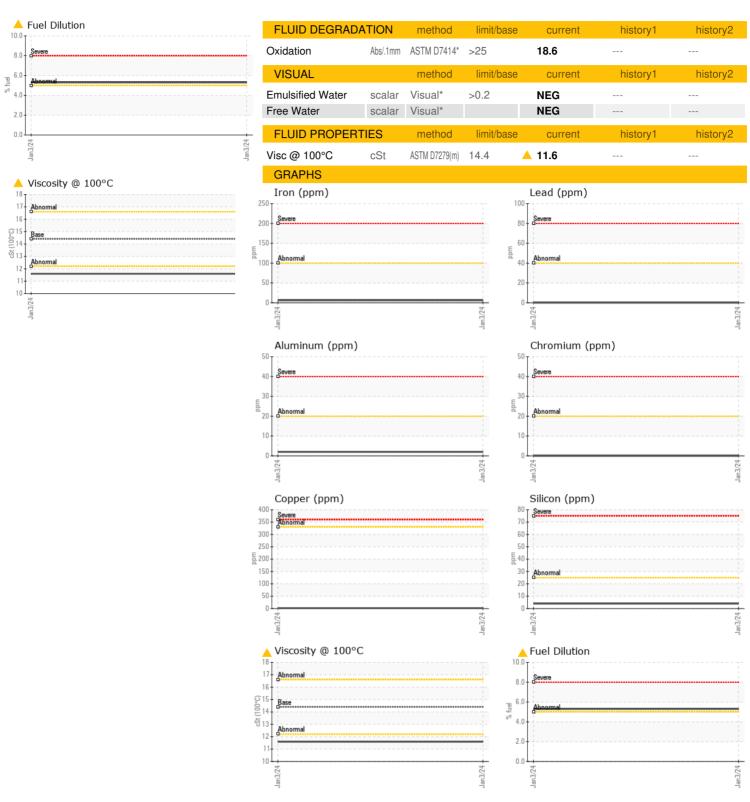



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: 02608134

: WC0886136

: 5709220

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Recieved : 11 Jan 2024 Diagnosed : 12 Jan 2024

Diagnostician : Wes Davis

Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel)

1350 Government Rd. W, MACASSA COMPLEX Kirkland Lake, ON CA P2N 3J1

Contact: Mitch Lamontagne $AEM_KL_macassao il samplere sults@agnico eagle.com$

T: (705)567-5208 F: (705)567-5221

Agnico Eagle Canada

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.