

OIL ANALYSIS REPORT

Area Goodyear - G04000 A2401094

Component Hydraulic System Fluid AW HYDRAULIC OIL ISO 68 (--- GAL)

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample.

Wear

Copper, iron and lead ppm levels are noted.

Contamination

Silicon ppm levels are notably high.

Fluid Condition

{not applicable}

				Jan2024		
SAMPLE INFORM	/IATION	method	limit/base	current	history1	history2
Batch #		Client Info		2024 01 0160		
Department		Client Info		Production		
Sample From		Client Info		Machine		
Production Stage		Client Info		Final		
Sent to WC		Client Info		01/19/2024		
Sample Number		Client Info		E30001223		
Sample Date		Client Info		18 Jan 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
-				-		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	34		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>20	1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>20	5		
Lead	ppm	ASTM D5185(m)	>20	13		
Copper	ppm	ASTM D5185(m)	>20	101		
Tin	ppm	ASTM D5185(m)	>20	<1		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	5	0		
Barium	ppm	ASTM D5185(m)	5	<1		
Molybdenum	ppm	ASTM D5185(m)	5	0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)	25	7		
Calcium	ppm	ASTM D5185(m)	200	43		
Phosphorus	ppm	ASTM D5185(m)	300	559		
Zinc	ppm	ASTM D5185(m)	370	414		
Sulfur	ppm	ASTM D5185(m)	2500	1936		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	11		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	<1		
Water	%	ASTM D6304*	>0.05	0.001		
ppm Water	ppm	ASTM D6304*	>500	15		

Sample Rating Trend






OIL ANALYSIS REPORT

FLUID CLEANLINESS

Particles >4µm

Particles >6um

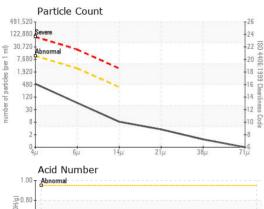







461


56

>10000

>2500

ASTM D7647

ASTM D7647

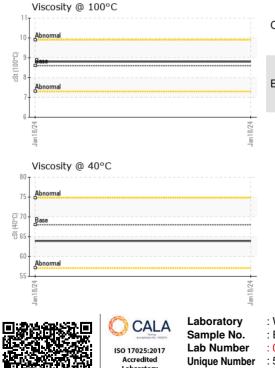

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Environmental 360 Solutions Ltd. Recieved : 23 Jan 2024 : E30001223 640 Victoria Street Cobourg, ON : 02610589 Diagnosed : 24 Jan 2024 CA K9A 5H5 : 5711675 Diagnostician : Tatiana Sorkina Laboratory Test Package : IND 2 (Additional Tests: KF, KV100, VI) Contact: Tatiana Sorkina To discuss this sample report, contact Customer Service at 1-905-372-2251. tsorkina@e360s.ca T: (800)263-3939 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied. F: (905)373-4950