


OIL ANALYSIS REPORT

L1 CUTOFF (S/N H6434)

Hydraulic System

PETRO CANADA ENDURATEX EP 100 (--- 0

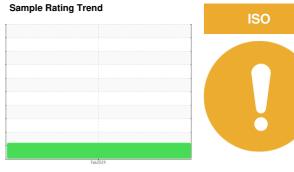

Recommendation

The filter change at the time of sampling has been noted. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

There is a light amount of silt (particulates < 14 microns in size) present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

GAL)				Feb 2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0905528		
Sample Date		Client Info		15 Feb 2024		
Machine Age	hrs	Client Info		1500		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				ATTENTION		
CONTAMINATION	٧	method	limit/base	current	history1	history2
Water		WC Method	>0.05	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>20	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>20	0		
Copper	ppm	ASTM D5185(m)	>20	2		
Tin	ppm	ASTM D5185(m)	>20	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	50	40		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	0	<1		
Calcium	ppm	ASTM D5185(m)		3		
Phosphorus	ppm	ASTM D5185(m)	270	284		
Zinc	ppm	ASTM D5185(m)	0	8		
Sulfur	ppm	ASTM D5185(m)	4500	3286		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<1		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	8627		
Tarticies >+μπ						
Particles >6µm		ASTM D7647	>1300	<u> </u>		
Particles >6μm Particles >14μm		ASTM D7647 ASTM D7647	>160	56		
Particles >6μm Particles >14μm Particles >21μm		ASTM D7647 ASTM D7647 ASTM D7647	>160 >40	56 13		
Particles >6μm Particles >14μm Particles >21μm Particles >38μm		ASTM D7647 ASTM D7647 ASTM D7647 ASTM D7647	>160 >40 >10	56 13 4		
Particles >6μm Particles >14μm Particles >21μm		ASTM D7647 ASTM D7647 ASTM D7647	>160 >40	56 13		



OIL ANALYSIS REPORT

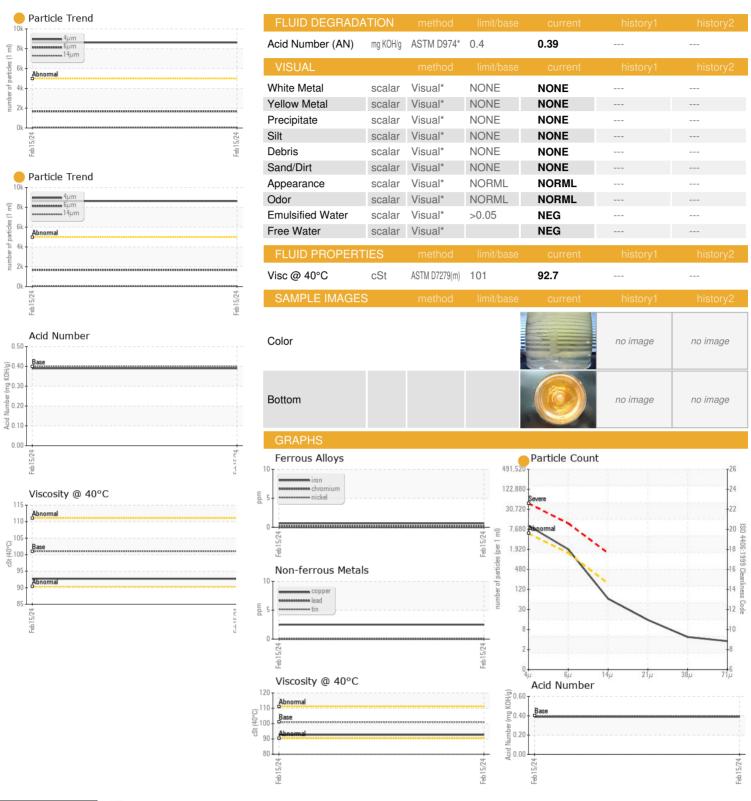



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No.

Lab Number Unique Number : 5747798 Test Package : IND 2

: WC0905528 : 02622679

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : 18 Mar 2024 Received **Tested** : 19 Mar 2024 Diagnosed

: 19 Mar 2024 - Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

LARSEN & SHAW LTD

575 DURHAM ST. WEST WALKERTON, ON CA NOG 2V0 Contact: Derek Kuntz dkuntz@larsenhinge.com

T: (519)881-1320 F: 519883593