


OIL ANALYSIS REPORT

Sample Rating Trend





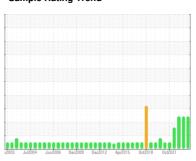

PBK-G-TUBR

Component

Bearing

MOBIL DTE OIL HVY MEDIUM (32 LTR)

D	IΑ	G١	VС	S	IS

Recommendation

We advise that you check for the source of water entry. Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We advise that you follow the water drain-off procedure for this component. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

Free water present.


Fluid Condition


The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.


		52003 Jul201	J4 Jun2006 Dec2009	Dec2012 Apr2015 Oct2018	Oct2021	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0455720	WC0455740	WC0455748
Sample Date		Client Info		01 Feb 2024	24 May 2023	15 Nov 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	ABNORMAL	ABNORMAL
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m)	>63	1	1	1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	0	0	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>2	0	<1	0
Lead	ppm	ASTM D5185(m)	>161	30	23	24
Copper	ppm	ASTM D5185(m)	>13	3	4	1
Tin	ppm	ASTM D5185(m)	>27	0	<1	0
Antimony	ppm	ASTM D5185(m)		0	<1	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		5	6	6
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		0	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		<1	0	0
Calcium	ppm	ASTM D5185(m)		0	0	0
Phosphorus	ppm	ASTM D5185(m)		117	133	120
Zinc	ppm	ASTM D5185(m)		32	40	39
Sulfur	ppm	ASTM D5185(m)		1182	1392	1312
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>12	2	1	1
Sodium	ppm	ASTM D5185(m)		0	<1	<1
Potassium	ppm	ASTM D5185(m)	>20	0	0	<1
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.08	0.06	0.07



OIL ANALYSIS REPORT

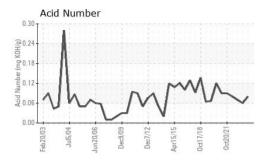

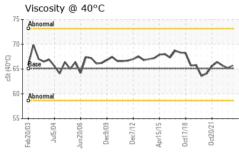

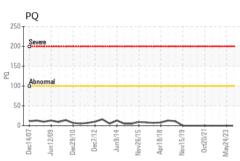

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	VLITE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE	VLITE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	▲ WGOIL	▲ WGOIL	▲ WGOIL
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	.5%	.5%	.5%
Free Water	scalar	Visual*		<u>^</u> 5%	5 %	<u>^</u> 1%
FLUID PROPERTIES		method	limit/base	current	history1	history2


	-				/	,
/isc @ 40°C	cSt	ASTM D7279(m)	65.1	65.7	65.2	65.7


method

Color



SAMPLE IMAGES

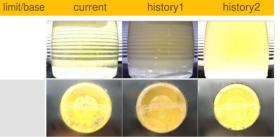

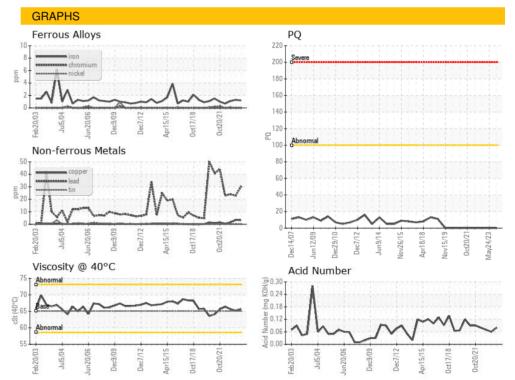





Laboratory Sample No.

Lab Number : 02624330 Unique Number : 5749449

: WC0455720

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Received : 25 Mar 2024 **Tested** Diagnosed

: 26 Mar 2024

: 26 Mar 2024 - Kevin Marson

Test Package : IND 2 (Additional Tests: TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

NEWFOUNDLAND POWER INC.

50 DUFFY PLACE, PO BOX 8910 ST. JOHNS, NL CA A1B 3P6

Contact: Paul Martin pmartin@newfoundlandpower.com

F: (709)737-2926

T: