


OIL ANALYSIS REPORT

NO UNIT WC0915116

Component

Hydraulic System

PETRO CANADA PRODURO TO-4 SAE 50 (--- GAL)

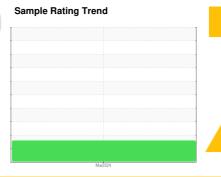



DIAGNOSIS

Recommendation

We advise that you check all areas where dirt can enter the system. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. Please specify the component make and model with your next sample. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using MOB 2 test kits, this testkit includes Particle Count to determine the ISO cleanliness of the fluid.

Wear

All component wear rates are normal.

Contamination

There is a moderate concentration of dirt present in the oil.


Fluid Condition

The oil is no longer serviceable due to the presence of contaminants.

				Mar2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0915116		
Sample Date		Client Info		25 Mar 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				ABNORMAL		
CONTAMINATIO	V	method	limit/base	current	history1	history2
Water		WC Method	>0.1	NEG		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		1		
Iron	ppm	ASTM D5185(m)	>20	28		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>10	1		
Lead	ppm	ASTM D5185(m)	>10	0		
Copper	ppm	ASTM D5185(m)	>75	7		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	2	4		
Barium	ppm	ASTM D5185(m)	0	<1		
Molybdenum	ppm	ASTM D5185(m)	0	2		
Manganese	ppm	ASTM D5185(m)	0	0		
Magnesium	ppm	ASTM D5185(m)	9	35		
Calcium	ppm	ASTM D5185(m)	3114	2818		
Phosphorus	ppm	ASTM D5185(m)	1099	863		
Zinc	ppm	ASTM D5185(m)	1245	1037		
Sulfur	ppm	ASTM D5185(m)	7086	8577		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	△ 31		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	0		



OIL ANALYSIS REPORT

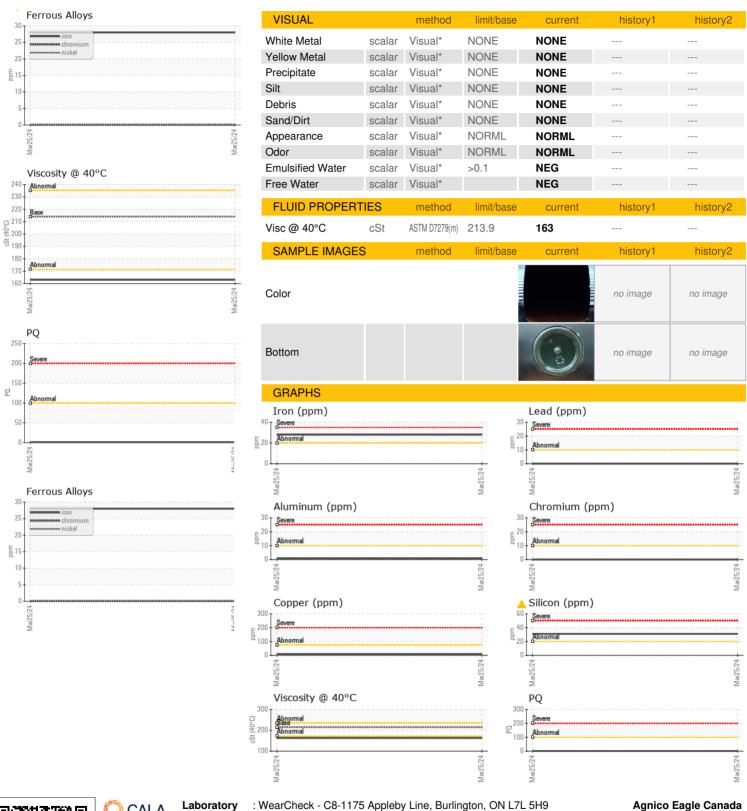



CALA ISO 17025:2017 Accredited

Laboratory Sample No.

: WC0915116 Lab Number : 02624717

Unique Number : 5749836 Test Package: MOB 1 (Additional Tests: PQ)

Received **Tested**

Diagnosed

: 26 Mar 2024 · 26 Mar 2024

: 26 Mar 2024 - Kevin Marson

1350 Government Rd. W, MACASSA COMPLEX

Kirkland Lake, ON CA P2N 3J1 Contact: Mitch Lamontagne

 $AEM_KL_macassao il samplere sults@agnico eagle.com$ To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (705)567-5208 F: (705)567-5221