



OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL



Machine Id
32 BECK

Component
Diesel Engine

Fluid
DIESEL ENGINE OIL SAE 10W30 (--- LTR)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. Please specify the component make and model with your next sample.

Wear

All component wear rates are normal.

Contamination

Fuel content negligible. There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0897609	---	---
Sample Date	Client Info		26 Feb 2024	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---
Glycol	WC Method		NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >100	10	---	---
Chromium	ppm	ASTM D5185(m) >20	0	---	---
Nickel	ppm	ASTM D5185(m) >4	<1	---	---
Titanium	ppm	ASTM D5185(m)	0	---	---
Silver	ppm	ASTM D5185(m) >3	0	---	---
Aluminum	ppm	ASTM D5185(m) >20	2	---	---
Lead	ppm	ASTM D5185(m) >40	3	---	---
Copper	ppm	ASTM D5185(m) >330	7	---	---
Tin	ppm	ASTM D5185(m) >15	4	---	---
Antimony	ppm	ASTM D5185(m)	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 250	72	---	---
Barium	ppm	ASTM D5185(m) 10	0	---	---
Molybdenum	ppm	ASTM D5185(m) 100	105	---	---
Manganese	ppm	ASTM D5185(m)	0	---	---
Magnesium	ppm	ASTM D5185(m) 450	665	---	---
Calcium	ppm	ASTM D5185(m) 3000	796	---	---
Phosphorus	ppm	ASTM D5185(m) 1150	628	---	---
Zinc	ppm	ASTM D5185(m) 1350	745	---	---
Sulfur	ppm	ASTM D5185(m) 4250	1713	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS



	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >25	8	---	---
Sodium	ppm	ASTM D5185(m)	2	---	---
Potassium	ppm	ASTM D5185(m) >20	1	---	---
Fuel	%	ASTM D7593* >5	0.7	---	---

INFRA-RED

	method	limit/base	current	history1	history2
Soot %	%	ASTM D7844* >3	0	---	---
Nitration	Abs/cm	ASTM D7624* >20	7.4	---	---
Sulfation	Abs./1mm	ASTM D7415* >30	16.8	---	---



OIL ANALYSIS REPORT

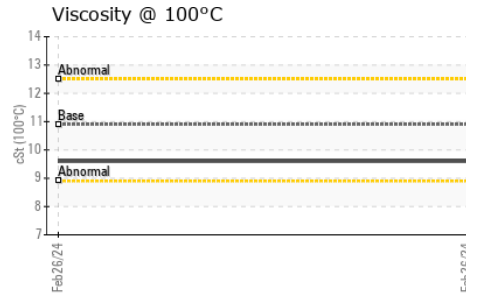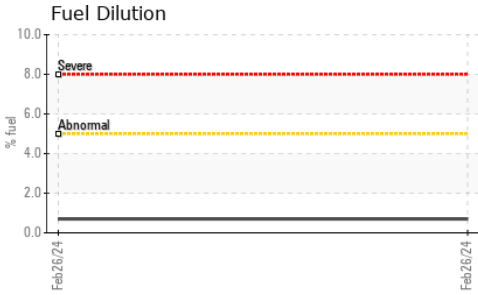

FLUID DEGRADATION

method	limit/base	current	history1	history2
Abs./1mm	ASTM D7414*	>25	---	---









VISUAL

method	limit/base	current	history1	history2
scalar	Visual*	>0.2	---	---
scalar	Visual*	NEG	---	---

FLUID PROPERTIES

method	limit/base	current	history1	history2
cSt	ASTM D7279(m)	10.9	---	---

GRAPHS

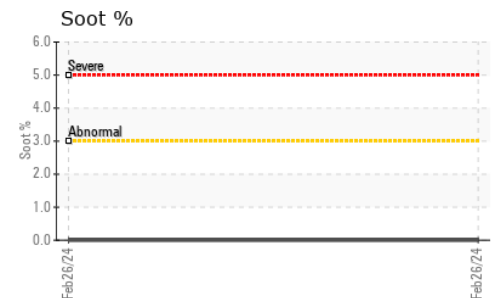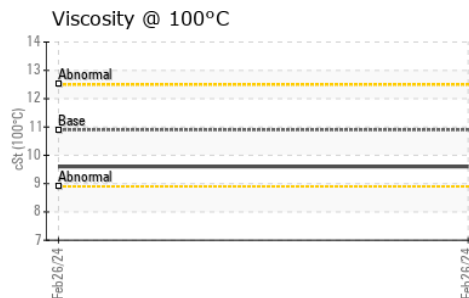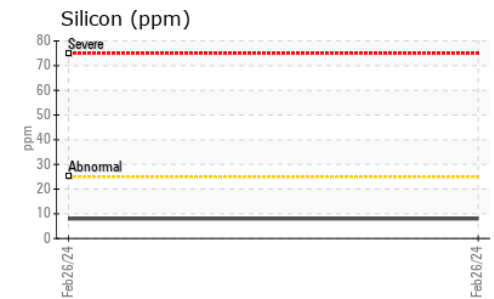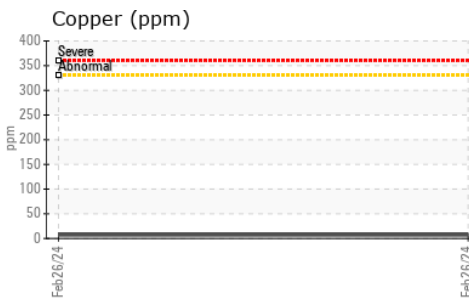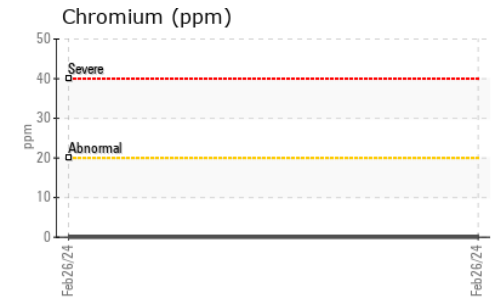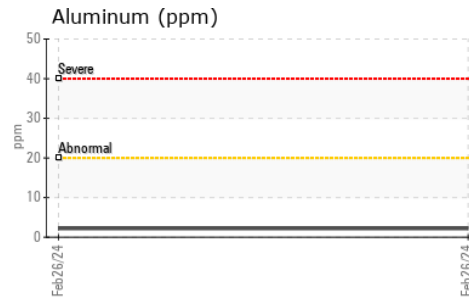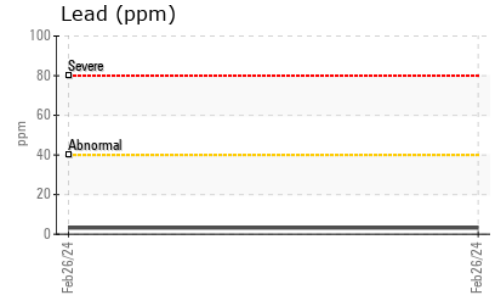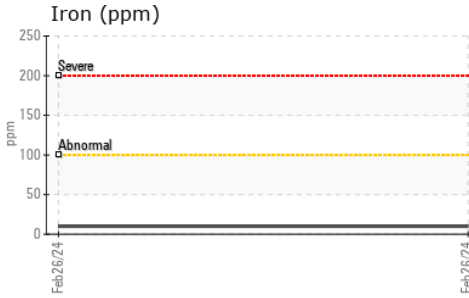

ISO 17025:2017
Accredited
Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0897609
Lab Number : 02625626
Unique Number : 5750745
Test Package : MOB 1 (Additional Tests: FuelDilution, PercentFuel)

Received : 01 Apr 2024
Tested : 02 Apr 2024
Diagnosed : 02 Apr 2024 - Kevin Marson

NORTHERN GENERATOR CO. LTD.
 80 ASHBRIDGE CIRCLE,, UNIT #1 & 2
 WOODBRIDGE, ON
 CA L4L 3R5

Contact: Selome Afework
 selome@northerngenerator.com

T: (905)264-9744
 F: (905)264-9714

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.