




OIL ANALYSIS REPORT

Sample Rating Trend

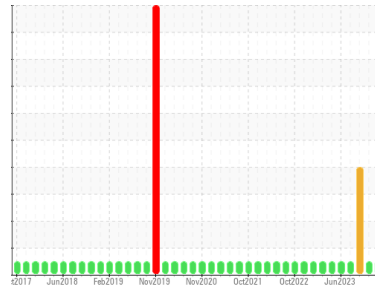

NORMAL

Machine Id
178
 Component
Rear Transmission (Auto)
 Fluid
CASTROL TRANSYND (24 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the fluid.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the fluid is suitable for further service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0889002	WC0889120	WC0889180
Sample Date	Client Info		08 Apr 2024	21 Feb 2024	27 Dec 2023
Machine Age	kms	Client Info	0	0	0
Oil Age	kms	Client Info	47595	38623	29631
Oil Changed	Client Info		Not Chngd	Not Chngd	Not Chngd
Sample Status			NORMAL	NORMAL	SEVERE

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>230	71	63	56
Chromium	ppm	ASTM D5185(m)	>2	0	0	0
Nickel	ppm	ASTM D5185(m)	>5	0	<1	0
Titanium	ppm	ASTM D5185(m)	>2	0	0	0
Silver	ppm	ASTM D5185(m)	>5	0	0	<1
Aluminum	ppm	ASTM D5185(m)	>65	19	14	10
Lead	ppm	ASTM D5185(m)	>55	5	5	4
Copper	ppm	ASTM D5185(m)	>85	25	20	16
Tin	ppm	ASTM D5185(m)	>5	2	2	1
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)	150	69	67	69
Barium	ppm	ASTM D5185(m)	0	0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		<1	0	0
Magnesium	ppm	ASTM D5185(m)	0	<1	1	1
Calcium	ppm	ASTM D5185(m)	40	123	124	125
Phosphorus	ppm	ASTM D5185(m)	320	232	236	232
Zinc	ppm	ASTM D5185(m)	5	5	4	4
Sulfur	ppm	ASTM D5185(m)	1050	1443	1595	1610
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS




	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>20	6	6	5
Sodium	ppm	ASTM D5185(m)		4	4	2
Potassium	ppm	ASTM D5185(m)	>20	<1	2	1

FLUID DEGRADATION

	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D974*	1.0	1.21	0.97	1.06




OIL ANALYSIS REPORT

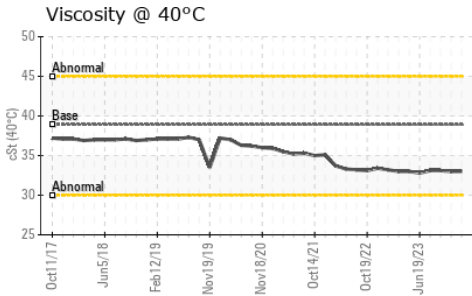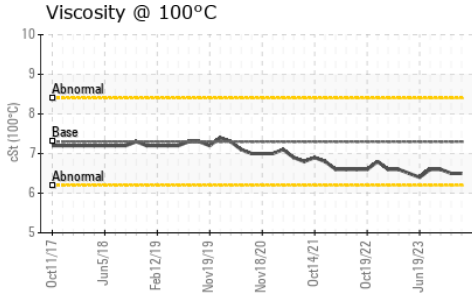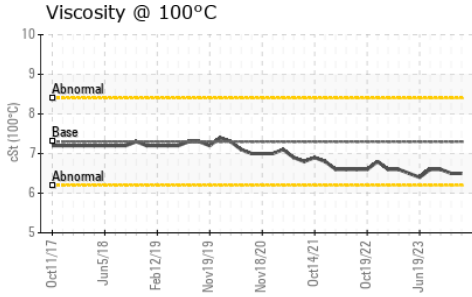









VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	38.9	33.0	33.1
Visc @ 100°C	cSt	ASTM D7279(m)	7.3	6.5	6.6
Viscosity Index (VI)	Scale	ASTM D2270*	168	154	159

SAMPLE IMAGES

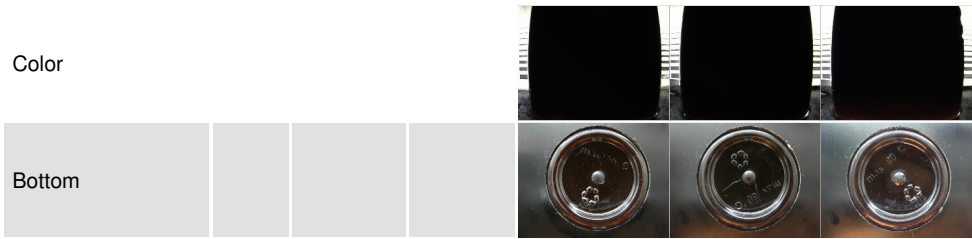

GRAPHS

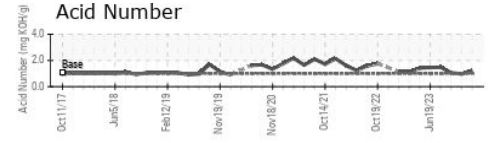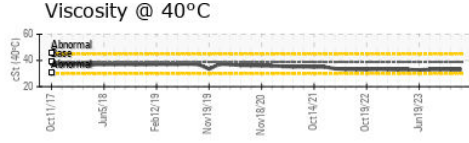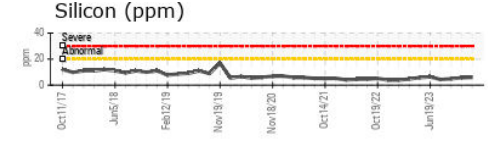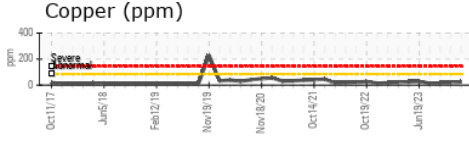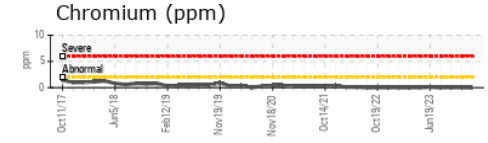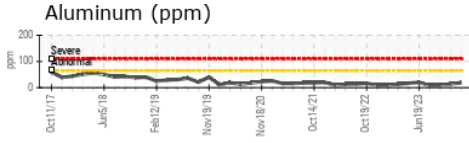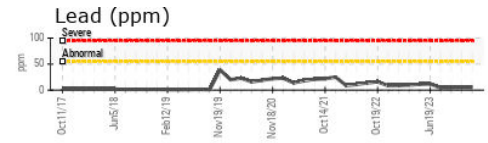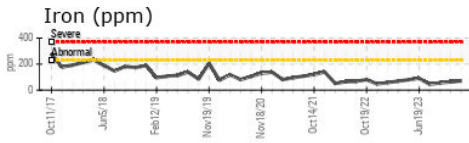

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0889002 **Received** : 15 Apr 2024
Lab Number : 02628928 **Tested** : 16 Apr 2024
Unique Number : 5762060 **Diagnosed** : 16 Apr 2024 - Wes Davis
Test Package : MOB 2 (Additional Tests: KV100, TAN Man, VI)

CITY OF THUNDER BAY
 AUTO MAINTENANCE STORES, 570 FORT WILLIAM ROAD
 THUNDER BAY, ON
 CA P7B 2Z8
 Contact: Sean Malcolm
 sean.malcolm@thunderbay.ca
 T: (807)684-2716
 F: (807)344-0237

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.