

# **OIL ANALYSIS REPORT**

Sample Rating Trend







SL08 Component Front Differential Fluid SAE 75W140 (--- GAL)

### DIAGNOSIS

Machine Id

## Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the oil.

## **Fluid Condition**

The condition of the oil is acceptable for the time in service.

				Apr2024		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0916286		
Sample Date		Client Info		15 Apr 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>.2	NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	45		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		<1		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	1		
Lead	ppm	ASTM D5185(m)	>25	<1		
Copper	ppm	ASTM D5185(m)	>100	3		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		18		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)		2		
Calcium	ppm	ASTM D5185(m)		18		
Phosphorus	ppm	ASTM D5185(m)		604		
Zinc	ppm	ASTM D5185(m)		100		
Sulfur	ppm	ASTM D5185(m)		12922		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	5	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>75	7		
Sodium	ppm	ASTM D5185(m)		10		
				_		


ASTM D5185(m) >20


ppm

Potassium



## **OIL ANALYSIS REPORT**

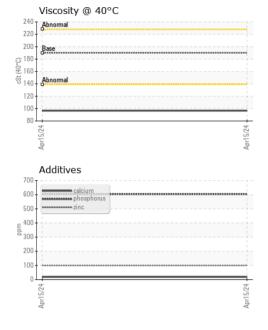

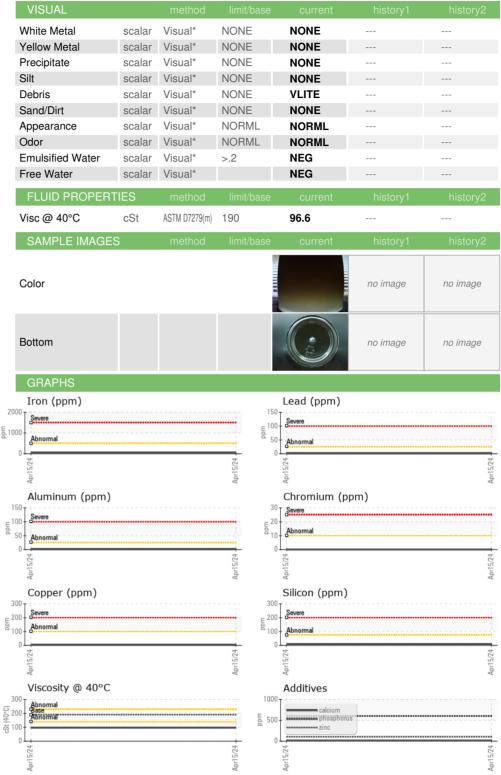



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No.

: WC0916286 Lab Number : 02629748

Unique Number : 5762880

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received **Tested** Diagnosed

: 17 Apr 2024 : 17 Apr 2024 : 17 Apr 2024 - Wes Davis

Agnico Eagle Canada

1350 Government Rd. W, MACASSA COMPLEX Kirkland Lake, ON CA P2N 3J1 Contact: Mitch Lamontagne

F: (705)567-5221

Test Package : MOB 1 To discuss this sample report, contact Customer Service at 1-800-268-2131.

AEM\_KL\_macassaoilsampleresults@agnicoeagle.com T: (705)567-5208

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Contact/Location: Mitch Lamontagne - KIR370KIR