




OIL ANALYSIS REPORT

Sample Rating Trend

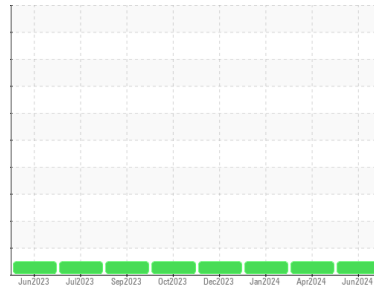

NORMAL



Machine Id

2225

Component

Natural Gas Engine

Fluid

VALVOLINE PREMIUM BLUE 9200 15W40 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0937134	WC0917500	WC0891062
Sample Date	Client Info		06 Jun 2024	16 Apr 2024	22 Jan 2024
Machine Age	kms	Client Info	76056	66078	47637
Oil Age	kms	Client Info	0	0	0
Oil Changed	Client Info		N/A	N/A	N/A
Sample Status			NORMAL	NORMAL	NORMAL

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.1	NEG	NEG	NEG

WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>50	9	8	9
Chromium	ppm	ASTM D5185(m)	>4	<1	<1	<1
Nickel	ppm	ASTM D5185(m)	>2	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)	>3	0	0	0
Aluminum	ppm	ASTM D5185(m)	>9	1	<1	2
Lead	ppm	ASTM D5185(m)	>30	0	0	<1
Copper	ppm	ASTM D5185(m)	>35	1	1	1
Tin	ppm	ASTM D5185(m)	>4	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		12	17	17
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		56	56	55
Manganese	ppm	ASTM D5185(m)		<1	<1	0
Magnesium	ppm	ASTM D5185(m)		854	854	833
Calcium	ppm	ASTM D5185(m)		1293	1286	1276
Phosphorus	ppm	ASTM D5185(m)		676	687	719
Zinc	ppm	ASTM D5185(m)		886	889	895
Sulfur	ppm	ASTM D5185(m)		1950	1942	2157
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS

	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>+100	4	3	4
Sodium	ppm	ASTM D5185(m)		5	2	2
Potassium	ppm	ASTM D5185(m)	>20	0	<1	<1

INFRA-RED



	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*		0	0	0
Nitration	Abs/cm	ASTM D7624*	>20	13.0	12.2	11.9
Sulfation	Abs/.1mm	ASTM D7415*	>30	23.0	21.3	22.3

FLUID DEGRADATION

	method	limit/base	current	history1	history2	
Oxidation	Abs/.1mm	ASTM D7414*	>25	20.6	19.1	19.2











OIL ANALYSIS REPORT

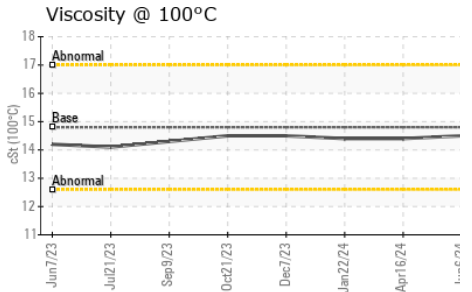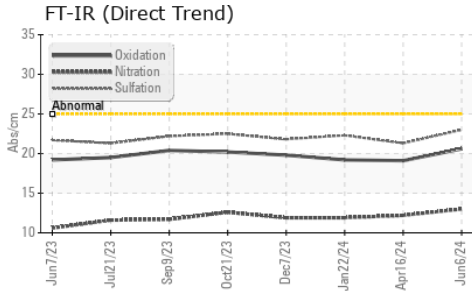

VISUAL	method	limit/base	current	history1	history2
Emulsified Water	scalar	Visual*	>0.1	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)	14.8	14.4	14.4

GRAPHS

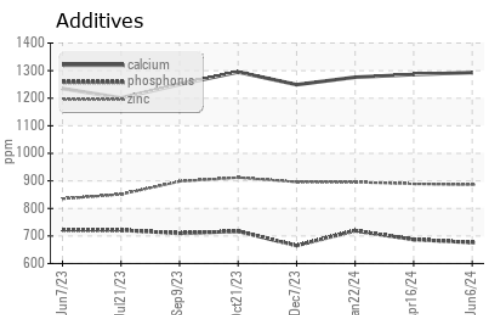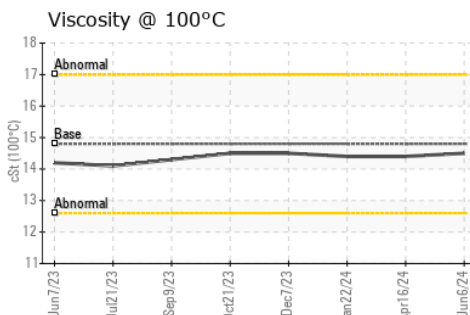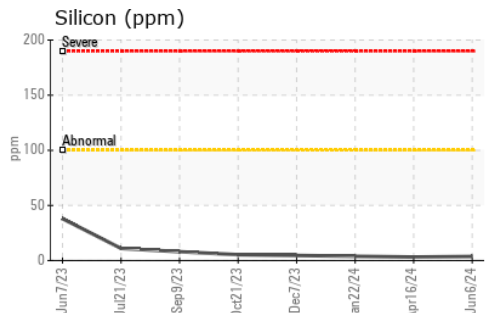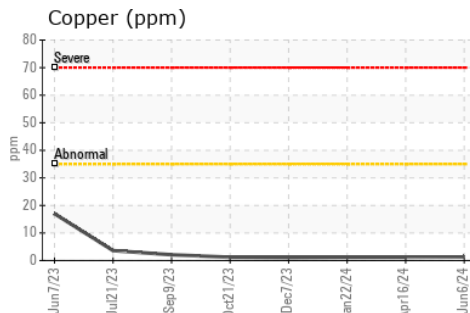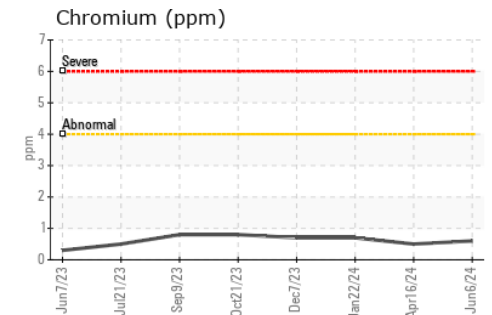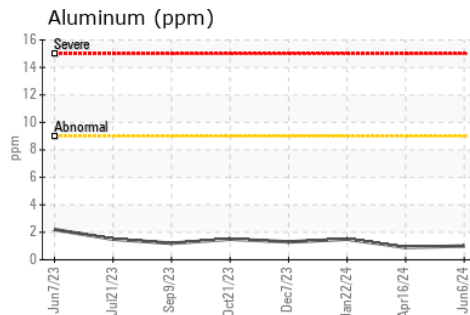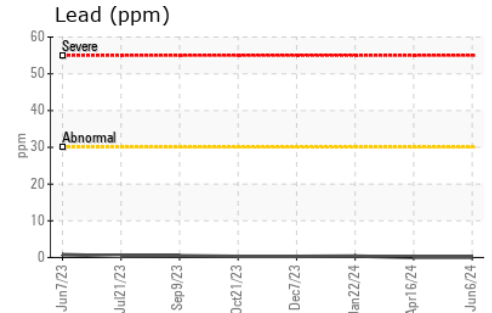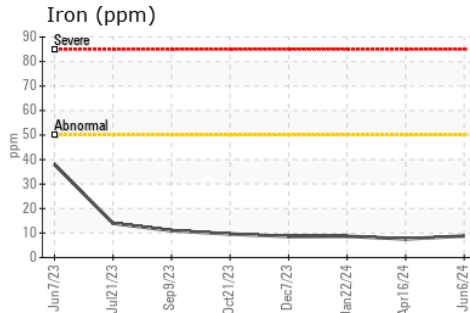

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0937134
Lab Number : 02641330
Unique Number : 5798869
Test Package : MOB 1
Received : 12 Jun 2024
Tested : 12 Jun 2024
Diagnosed : 12 Jun 2024 - Wes Davis

CITY OF HAMILTON
 2200 UPPER JAMES., MOUNTAIN TRANSIT STOREROOM
 MOUNT HOPE, ON
 CA L0R 1W0
 Contact: Cliff Bird
 cliff.bird@hamilton.ca

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

F: (905)679-4502