



OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL



Machine Id
EPIROC SIMBA 57 LH016
 Component
Front Right Planetary
 Fluid
SAE 80W140 (--- GAL)

DIAGNOSIS

Recommendation

The oil change at the time of sampling has been noted. Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to monitor.

Wear

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

Viscosity of sample indicates oil is within SAE 30 range, advise investigate. This plus the additive levels indicates that this is not the same brand, or type of oil as reported. The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0937684	---	---
Sample Date	Client Info		10 Jun 2024	---	---
Machine Age	hrs	Client Info	359	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		Changed	---	---
Sample Status			NORMAL	---	---

CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---

WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		319	---	---
Iron	ppm	ASTM D5185(m) >500	637	---	---
Chromium	ppm	ASTM D5185(m) >10	8	---	---
Nickel	ppm	ASTM D5185(m) >10	0	---	---
Titanium	ppm	ASTM D5185(m)	<1	---	---
Silver	ppm	ASTM D5185(m)	0	---	---
Aluminum	ppm	ASTM D5185(m) >25	<1	---	---
Lead	ppm	ASTM D5185(m) >25	0	---	---
Copper	ppm	ASTM D5185(m) >75	3	---	---
Tin	ppm	ASTM D5185(m) >10	0	---	---
Antimony	ppm	ASTM D5185(m) >5	0	---	---
Vanadium	ppm	ASTM D5185(m)	0	---	---
Beryllium	ppm	ASTM D5185(m)	0	---	---
Cadmium	ppm	ASTM D5185(m)	0	---	---

ADDITIVES




	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	117	---	---
Barium	ppm	ASTM D5185(m)	20	---	---
Molybdenum	ppm	ASTM D5185(m)	0	---	---
Manganese	ppm	ASTM D5185(m)	8	---	---
Magnesium	ppm	ASTM D5185(m)	5	---	---
Calcium	ppm	ASTM D5185(m)	812	---	---
Phosphorus	ppm	ASTM D5185(m)	713	---	---
Zinc	ppm	ASTM D5185(m)	1562	---	---
Sulfur	ppm	ASTM D5185(m)	6057	---	---
Lithium	ppm	ASTM D5185(m)	<1	---	---

CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >75	156	---	---
Sodium	ppm	ASTM D5185(m)	6	---	---
Potassium	ppm	ASTM D5185(m) >20	<1	---	---



OIL ANALYSIS REPORT

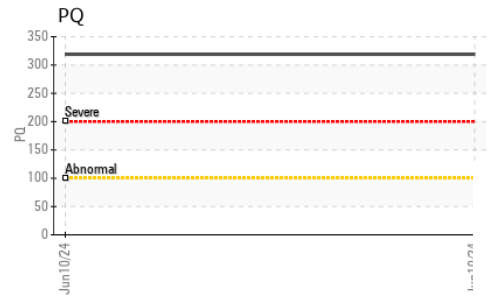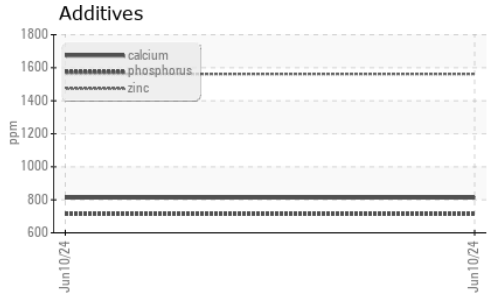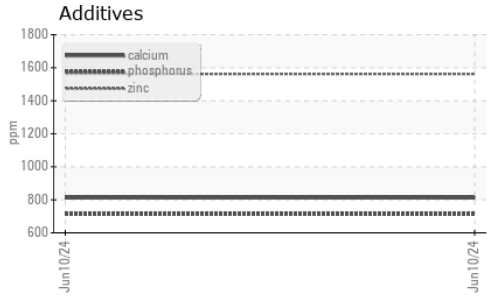









VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	LIGHT	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---
Appearance	scalar	Visual*	NORML	NORML	---
Odor	scalar	Visual*	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.2	NEG	---
Free Water	scalar	Visual*		NEG	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	275	85.5	---

SAMPLE IMAGES	method	limit/base	current	history1	history2
---------------	--------	------------	---------	----------	----------

Color				no image	no image
Bottom				no image	no image

GRAPHS

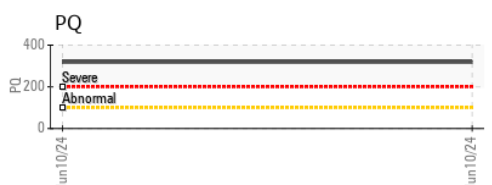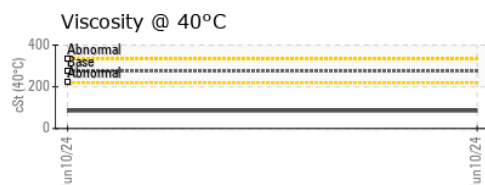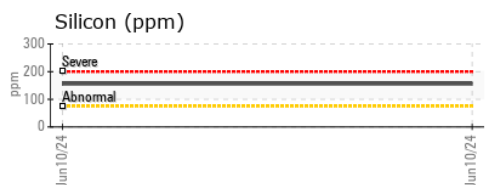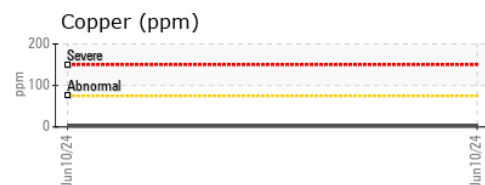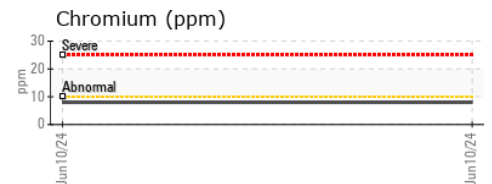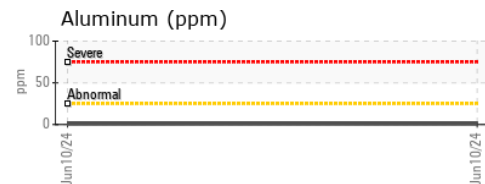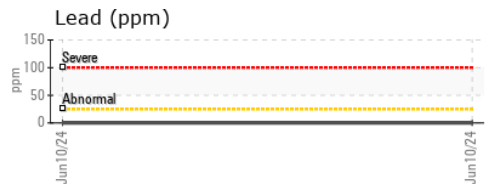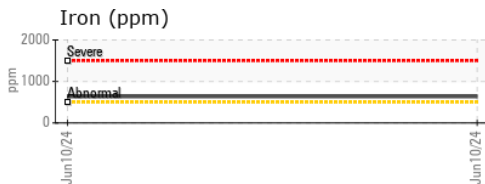

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0937684 **Received** : 13 Jun 2024
Lab Number : **02641792** **Tested** : 13 Jun 2024
Unique Number : 5799331 **Diagnosed** : 14 Jun 2024 - Kevin Marson
Test Package : MOB 1 (Additional Tests: PQ)

Agnico Eagle Canada
 1350 Government Rd. W, MACASSA COMPLEX
 Kirkland Lake, ON
 CA P2N 3J1
 Contact: Mitch Lamontagne
 AEM_KL_macassaoilsampleresults@agnicoeagle.com

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

T: (705)567-5208
 F: (705)567-5221