


OIL ANALYSIS REPORT

UNASSIGNED **CL2 FILLER B**

Component **Gearbox**

CHEVRON MEROPA 220 (7 LTR)

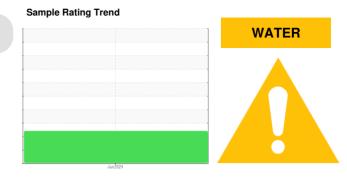

DIAGNOSIS

Recommendation

We advise that you check for the source of water entry. Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition.

Wear

All component wear rates are normal.

Contamination

There is a moderate concentration of water present in the oil.


Fluid Condition

The AN level is acceptable for this fluid. The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0737083		
Sample Date		Client Info		10 Jun 2024		
Machine Age	mths	Client Info		0		
Oil Age	mths	Client Info		5		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0		
Iron	ppm	ASTM D5185(m)	>200	16		
Chromium	ppm	ASTM D5185(m)	>15	0		
Nickel	ppm	ASTM D5185(m)	>15	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	0		
Lead	ppm	ASTM D5185(m)	>100	0		
Copper	ppm	ASTM D5185(m)	>200	8		
Tin	ppm	ASTM D5185(m)	>25	<1		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		16		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		10		
Phosphorus	ppm	ASTM D5185(m)		155		
Zinc	ppm	ASTM D5185(m)		16		
Sulfur	ppm	ASTM D5185(m)		6061		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	2		
Sodium	ppm	ASTM D5185(m)		2		
Potassium	ppm	ASTM D5185(m)	>20	2		
Water	%	ASTM D6304*	>0.2	<u> </u>		
ppm Water	ppm	ASTM D6304*	>2000	<u> 5471</u>		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.45		



OIL ANALYSIS REPORT

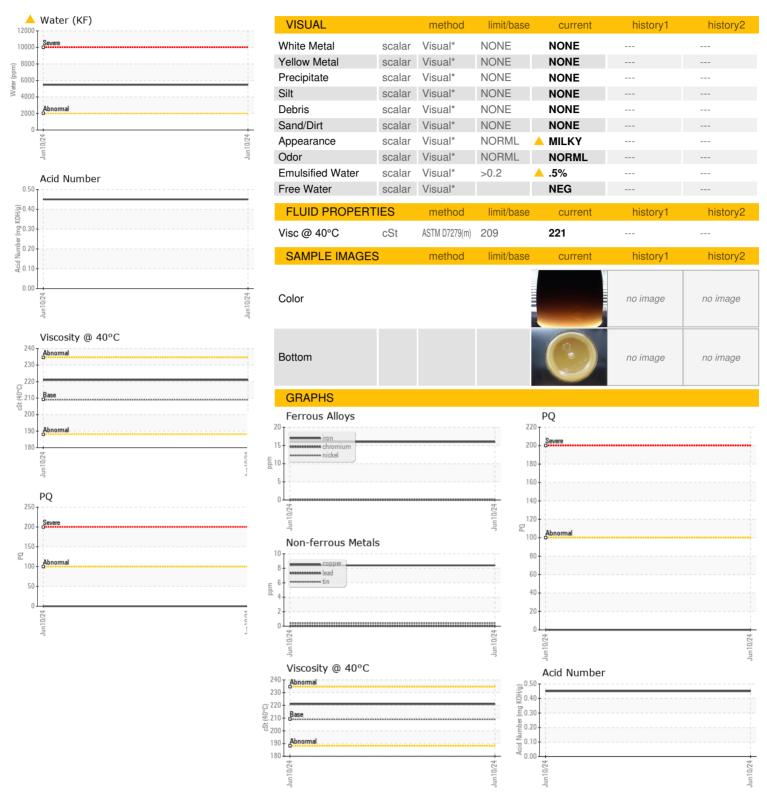



CALA ISO 17025:2017 Accredited Laboratory

Laboratory

Sample No. Lab Number

: 02641851 Unique Number : 5799390

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0737083

Received

Validity of results and interpretation are based on the sample and information as supplied.

: 13 Jun 2024 **Tested** Diagnosed

: 14 Jun 2024 : 14 Jun 2024 - Kevin Marson

Test Package : IND 2 (Additional Tests: KF, TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Christopher.Galamb@Refresco.com Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

REFRESCO NORTH AMERICA

6525 VISCOUNT RD

MISSISSAUGA, ON

Contact: Chris Galamb

T: (289)328-0128

CA L4V 1H6

Report Id: REF652MIS [WCAMIS] 02641851 (Generated: 06/14/2024 16:24:24) Rev: 1

F: