

OIL ANALYSIS REPORT

DOMTAR 136-768-1 [GTT224-445 DOMTAR] OTHER DOMTAR 136-768-1

Componer

Fluid Copeland Ultra 32-3MAF (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

Wear


All component wear rates are normal.

Contamination

The water content is negligible. There is no indication of any contamination in the oil.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

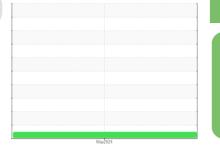

Sample Rating Trend



NORMAL

SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		GTT0003262		
Sample Date		Client Info		31 May 2024		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>8	2		
Chromium	ppm	ASTM D5185(m)	>2	0		
Nickel	ppm	ASTM D5185(m)		<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	0		
Aluminum	ppm	ASTM D5185(m)	>3	<1		
Lead	ppm	ASTM D5185(m)	>2	<1		
Copper	ppm	ASTM D5185(m)	>8	<1		
Tin	ppm	ASTM D5185(m)	>4	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	<1		
Barium	ppm	ASTM D5185(m)	0	0		
Molybdenum	ppm	ASTM D5185(m)	0	0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)	0	0		
Calcium	ppm	ASTM D5185(m)	0	<1		
Phosphorus	ppm	ASTM D5185(m)	600	13		
Zinc	ppm	ASTM D5185(m)	0	1		
Sulfur	ppm	ASTM D5185(m)	50	136		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	13		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
ppm Water	ppm	ASTM D6304*	>100	228		
FLUID DEGRADA		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.05	0.01		



OIL ANALYSIS REPORT

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
SAMPLE IMAGES						
SAMPLE IMAGES	3	method	limit/base	current	history1	history2
SAMPLE IMAGES	3	method	limit/base	current	history1 no image	history2 no image
	5	method	limit/base	current		



Lab Number : 02642217 Tested : 24 Jun 2024 Rock Forest, QC Unique Number : 5799756 Diagnosed : 24 Jun 2024 - Bill Quesnel Test Package : IND 2 (Additional Tests: KV40) Contact: Service Manager To discuss this sample report, contact Customer Service at 1-905-847-9300 Ext 26. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Damages: Seller shall in no event be liable for special, incidental, or consequential damages, of a commercial nature, resulting from any cause.

: 14 Jun 2024

Received

Report Id: GTT0000040 [WCAMIS] 02642217 (Generated: 06/24/2024 12:18:34) Rev: 1

Sample No. : GTT0003262

Contact/Location: Service Manager - GTT0000040 Page 2 of 2

Bridair Inc.

CA J1N 2B1

T:

F:

4704 boul Bertrand