




OIL ANALYSIS REPORT

Sample Rating Trend

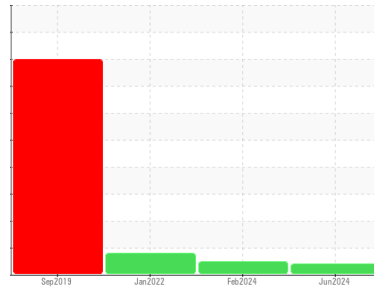

ADDITIVES



Machine Id

5 TRUNBION

Component

Trunnion Bearing

Fluid

MOBIL MOBILGEAR SHC 1000 (--- GAL)

DIAGNOSIS

Recommendation

We advise that you check all areas where contaminants can enter the system. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

Calcium and/or magnesium levels higher than normal indicating possible lime contamination, advise investigate.

Fluid Condition

The AN level is acceptable for this fluid.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0886533	WC0886525	WC0568991
Sample Date	Client Info			20 Jun 2024	01 Feb 2024	10 Jan 2022
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed	Client Info			Not Chngd	Not Chngd	N/A
Sample Status				ATTENTION	NORMAL	ATTENTION

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>2	NEG	NEG	NEG

WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		24	20	2
Iron	ppm	ASTM D5185(m)	>20	23	18	27
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		<1	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	3	2	2
Lead	ppm	ASTM D5185(m)	>20	17	14	11
Copper	ppm	ASTM D5185(m)	>20	59	51	91
Tin	ppm	ASTM D5185(m)	>20	4	3	3
Antimony	ppm	ASTM D5185(m)		<1	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		<1	0	<1
Magnesium	ppm	ASTM D5185(m)		20	18	10
Calcium	ppm	ASTM D5185(m)		256	178	75
Phosphorus	ppm	ASTM D5185(m)		267	286	225
Zinc	ppm	ASTM D5185(m)		5	4	4
Sulfur	ppm	ASTM D5185(m)		1305	1532	1079
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	16	16	23
Sodium	ppm	ASTM D5185(m)		0	0	0
Potassium	ppm	ASTM D5185(m)	>20	<1	1	5

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.29	0.09	0.28



OIL ANALYSIS REPORT

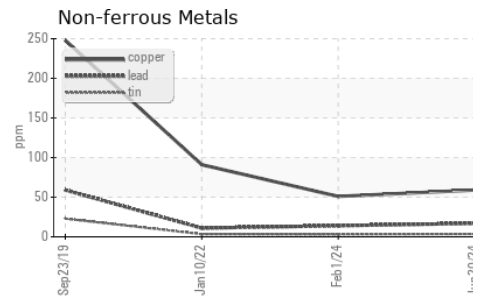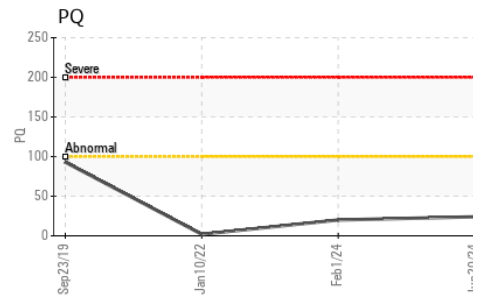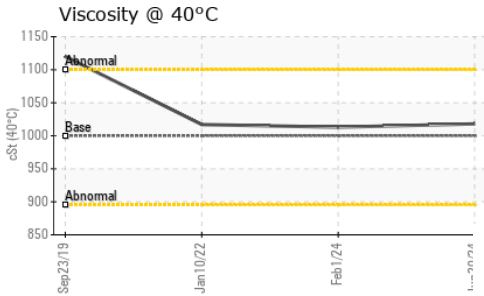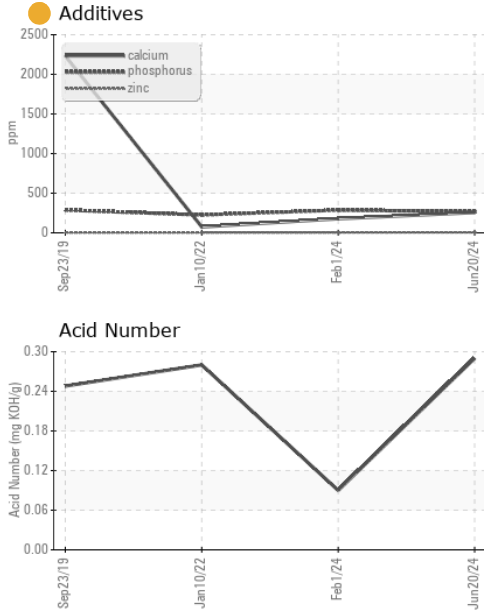






VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	1000	1018	1013

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color				
Bottom				

GRAPHS

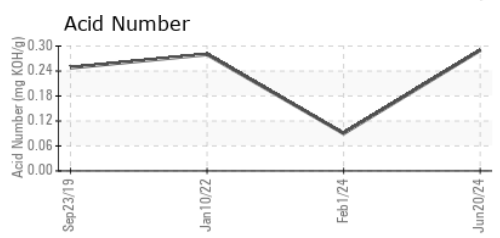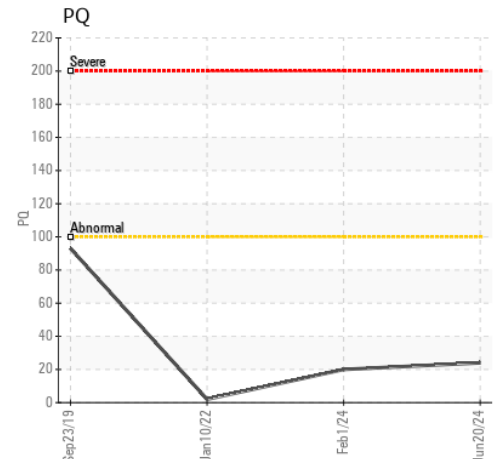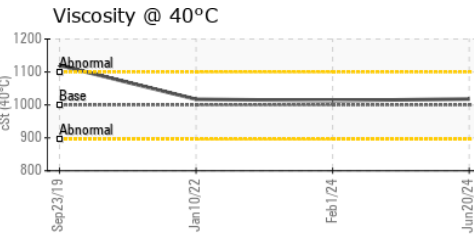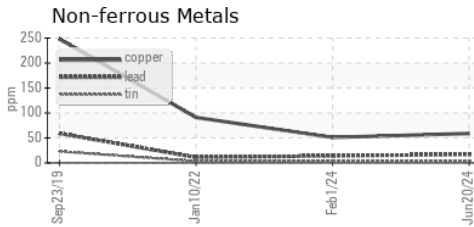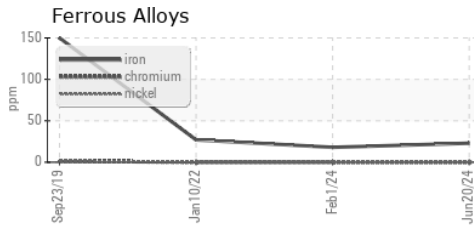

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0886533
Lab Number : 02643752
Unique Number : 5801291
Test Package : IND 2 (Additional Tests: TAN Man)

CARMEUSE LIME CANADA LTD.
 BOX 1690., HWY 17 EAST
 BLIND RIVER, ON
 CA P0R 1B0
 Contact: Rejean Baillargeon
 rejean.baillargeon@carmeusena.com
 T: (705)849-2201
 F: (705)849-2355

*To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.*