

OIL ANALYSIS REPORT

SAB1 SAB1 G9

Thrust Bearing

ESSO TERESSO ISO 46 (4250 LTR)

Sample Rating Trend





DIAGNOSIS

Recommendation

Resample at the next service interval to monitor. Please contact your representative for information regarding the proper sampling kits for your service. NOTE: We recommend using IND 3 test kits, this testkit includes Analytical Ferrography which provides a detailed morphological analysis of wear particles present in the fluid.

Wear

Component wear rates appear to be normal (unconfirmed).

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.


SAMPLE INFORMATION		method			history2
Sample Number		Client Info	WC0565948	WC0812612	WC0864639
Sample Date		Client Info	25 May 2024	15 May 2024	21 Dec 2023
Machine Age	hrs	Client Info	0	0	0
Oil Age	hrs	Client Info	0	0	0
Oil Changed		Client Info	N/A	N/A	N/A
Sample Status			NORMAL	NORMAL	NORMAL

Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>85	<1	0	0
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>40	<1	0	<1
Lead	ppm	ASTM D5185(m)	>60	0	0	0
Copper	ppm	ASTM D5185(m)	>7	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>40	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2

ADDITIVES		method				history2
Boron	ppm	ASTM D5185(m)	0	0	0	0
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Calcium	ppm	ASTM D5185(m)	0	<1	0	<1
Phosphorus	ppm	ASTM D5185(m)	2.4	3	3	2
Zinc	ppm	ASTM D5185(m)	0	1	1	<1
Sulfur	ppm	ASTM D5185(m)		636	622	664
Lithium	ppm	ASTM D5185(m)		<1	<1	<1

CONTAMINANTS		method				history2
Silicon	ppm	ASTM D5185(m)	>20	<1	0	<1
Sodium	ppm	ASTM D5185(m)		0	0	0
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	<1

			(/				
	FLUID CLEANLIN	ESS	method	limit/base	current	history1	history2
Pa	articles >4μm		ASTM D7647	>10000	923	996	158
Pa	articles >6µm		ASTM D7647	>1300	109	289	48
Pa	articles >14µm		ASTM D7647	>160	8	19	4
Pa	articles >21µm		ASTM D7647	>40	3	3	1
Pa	articles >38µm		ASTM D7647	>10	0	0	0
Pa	articles >71µm		ASTM D7647	>3	0	0	0
_	il Cleanliness 6:06) Rev: 1		ISO 4406 (c)	>20/17/14	17/14/10 Contact/Locat	17/15/11 ion: Michael Bro	14/13/9 ochu - ONTQUE

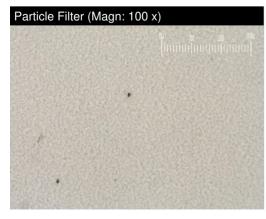

Report Id: ONTQUE [WCAMIS] 02645496 (Generated: 07/09/2024 16:56:06) Rev: 1



OIL ANALYSIS REPORT







Sample No.

Laboratory

: WC0565948 Lab Number : 02645496 Unique Number : 5803035

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

Received : 04 Jul 2024 **Tested** : 09 Jul 2024 Diagnosed

: 09 Jul 2024 - Kevin Marson Test Package : IND 2 (Additional Tests: BottomAnalysis, FilterPatch, PrtFilter)

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Ontario Power Generation NIAGARA PLANT GROUP,, 14000 NIAGARA PKWY

NIAGARA ON THE LAKE, ON

CA LOS 1J0 Contact: Michael Brochu mike.brochu@opg.com

T: (905)357-0322 F: (905)374-5466