

## **OIL ANALYSIS REPORT**

Sample Rating Trend

DIRT

#### Machine Id **150-M-032 Top Calender Roll** Component Bearing Fluid MOBIL SHC 630 (13 LTR)

### DIAGNOSIS

#### Recommendation

Check seals and/or filters for points of contaminant entry. The air breather requires service. If unrated, we recommend that you replace with a suitable micron rated and/or desiccant air breather. If rated, we recommend that you service/replace the breather. We recommend an early resample to monitor this condition.

## Wear

All component wear rates are normal.

## Contamination

Elemental level of silicon (Si) above normal indicating ingress of seal material.


## Fluid Condition


The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.


		H802020 0	ctzuzu Junzuz I Ma	2022 Oct2022 Jul2023	Feb2024	
SAMPLE INFORM	ATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0962306	WC0913366	WC0879799
Sample Date		Client Info		03 Jul 2024	26 Feb 2024	08 Nov 2023
Machine Age	hrs	Client Info		0	0	0
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		N/A	N/A	N/A
Sample Status				ABNORMAL	NORMAL	NORMAL
CONTAMINATIO	N	method	limit/base	current	history1	history2
Water		WC Method	>2	NEG	NEG	NEG
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0	0	0
Iron	ppm	ASTM D5185(m)	>20	0	0	0
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	<1
Aluminum	ppm	ASTM D5185(m)	>20	0	<1	0
Lead	ppm	ASTM D5185(m)	>20	0	0	0
Copper	ppm	ASTM D5185(m)	>20	<1	0	<1
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	0
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	<1
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		0	0	0
Calcium	ppm	ASTM D5185(m)		1	<1	<1
Phosphorus	ppm	ASTM D5185(m)		440	453	426
Zinc	ppm	ASTM D5185(m)		4	3	3
Sulfur	ppm	ASTM D5185(m)		86	59	39
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	<u> </u>	22	22
Sodium	ppm	ASTM D5185(m)		0	0	<1
Potassium	ppm	ASTM D5185(m)	>20	<1	<1	0
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		0.48	0.47	0.36



# **OIL ANALYSIS REPORT**

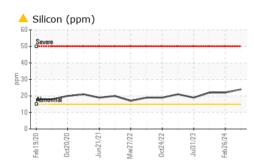


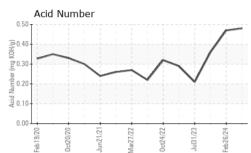

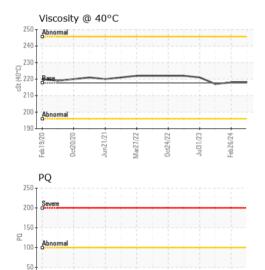

Feb19/20

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	VLITE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	VLITE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>2	NEG	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG	NEG
FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	217.7	218	218	217
SAMPLE IMAGES		method	limit/base	current	history1	history2
Color						eening .
Bottom						

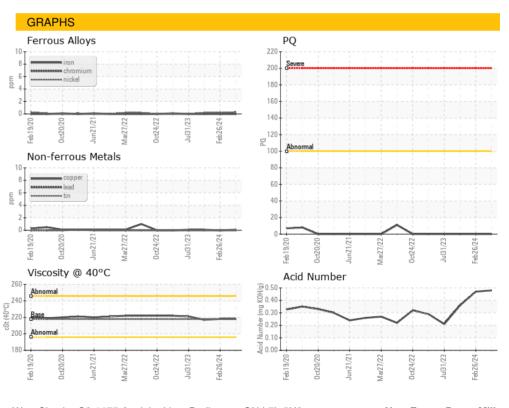

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **New Forest Paper Mill** Received : 04 Jul 2024 333 Progress Avenue Tested : 05 Jul 2024 Scarborough, ON Diagnosed : 05 Jul 2024 - Kevin Marson CA M1P 2Z7 Test Package : IND 2 (Additional Tests: TAN Man) Contact: Nayan Patel

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

: WC0962306

Report Id: NEWSCA [WCAMIS] 02645630 (Generated: 07/05/2024 16:48:38) Rev: 1

CALA

ISO 17025:2017 Accredited Laboratory

Jul31/23

Feb26/24

Laboratory

Sample No.

Lab Number : 02645630

Unique Number : 5803169

0ct24/22

Mar27/22

Submitted By: Bob Melanson

nayan\_patel@atlantic.ca

T: (519)991-8496

F: (416)298-5386

Page 2 of 2