




# OIL ANALYSIS REPORT

Sample Rating Trend

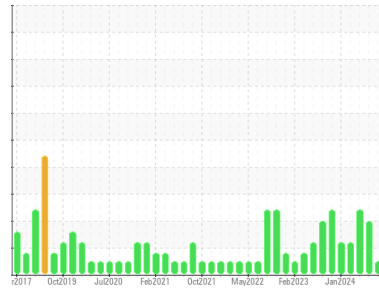

**NORMAL**



Machine Id  
**NEW FLYER 1105**  
 Component  
**Diesel Engine**  
 Fluid  
**SAFETY-KLEEN PERFORMANCE PLUS XHD-7 15W40 (--- GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

Test for glycol is negative. There is no indication of any contamination in the oil.

### Fluid Condition

The condition of the oil is acceptable for the time in service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0937300</b>	WC0937330	WC0877884
Sample Date	Client Info		<b>11 Jul 2024</b>	28 May 2024	08 Apr 2024
Machine Age	kms	Client Info	<b>846289</b>	835457	825170
Oil Age	kms	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	ATTENTION	SEVERE

## CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>3.0	<b>&lt;1.0</b>	▲ 2.1	▲ 6.6
Water	WC Method	>0.2	<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>75	<b>32</b>	32	13
Chromium	ppm	ASTM D5185(m)	>5	<b>&lt;1</b>	<1	<1
Nickel	ppm	ASTM D5185(m)	>4	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)	>2	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>15	<b>7</b>	3	1
Lead	ppm	ASTM D5185(m)	>25	<b>1</b>	<1	0
Copper	ppm	ASTM D5185(m)	>100	<b>1</b>	3	<1
Tin	ppm	ASTM D5185(m)	>4	<b>0</b>	0	0
Antimony	ppm	ASTM D5185(m)		<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		<b>2</b>	5	<1
Barium	ppm	ASTM D5185(m)		<b>0</b>	<1	0
Molybdenum	ppm	ASTM D5185(m)		<b>58</b>	64	57
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	0
Magnesium	ppm	ASTM D5185(m)		<b>925</b>	905	886
Calcium	ppm	ASTM D5185(m)		<b>989</b>	989	939
Phosphorus	ppm	ASTM D5185(m)		<b>932</b>	917	923
Zinc	ppm	ASTM D5185(m)		<b>1176</b>	1122	1092
Sulfur	ppm	ASTM D5185(m)		<b>2423</b>	2332	2385
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

## CONTAMINANTS




	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>25	<b>4</b>	8	2
Sodium	ppm	ASTM D5185(m)		<b>26</b>	163	35
Potassium	ppm	ASTM D5185(m)	>20	<b>9</b>	54	19
Glycol	%	ASTM D7922*		<b>0.0</b>	0.0	0.0

## INFRA-RED

	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*	>6	<b>1.1</b>	0.8	0.7
Nitration	Abs/cm	ASTM D7624*	>20	<b>9.7</b>	8.4	9.1
Sulfation	Abs./1mm	ASTM D7415*	>30	<b>23.2</b>	21.3	20.7



# OIL ANALYSIS REPORT






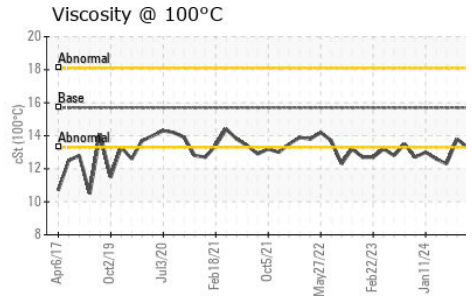
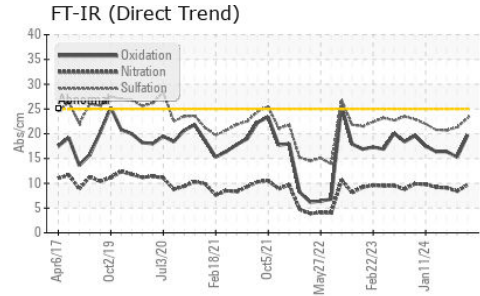
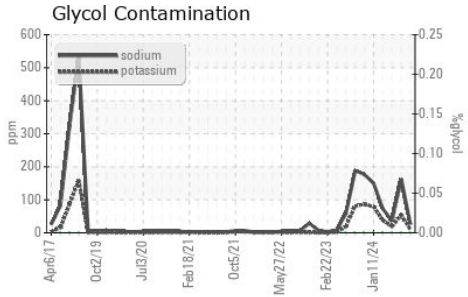


FLUID DEGRADATION	method	limit/base	current	history1	history2	
Oxidation	Abs./1mm	ASTM D7414*	>25	<b>19.7</b>	15.3	16.4

VISUAL	method	limit/base	current	history1	history2	
Emulsified Water	scalar	Visual*	>0.2	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 100°C	cSt	ASTM D7279(m)	15.7	<b>13.3</b>	13.8	▲ 12.3

## GRAPHS

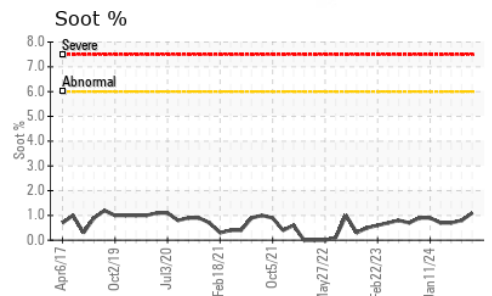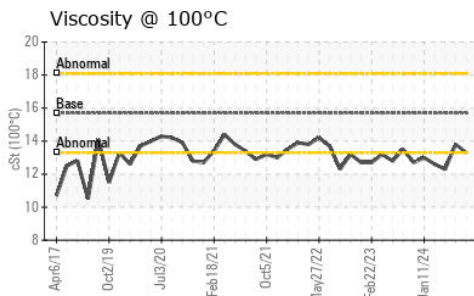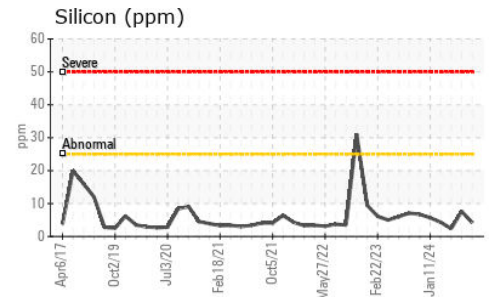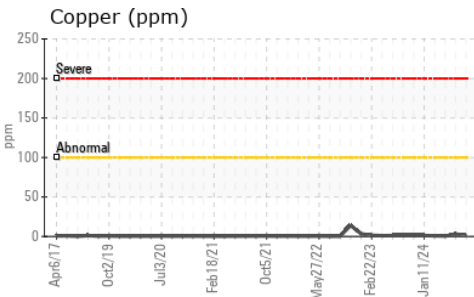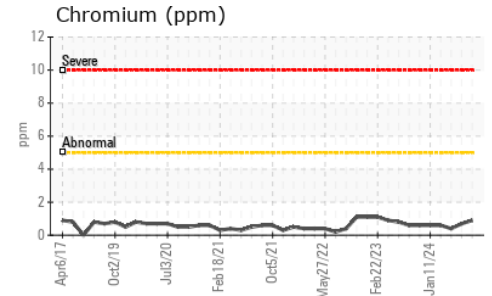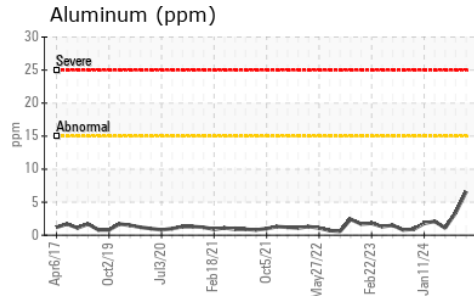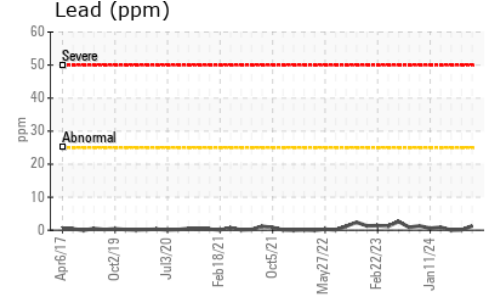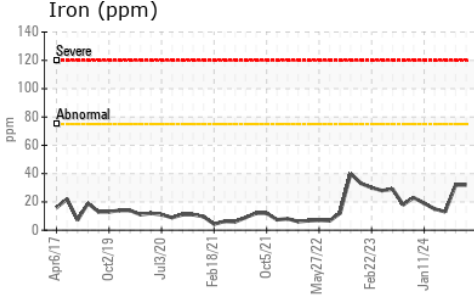

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0937300      **Received** : 15 Jul 2024  
**Lab Number** : **02647758**      **Tested** : 15 Jul 2024  
**Unique Number** : 5813310      **Diagnosed** : 15 Jul 2024 - Wes Davis  
**Test Package** : MOB 1 ( Additional Tests: Glycol )

**CITY OF HAMILTON**  
 2200 UPPER JAMES., MOUNTAIN TRANSIT STOREROOM  
 MOUNT HOPE, ON  
 CA L0R 1W0  
 Contact: Jeff Parr  
 jeff.parr@hamilton.ca  
 T: (905)546-2424  
 F: (905)679-4502

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.