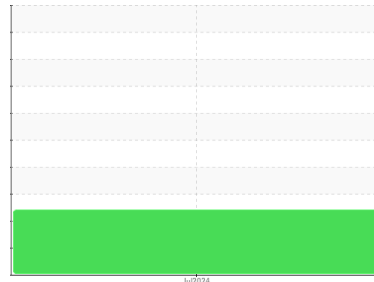




OIL ANALYSIS REPORT

Sample Rating Trend



WATER



Machine Id
KHS L2 MAIN FILLER DRIVE
 Component
Gearbox
 Fluid
KLUBER KLUBEROIL 4 UH1-460 N (--- GAL)

DIAGNOSIS

▲ Recommendation

We advise that you check for the source of water entry. Check seals and/or filters for points of contaminant entry. We recommend that you drain the oil from the component if this has not already been done. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

▲ Contamination

There is a moderate concentration of water present in the oil. Excessive free water present.

Fluid Condition

The oil is no longer serviceable due to the presence of contaminants.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0953981	---	---
Sample Date	Client Info		02 Jul 2024	---	---
Machine Age	hrs	Client Info	0	---	---
Oil Age	hrs	Client Info	0	---	---
Oil Changed	Client Info		N/A	---	---
Sample Status			ABNORMAL	---	---



CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>0.2	NEG	---	---

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	---
Yellow Metal	scalar	Visual*	NONE	NONE	---
Precipitate	scalar	Visual*	NONE	NONE	---
Silt	scalar	Visual*	NONE	NONE	---
Debris	scalar	Visual*	NONE	NONE	---
Sand/Dirt	scalar	Visual*	NONE	VLITE	---
Appearance	scalar	Visual*	NORML	▲ WGOIL	---
Odor	scalar	Visual*	NORML	NORML	---
Emulsified Water	scalar	Visual*	>0.2	▲ 1%	---
Free Water	scalar	Visual*		▲ >10%	---

SAMPLE IMAGES

	method	limit/base	current	history1	history2
Color				no image	no image
Bottom				no image	no image



OIL ANALYSIS REPORT

GRAPHS



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0953981
Lab Number : 02648271
Unique Number : 5813823
Test Package : TEST (Additional Tests: SPAT)

COCA COLA CANADA BOTTLING LTD.
 15 WEST CREEK BLVD
 BRAMPTON, ON
 CA L6T 5T4
 Contact: Chandan Ahuja
 cahuja@cokecanada.com
 T: (635)440-5087
 F:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.