


# **OIL ANALYSIS REPORT**

## Sample Rating Trend





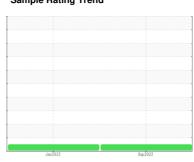

# DAC-1 SUMP

Component

Gearbox

MOBIL DTE OIL HVY MEDIUM (--- GAL)

#### DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

#### Wear

All component wear rates are normal.

#### Contamination

The water content is negligible. There is no indication of any contamination in the oil.

## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

			Jan 2022	Sep 2022	<u> </u>	
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		RP0024267	RP0024340	
Sample Date		Client Info		25 Sep 2022	24 Jan 2022	
Machine Age	hrs	Client Info		0	0	
Oil Age	hrs	Client Info		0	0	
Oil Changed		Client Info		N/A	N/A	
Sample Status				NORMAL	NORMAL	
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>200	32	12	
Chromium	ppm	ASTM D5185m	>15	<1	<1	
Nickel	ppm	ASTM D5185m	>15	0	0	
Titanium	ppm	ASTM D5185m		0	0	
Silver	ppm	ASTM D5185m		0	<1	
Aluminum	ppm	ASTM D5185m	>25	<1	<1	
Lead	ppm	ASTM D5185m	>100	<1	0	
Copper	ppm	ASTM D5185m	>200	25	19	
Tin	ppm	ASTM D5185m	>25	0	<1	
Antimony	ppm	ASTM D5185m			0	
Vanadium	ppm	ASTM D5185m		0	0	
Cadmium	ppm	ASTM D5185m		0	0	
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0	18	
Barium	ppm	ASTM D5185m		0	0	
Molybdenum	ppm	ASTM D5185m		0	0	
Manganese	ppm	ASTM D5185m		<1	<1	
Magnesium	ppm	ASTM D5185m		50	43	
Calcium	ppm	ASTM D5185m		<1	8	
Phosphorus	ppm	ASTM D5185m		5	100	
Zinc	ppm	ASTM D5185m		2	0	
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>50	<1	<1	
Sodium	ppm	ASTM D5185m		0	0	
Potassium	ppm	ASTM D5185m	>20	1	0	
Water	%	ASTM D6304	>0.2	0.016	0.006	
ppm Water	ppm	ASTM D6304	>2000	168.4	64.6	
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2

Acid Number (AN)

mg KOH/g ASTM D8045

0.24

0.37



# **OIL ANALYSIS REPORT**







Laboratory Sample No. Lab Number **Unique Number** 

Test Package : IND 2

: RP0024267 : 05650417 : 10149969

To discuss this sample report, contact Customer Service at 1-800-237-1369.

: WearCheck USA - 501 Madison Ave., Cary, NC 27513 Received Diagnosed Diagnostician

: 26 Sep 2022 : 28 Sep 2022 : Jonathan Hester

**ENGIE-MATEP** 474 BROOKLINE AVE BOSTON, MA US 02215

Contact: ROBERT ST SAUVEUR robert.stsauveur@engie.com T: (401)651-9381

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation. Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: