

PROBLEM SUMMARY

Sample Rating Trend

WEAR




Machine Id **50871296 (S/N 13773)**

Hydraulic System

MOBIL DTE 24 (--- GAL)

COMPONENT CONDITION SUMMARY

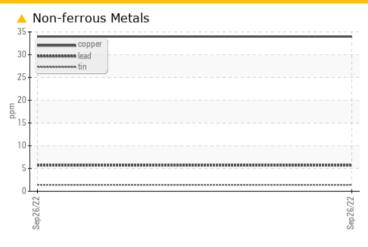

RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS								
Sample Status				ABNORMAL				
Copper	ppm	ASTM D5185m	>20	4 34				

Customer Id: TECGRENC Sample No.: WC0731053 Lab Number: 05651437 Test Package: PLANT

To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

RECOMMENDED ACTIONS

There are no recommended actions for this sample.

HISTORICAL DIAGNOSIS



OIL ANALYSIS REPORT

Sample Rating Trend

WEAR

Machine Id **50871296 (S/N 13773)**

Hydraulic System

Fluid

MOBIL DTE 24 (--- GAL)

DIAGNOSIS

Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

A Wear

The copper level is abnormal. All other component wear rates are normal.

Contamination

The amount and size of particulates present in the system are acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.


				Sep 2022		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0731053		
Sample Date		Client Info		26 Sep 2022		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	16		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	6		
Copper	ppm	ASTM D5185m	>20	<u> </u>		
Tin	ppm	ASTM D5185m	>20	1		
Vanadium	ppm	ASTM D5185m	>20	0		
Cadmium		ASTM D5185m		0		
	ppm					
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		0		
Barium	ppm	ASTM D5185m		3		
Molybdenum	ppm	ASTM D5185m		0		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		2		
Calcium	ppm	ASTM D5185m		122		
Phosphorus	ppm	ASTM D5185m		516		
Zinc	ppm	ASTM D5185m		761		
Sulfur	ppm	ASTM D5185m		3825		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185m	>15	3		
Sodium	ppm	ASTM D5185m		<1		
Potassium	ppm	ASTM D5185m	>20	2		
FLUID CLEANLIN	NESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	924		
Particles >6µm		ASTM D7647	>1300	78		
Particles >14μm		ASTM D7647	>160	5		
Particles >21µm		ASTM D7647	>40	1		
Particles >38µm		ASTM D7647	>10	1		
Particles >71µm		ASTM D7647		0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	17/13/10		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
				333		

Acid Number (AN) mg KOH/g ASTM D8045

0.91



OIL ANALYSIS REPORT

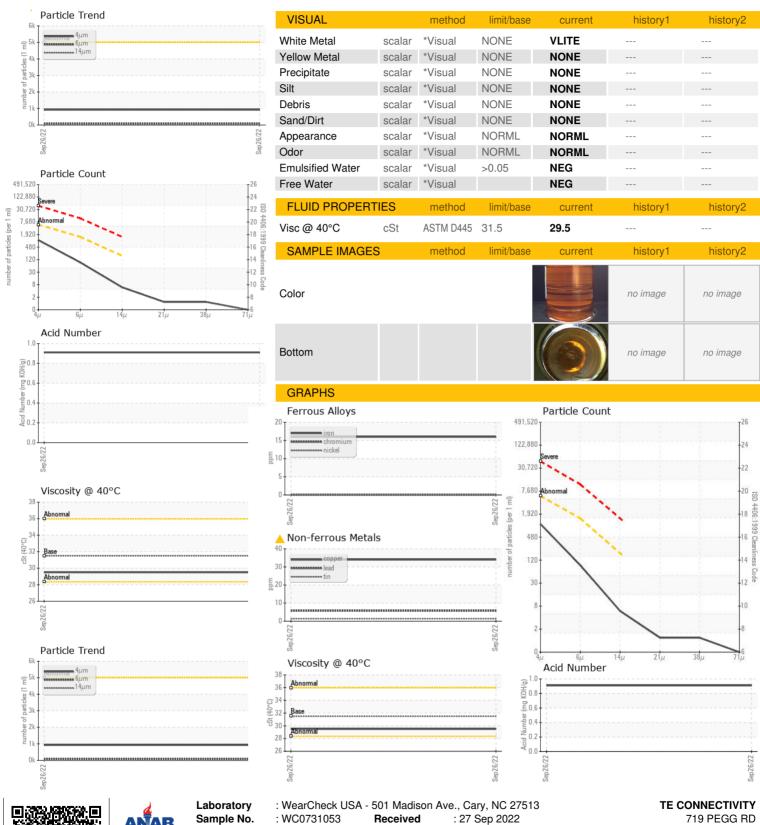





Certificate L2367

Sample No. Lab Number Unique Number

: 05651437 : 10150989

: WC0731053 Test Package : PLANT

Received Diagnosed Diagnostician

: 28 Sep 2022 : Angela Borella

719 PEGG RD GREENSBORO, NC US 27409 Contact: BILLIE WALLACE

billie.wallace@te.com

T:

To discuss this sample report, contact Customer Service at 1-800-237-1369. * - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

F: