

# **PROBLEM SUMMARY**

Sample Rating Trend


**WEAR** 

Machine Id **50499520 (S/N 13185)** 

**Hydraulic System** 

MOBIL DTE 24 (--- GAL)

### **COMPONENT CONDITION SUMMARY**

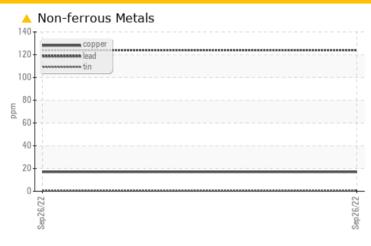

### RECOMMENDATION

No corrective action is recommended at this time. Resample at the next service interval to monitor.

PROBLEMATIC TEST RESULTS										
Sample Status				ABNORMAL						
Lead	ppm	ASTM D5185m	>20	<b>124</b>						

**Customer Id: TECGRENC** Sample No.: WC0731067 Lab Number: 05651449 Test Package: PLANT



To manage this report scan the QR code

To discuss the diagnosis or test data: Angela Borella +1 800-237-1369 angela.borella@wearcheckusa.com

To change component or sample information: Customer Service +1 1-800-237-1369 customerservice@wearcheck.com

## RECOMMENDED ACTIONS

There are no recommended actions for this sample.

## HISTORICAL DIAGNOSIS



# **OIL ANALYSIS REPORT**

Sample Rating Trend

WEAR

50499520 (S/N 13185)

Component

Hydraulic System

MOBIL DTE 24 (--- GAL)

# DIAGNOSIS

### Recommendation

No corrective action is recommended at this time. Resample at the next service interval to monitor.

#### A Waar

The iron level is abnormal. All other component wear rates are normal.

### Contamination

The amount and size of particulates present in the system are acceptable.

### **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is acceptable for the time in service.


				Sep 2022		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0731067		
Sample Date		Client Info		26 Sep 2022		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				ABNORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185m	>20	12		
Chromium	ppm	ASTM D5185m	>20	0		
Nickel	ppm	ASTM D5185m	>20	0		
Titanium	ppm	ASTM D5185m		0		
Silver	ppm	ASTM D5185m		0		
Aluminum	ppm	ASTM D5185m	>20	<1		
Lead	ppm	ASTM D5185m	>20	<u> </u>		
Copper	ppm	ASTM D5185m	>20	17		
Tin	ppm	ASTM D5185m	>20	<1		
Vanadium	ppm	ASTM D5185m		0		
Cadmium	ppm	ASTM D5185m		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185m		<1		
Barium	ppm	ASTM D5185m		2		
Molybdenum	ppm	ASTM D5185m		1		
Manganese	ppm	ASTM D5185m		<1		
Magnesium	ppm	ASTM D5185m		11		
Calcium	ppm	ASTM D5185m		105		
Phosphorus	ppm	ASTM D5185m		204		
Zinc	ppm	ASTM D5185m		267		
Sulfur	ppm	ASTM D5185m		1326		
CONTAMINANTS		method	limit/base		hiotonyt	hiotory
				current	history1	history2
Silicon	ppm	ASTM D5185m	>15	2		
Sodium	ppm	ASTM D5185m		0		
Potassium	ppm	ASTM D5185m	>20	1		
FLUID CLEANLIN	IESS	method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	2040		
Particles >6µm		ASTM D7647	>1300	174		
Particles >14μm		ASTM D7647	>160	5		
Particles >21µm		ASTM D7647	>40	1		
Particles >38µm		ASTM D7647	>10	0		
Particles >71μm		ASTM D7647	>3	0		
Oil Cleanliness		ISO 4406 (c)	>19/17/14	18/15/10		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Acid Number (AN)	ma K∩U/a	VCTM DOUVE		0.27		

Acid Number (AN) mg KOH/g ASTM D8045

0.37



## **OIL ANALYSIS REPORT**

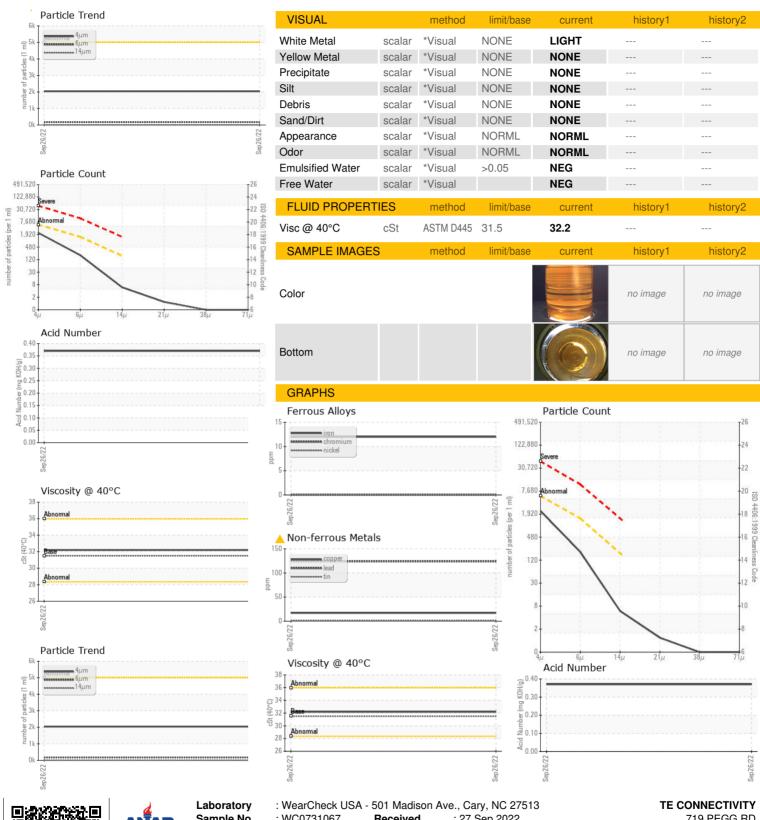





Certificate L2367

Sample No. Lab Number Unique Number Test Package

: 05651449 : 10151001

: WC0731067 : PLANT

Received : 27 Sep 2022 Diagnosed Diagnostician

: 28 Sep 2022 : Angela Borella

To discuss this sample report, contact Customer Service at 1-800-237-1369.

\* - Denotes test methods that are outside of the ISO 17025 scope of accreditation.

Statements of conformity to specifications are based on the simple acceptance decision rule (JCGM 106:2012)

719 PEGG RD

GREENSBORO, NC US 27409

Contact: BILLIE WALLACE

billie.wallace@te.com

T: F: